

Atlantic Municipal Airport

PAVEMENT MANAGEMENT REPORT



PREPARED BY

Applied Pavement Technology, Inc.
115 West Main Street, Suite 400
Urbana, Illinois 61801
(217) 398-3977
www.appliedpavement.com

JULY 2021



The preparation of this document was financed in part through an Airport Improvement Program grant from the Federal Aviation Administration (Project Number 3-19-0000-027-2020) as provided under Section 505 of the Airport and Airway Improvement Act of 1982, as amended. The contents do not necessarily reflect the DOT's official views or the policy of the FAA. Acceptance of this report by the FAA does not in any way constitute a commitment on the part of the United States to participate in any development depicted therein nor does it indicate the proposed development is environmentally acceptable in accordance with appropriate public laws.

ATLANTIC MUNICIPAL AIRPORT PAVEMENT MANAGEMENT REPORT

Prepared For:

Iowa Department of Transportation
Aviation Bureau
800 Lincoln Way
Ames, Iowa 50010
515-239-1691



<https://iowadot.gov/aviation/>

Prepared By:

Applied Pavement Technology, Inc.
115 West Main Street, Suite 400
Urbana, Illinois 61801
217-398-3977



<https://www.appliedpavement.com>

In Association With:

Robinson Engineering Company
Consulting Engineers
819 Second Street NE
Independence, Iowa 50644
319-334-7211



TABLE OF CONTENTS

INTRODUCTION	1
PAVEMENT INVENTORY	3
PAVEMENT EVALUATION.....	6
Pavement Evaluation Procedure	6
Pavement Evaluation Results.....	7
Inspection Comments	12
Runways.....	12
Taxiways.....	12
Apron	12
T-Hangars	12
PAVEMENT MAINTENANCE AND REHABILITATION PROGRAM	14
Analysis Parameters.....	14
Critical PCIs.....	14
Localized Preventive Maintenance Policies and Unit Costs.....	14
Major Rehabilitation Unit Costs	14
Budget and Inflation Rate	14
Analysis Approach.....	14
Analysis Results.....	15
General Maintenance Recommendations	16
FAA Requirements (Public Law 103-305).....	16
SUMMARY	21

LIST OF FIGURES

Figure 1. Pavement condition versus cost of repair.....	1
Figure 2. Pavement area by branch use at Atlantic Municipal Airport.	4
Figure 3. Atlantic Municipal Airport network definition map.	5
Figure 4. Visual representation of PCI scale on typical pavement surfaces.	6
Figure 5. PCI versus repair type.	7
Figure 6. Pavement area by PCI range at Atlantic Municipal Airport.....	8
Figure 7. Area-weighted PCI by branch use at Atlantic Municipal Airport.	8
Figure 8. Atlantic Municipal Airport PCI map.....	9

LIST OF TABLES

Table 1. 2020 pavement evaluation results.....	10
Table 2. 5-year M&R program under an unlimited funding analysis scenario.	15
Table 3. Pavement inspection report.....	19

APPENDIXES

Appendix A. Cause of Distress Tables	A-1
Appendix B. Inspection Photographs	B-1
Appendix C. Inspection Report.....	C-1
Appendix D. Work History Report.....	D-1
Appendix E. Localized Preventive Maintenance Policies and Unit Cost Tables	E-1
Appendix F. Year 2021 Localized Preventive Maintenance Details	F-1


INTRODUCTION

Applied Pavement Technology, Inc. (APTech), with assistance from Robinson Engineering Company, updated the Airport Pavement Management System (APMS) for the Iowa Department of Transportation, Aviation Bureau (Iowa DOT). The APMS provides a means to monitor the condition of the pavements within the state of Iowa and to proactively plan for their preservation.

As part of this project, pavement conditions at Atlantic Municipal Airport were assessed in November 2020 using the Pavement Condition Index (PCI) procedure. During a PCI inspection, the types, severities, and amounts of distress present in a pavement are quantified. This information is then used to develop a composite index that represents the overall condition of the pavement in numerical terms, ranging from 0 (failed) to 100 (excellent). The PCI provides an overall measure of condition and an indication of the level of work that will be required to maintain or repair a pavement. The distress information also provides insight into what is causing the pavement to deteriorate, which is the first step in selecting the appropriate repair action to correct the problem.

Programmed into an APMS, PCI information is used to determine when preventive maintenance actions (such as crack or joint sealing) are advisable and to identify the most cost-effective time to perform major rehabilitation (such as an overlay or whitetopping). Delaying maintenance and rehabilitation (M&R) until a pavement structure has seriously degraded can cost many times more than if M&R was applied earlier in a pavement's life cycle, as shown in Figure 1. From a safety perspective, pavement distresses, such as cracks and loose debris, may pose risks in terms of the potential for aircraft tire damage and the ability of a pilot to safely control aircraft.

Figure 1. Pavement condition versus cost of repair.

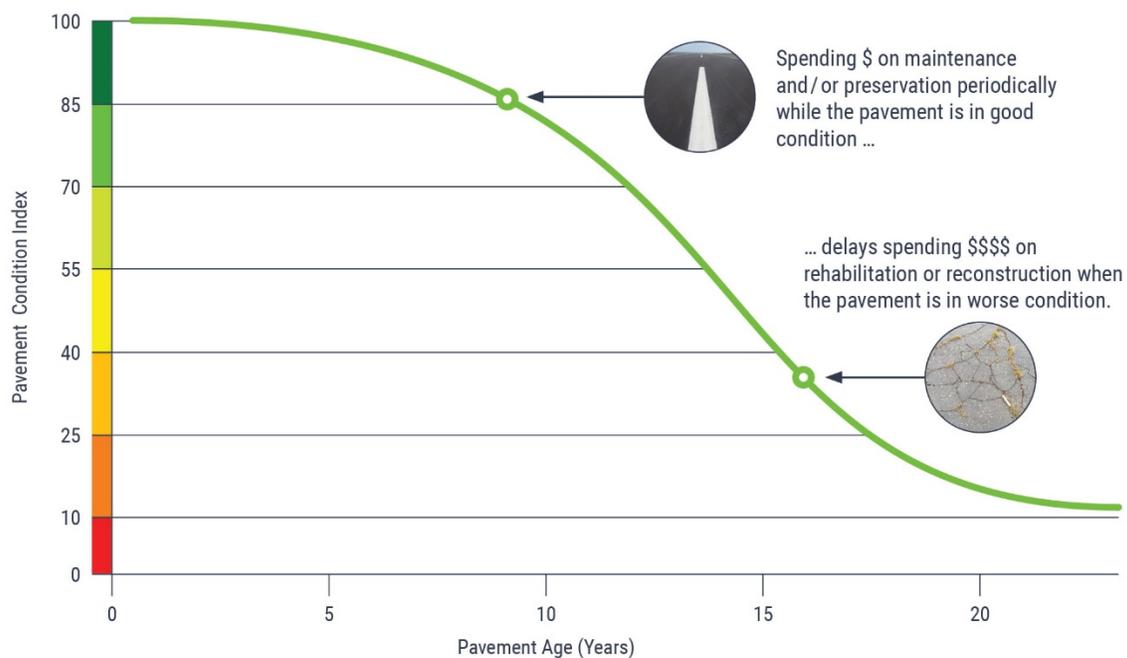

The pavement evaluation results for Atlantic Municipal Airport are presented within this report and can be used by Atlantic Municipal Airport, the Iowa DOT and the Federal Aviation Administration (FAA) to identify, prioritize, and schedule pavement M&R actions at the airport.

In addition to this report, the interactive pavement management data visualization tool IDEA, containing the pavement management information collected during this project, was updated and may be accessed from the Iowa DOT's website (<https://iowadot.gov/aviation>).

PAVEMENT INVENTORY

The project began with a review of the existing inventory information pertaining to the pavements at Atlantic Municipal Airport. The date of original construction, along with the date of any subsequent rehabilitation; the location of completed work; and the type of work undertaken were gathered. The information was used to update the pavement management database and associated maps as necessary to account for pavement-related work that had been undertaken since the last time the airport was evaluated in 2017.

The pavement network at Atlantic Municipal Airport was then divided into branches, sections, and sample units. A branch is a single entity that serves a distinct function. For example, a runway is considered a branch because it serves a single function (allowing aircraft to take off and land). Taxiways, aprons, and T-hangars are also separate branches.

Each branch was further divided into sections. Traditionally, sections are defined as parts of the branch that share common attributes, such as cross-section, date of last construction, traffic level, and performance. Using this approach, if a runway was built in 1968 and then extended in 1984, it would contain two separate sections.

To estimate the overall condition of a pavement section, each section was subdivided into sample units. Portions of these sample units were evaluated during the pavement inspection, and the collected information was extrapolated to predict the overall section condition and quantities of distress.

Approximately 1,010,700 square feet of pavement were evaluated at Atlantic Municipal Airport, as illustrated in Figure 2. This figure also shows the area-weighted age, in years of the pavements, at the time of the inspection. Figure 3 provides a map that details how the pavement network was divided into management units and identifies the sample units that were evaluated during the pavement inspection at Atlantic Municipal Airport.

Figure 2. Pavement area by branch use at Atlantic Municipal Airport.


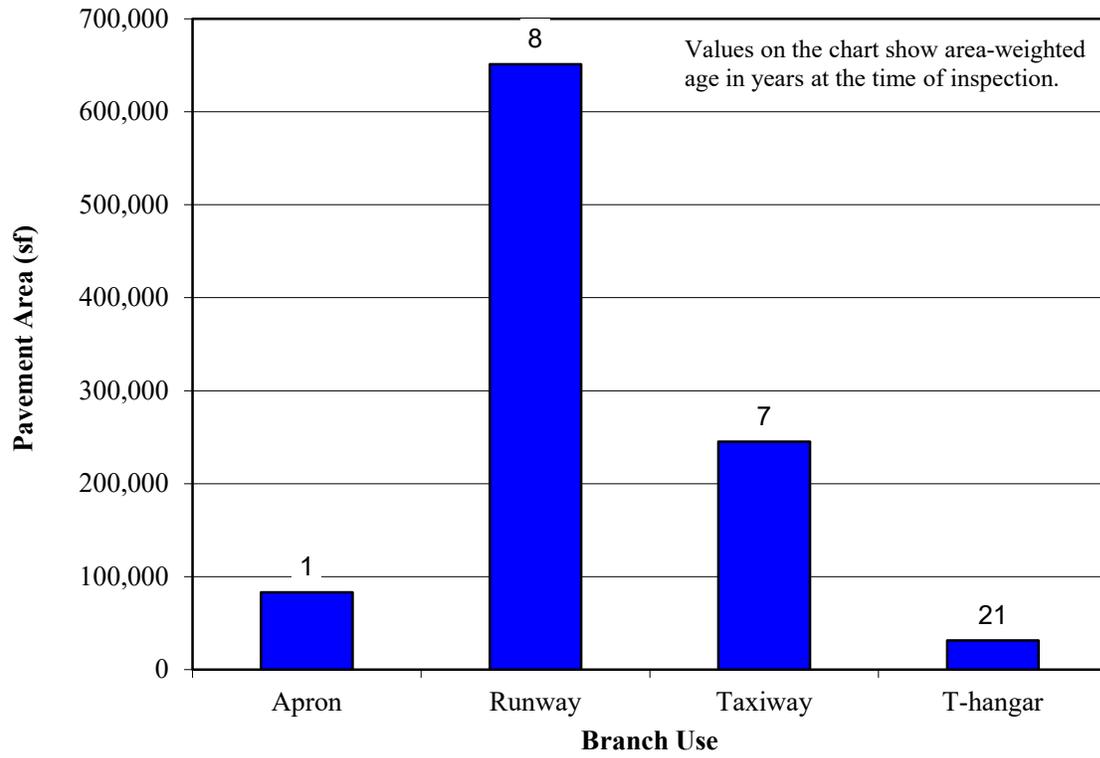


FIGURE 3. NETWORK DEFINITION MAP.

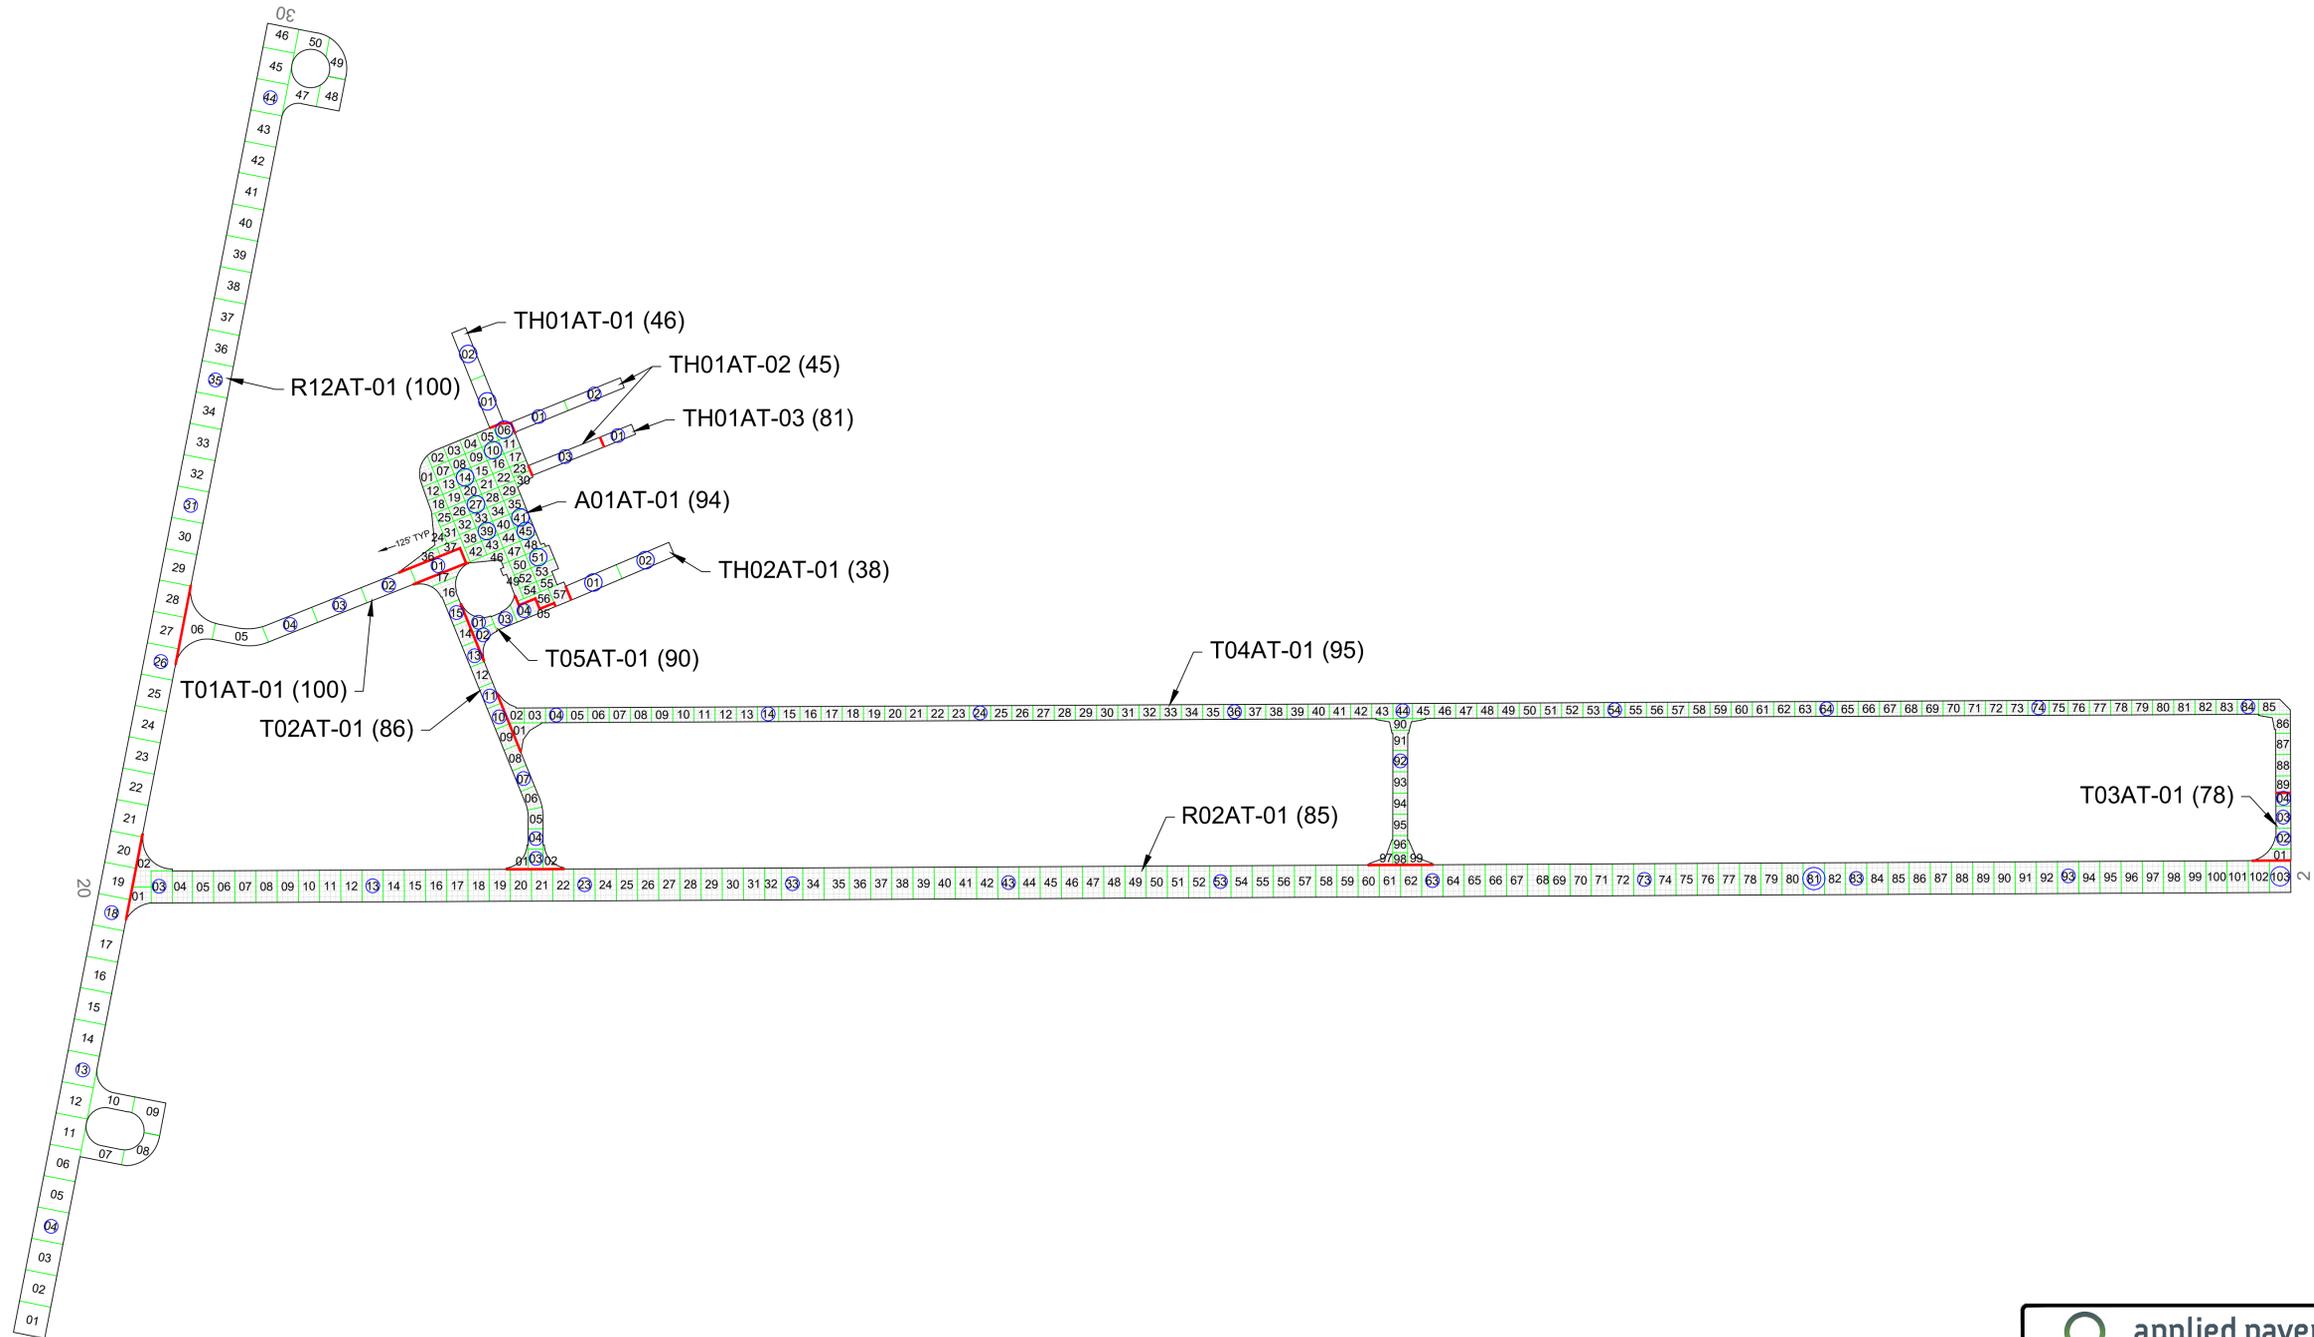

NETWORK DEFINITION LEGEND

	BRANCH IDENTIFIER
	SECTION IDENTIFIER
	PCI VALUE
	SECTION BREAK LINE
	SAMPLE UNIT BREAK LINE
	SLAB JOINT
	SAMPLE UNIT NUMBER
	SAMPLE UNIT INSPECTED
	ADDITIONAL SAMPLE UNIT

applied pavement TECHNOLOGY
 115 W. Main Street, Suite 400
 Urbana, IL 61801
 Tel: (217) 398-3977
 Fax: (217) 398-4027

AGENCY: Iowa Department of Transportation			
Aviation Bureau			
LOCATION: Atlantic Municipal Airport			
Atlantic, Iowa			
PAGE TITLE: Network Definition Map			
PROJECT DATE: SEP. 2020	CREATION DATE: SEP. 2020	PROJECT MANAGER: LJR	JOB NUMBER: 2017-020-AM04
DRAWING SCALE: 1"=200'	LAST MODIFIED DATE: MAR. 2021	REVISED BY: ABF	DRAWN BY: DSP
FILENAME: Atlantic.dwg	LAYOUT NAME/NUMBER: NET. DEF.	PAGE NUMBER: 5	

PAVEMENT EVALUATION

Pavement Evaluation Procedure

APTech inspected the pavements at Atlantic Municipal Airport using the PCI procedure described in:

- FAA Advisory Circular 150/5380-6C, *Guidelines and Procedures for Maintenance of Airport Pavements* (https://www.faa.gov/documentLibrary/media/Advisory_Circular/150-5380-6C.pdf).
- FAA Advisory Circular 150/5380-7B, *Airport Pavement Management Program (PMP)* (https://www.faa.gov/documentLibrary/media/Advisory_Circular/150-5380-7B.pdf).
- ASTM D5340-20, *Standard Test Method for Airport Pavement Condition Index Surveys*.

The PCI provides a numerical indication of overall pavement condition, as illustrated in Figure 4. The types and amounts of deterioration are used to calculate the PCI of the section. The PCI ranges from a value of 0, which represents a pavement in a failed condition, to a value of 100, which represents a pavement in excellent condition. It is important to note that factors other than overall PCI need to be considered when identifying the appropriate type of repair, including types of distress present and rate of deterioration. Also, since the PCI does not assess the structural integrity or capacity of the pavement structure, further testing may be needed to validate and refine the treatment strategy.

Figure 4. Visual representation of PCI scale on typical pavement surfaces.



Note: Photographs shown are not specific to Atlantic Municipal Airport.

Generally, pavements with relatively high PCIs that are not exhibiting significant load-related distress will benefit from preventive maintenance actions, such as crack sealing or joint resealing. As the PCI drops, the pavements may require major rehabilitation, such as an overlay or whitetopping. In some situations where the PCI has dropped low enough, reconstruction may be the only viable alternative due to the substantial damage to the pavement structure. Figure 5 illustrates how the appropriate repair type varies with the PCI of a pavement section and provides the corresponding colors used for the maps and charts in this report for each range of PCIs.

Figure 5. PCI versus repair type.

PCI Range	Repair
86-100	Preventive Maintenance
71-85	
56-70	
41-55	Major Rehabilitation
26-40	Reconstruction
11-25	
0-10	

The types of distress identified during the PCI inspection provide insight into the cause of pavement deterioration which in turn helps in selecting a rehabilitation alternative that corrects the cause and thus eliminates or delays its recurrence. PCI distress types are characterized as load-related (such as alligator cracking on asphalt-surfaced pavements or shattered slabs on portland cement concrete [PCC] pavements), climate/durability-related (such as weathering [a climate-related distress type on asphalt-surfaced pavements] and durability cracking [a durability-related distress type on PCC pavements]), and other (distress types that cannot be attributed solely to load or climate/durability).

Appendix A identifies the distress types considered during a PCI inspection and describes the likely cause of each distress type. It should be noted that a PCI is based on visual signs of pavement deterioration and does not provide a measure of structural capacity.

Pavement Evaluation Results

The pavements at Atlantic Municipal Airport were inspected in November 2020. The 2020 area-weighted condition of Atlantic Municipal Airport is 91, with conditions ranging from 38 to 100 (on a scale of 0 [failed] to 100 [excellent]). During the previous pavement inspection in 2017, the area-weighted PCI of the airport was 75.

Figure 6 summarizes the overall condition of the pavements at Atlantic Municipal Airport, and Figure 7 presents area-weighted condition (average PCI adjusted to account for the relative size of the pavement sections) by branch use. Figure 8 is a map that displays the condition of the evaluated pavements. Table 1 summarizes the results of the pavement evaluation. Appendix B presents photographs taken during the PCI inspection, and Appendix C contains detailed information on the distresses observed during the visual survey. Appendix D includes detailed work history information that was collected during the record review process.

Figure 6. Pavement area by PCI range at Atlantic Municipal Airport.

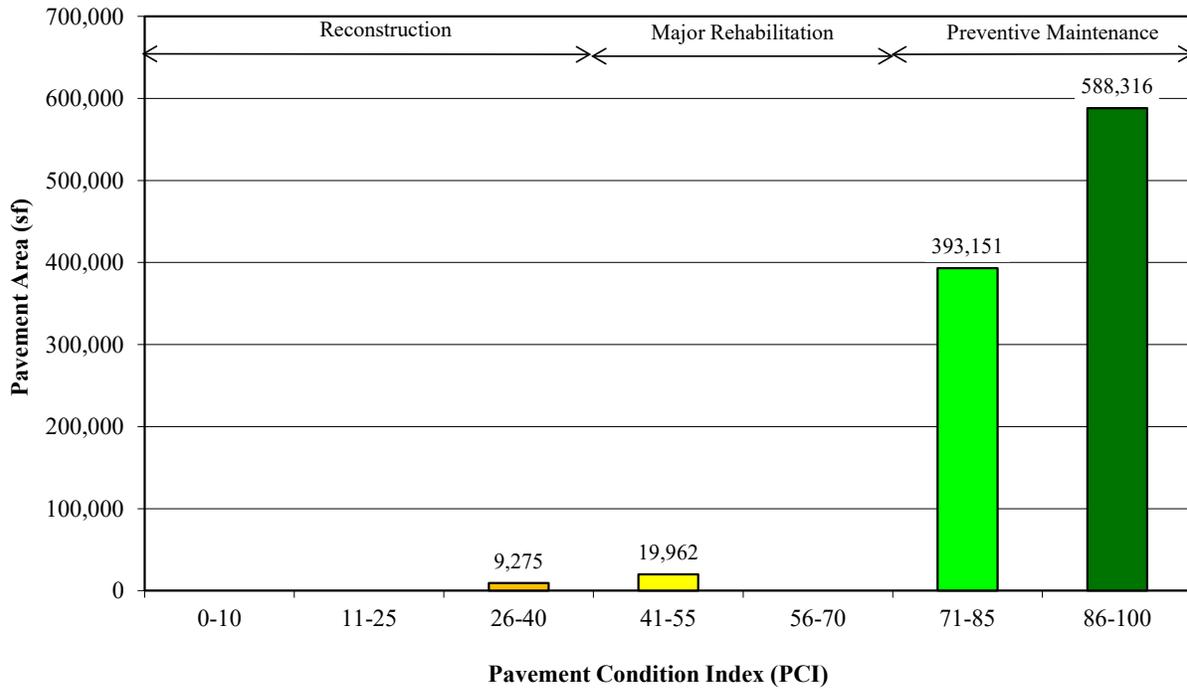


Figure 7. Area-weighted PCI by branch use at Atlantic Municipal Airport.

(Values on chart are area-weighted)


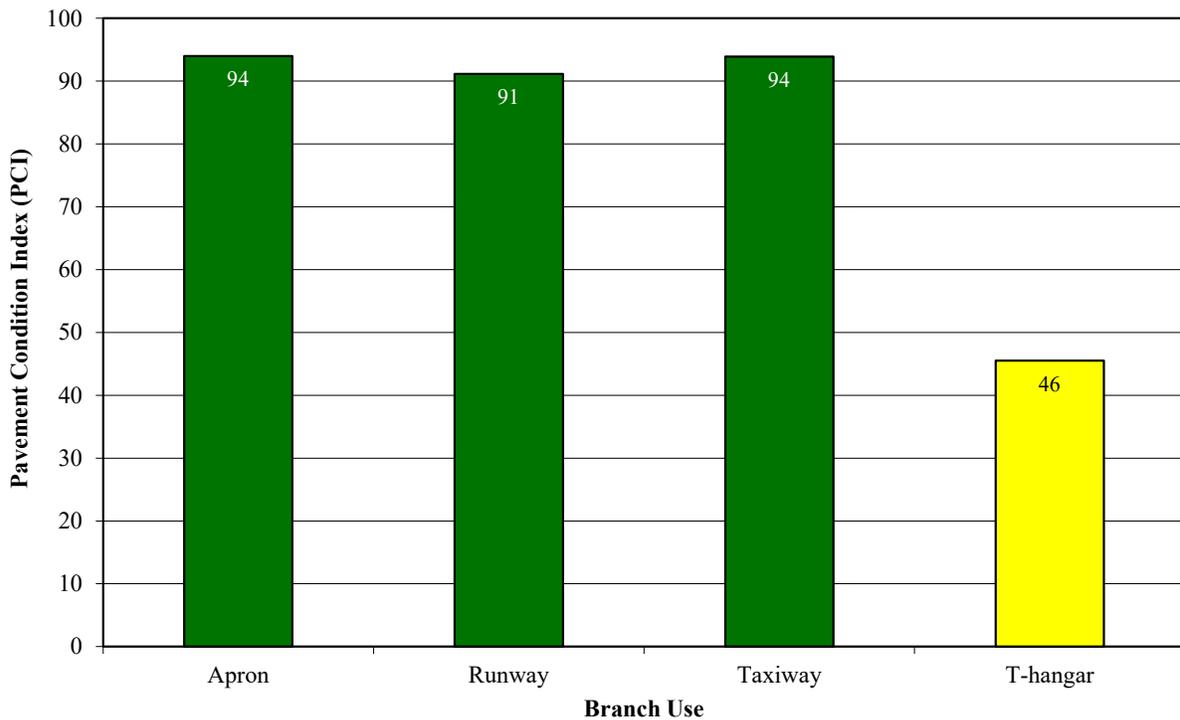


FIGURE 8. PCI MAP.

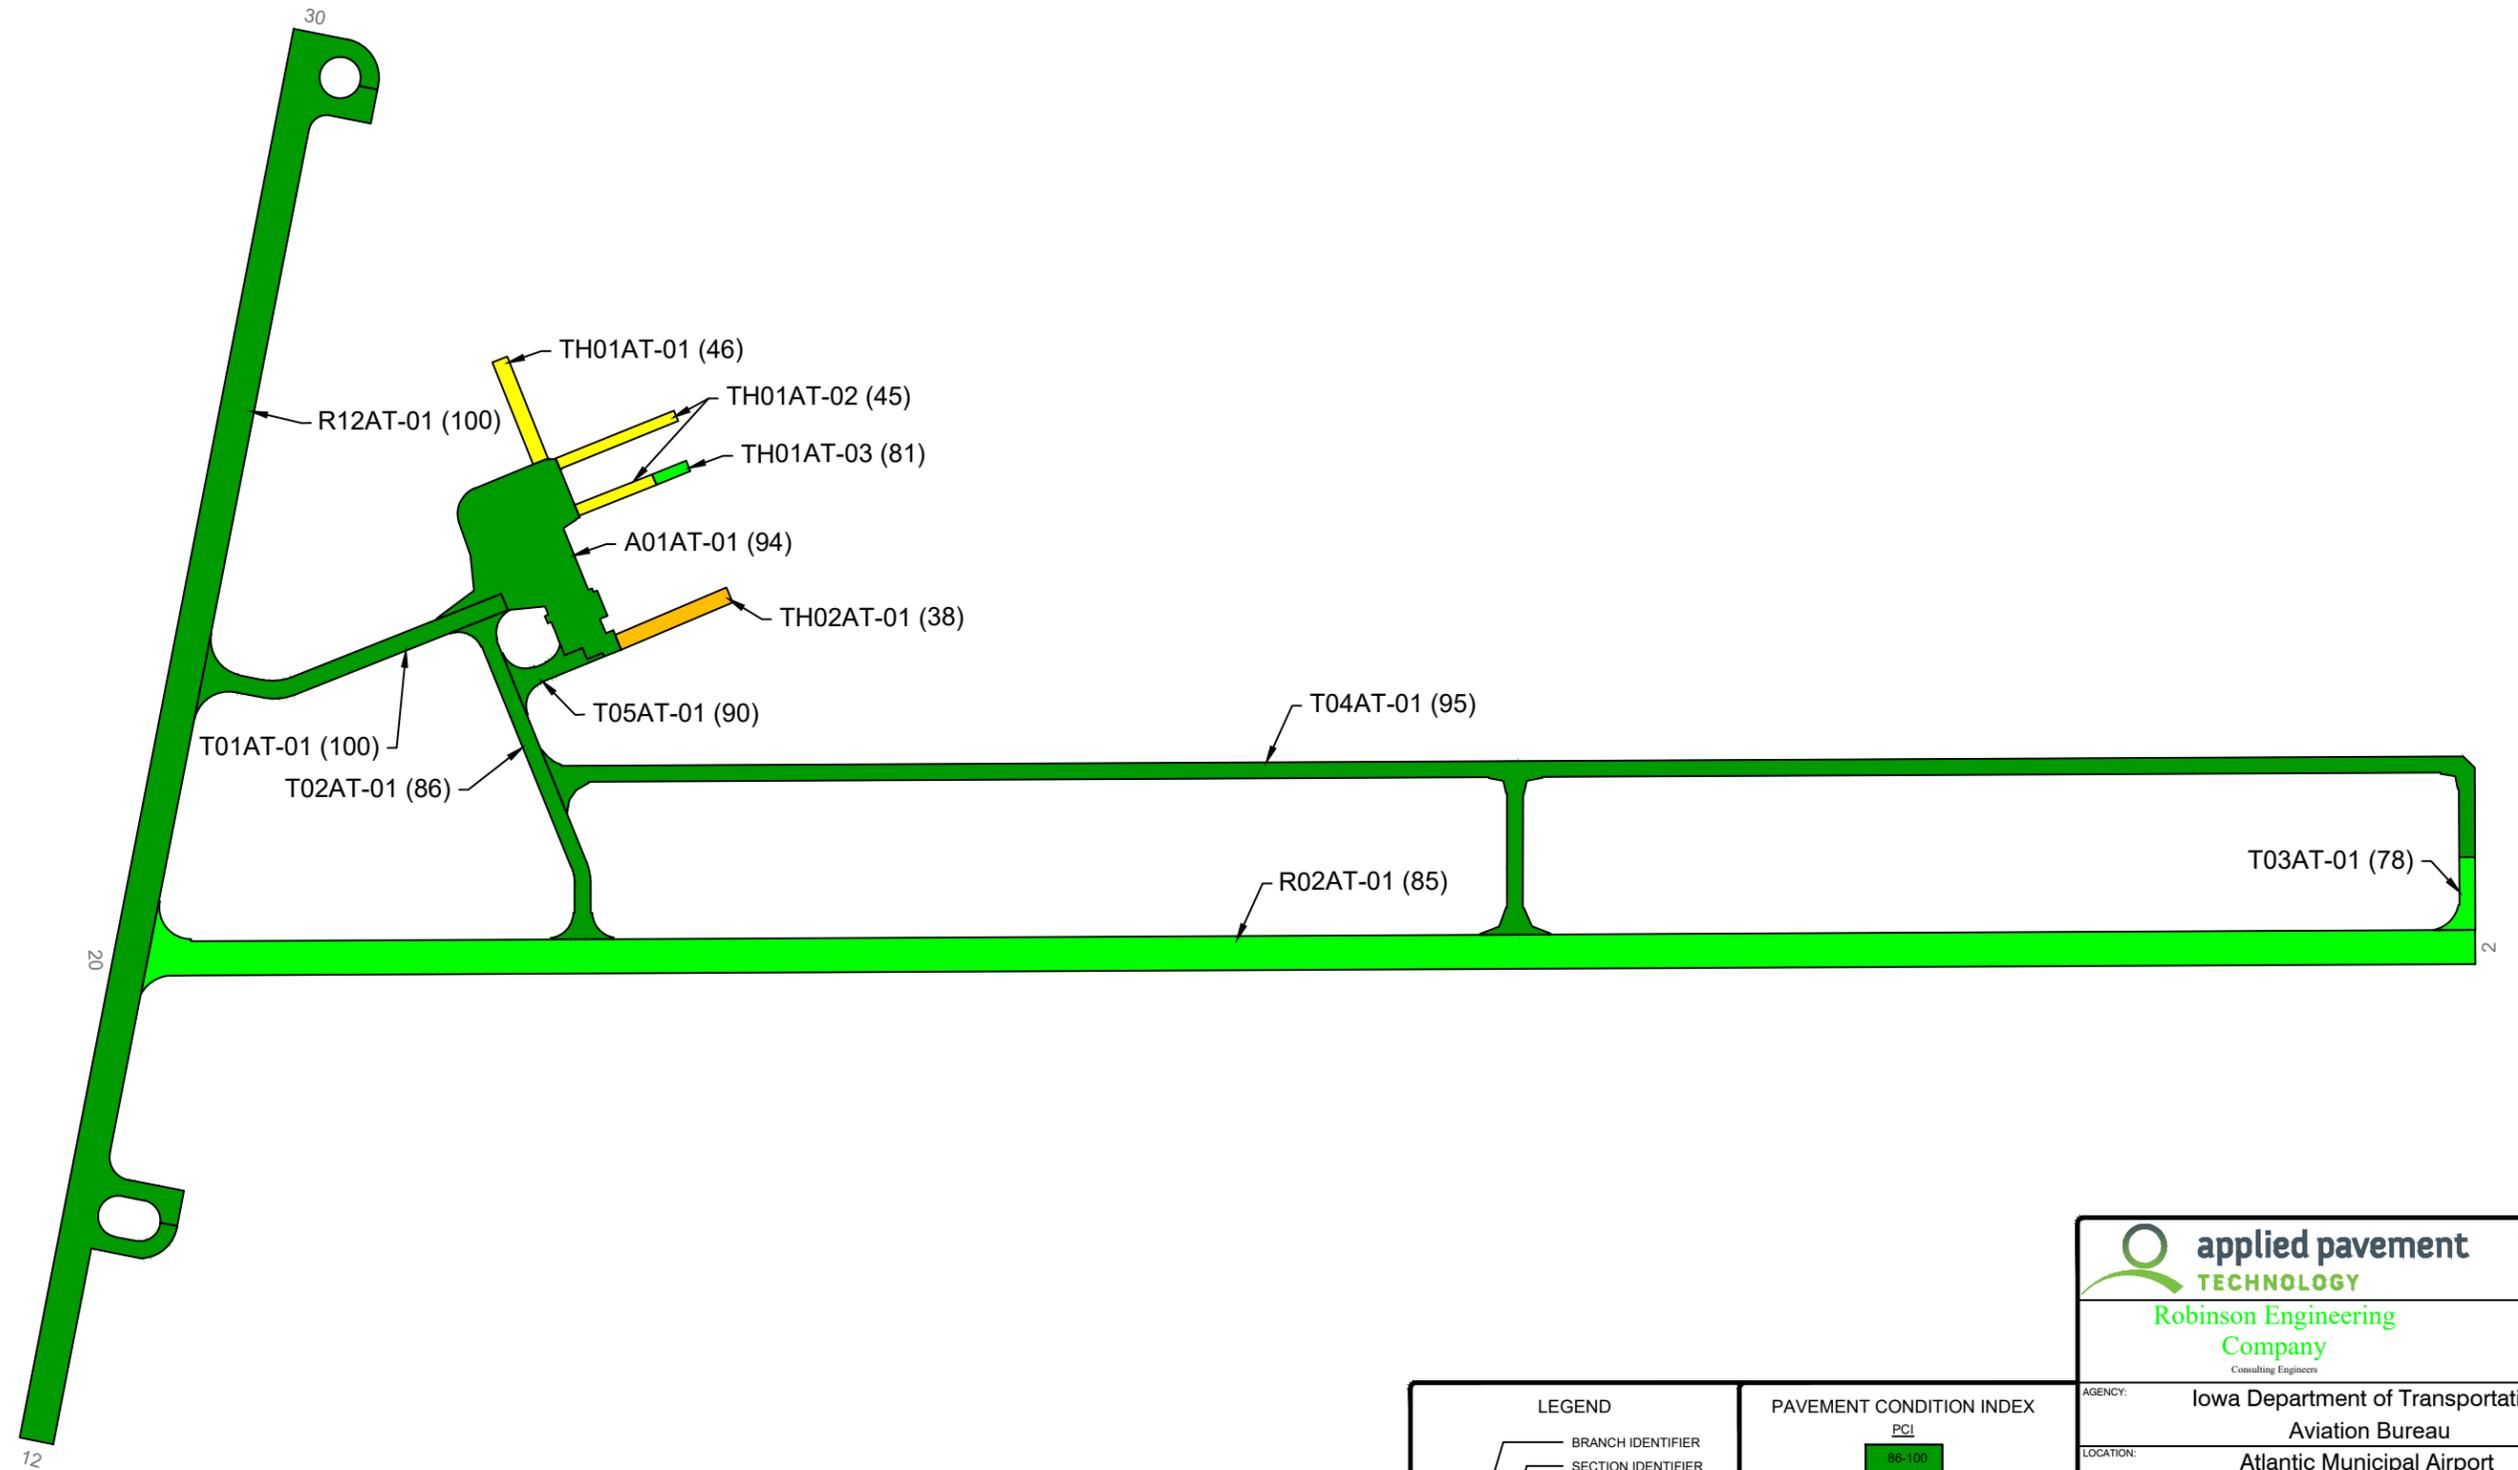

LEGEND

	BRANCH IDENTIFIER
	SECTION IDENTIFIER
	PCI VALUE
	SECTION BREAK LINE

PAVEMENT CONDITION INDEX

PCI
86-100
71-85
56-70
41-55
26-40
11-25
0-10

		115 W. Main Street, Suite 400 Urbana, IL 61801 Tel: (217) 398-3977 Fax: (217) 398-4027	
		322 1st Street East Independence, IA 50844 Tel: (319) 334-7211	
AGENCY: Iowa Department of Transportation Aviation Bureau			
LOCATION: Atlantic Municipal Airport Atlantic, Iowa			
PAGE TITLE: 2020 Pavement Condition Index Map			
PROJECT DATE: SEP. 2020	CREATION DATE: SEP. 2020	PROJECT MANAGER: LJR	JOB NUMBER: 2017-020-AM04
DRAWING SCALE: 1" = 400'	LAST MODIFIED DATE: MAR. 2021	REVISED BY: ABF	DRAWN BY: DSP
FILENAME: Atlantic.dwg		LAYOUT NAME/NUMBER: PCI	PAGE NUMBER: 9

Table 1. 2020 pavement evaluation results.

Branch	Section	Surface Type	Section Area (sf)	LCD	2020 PCI	% Distress Due to Load	% Distress Due to Climate/Durability	% Distress Due to Other	Type of Distresses
A01AT	01	PCC	83,176	4/15/2019	94	89	0	11	Joint Spalling, LTD Cracking
R02AT	01	PCC	384,590	11/1/2006	85	32	52	16	Corner Break, Corner Spalling, Faulting, Joint Seal Damage, Joint Spalling, LTD Cracking, Shattered Slab, Shrinkage Cracking, Small Patch
R12AT	01	AAC	266,480	11/12/2020	100	0	0	0	No Distress
T01AT	01	AAC	29,270	11/12/2020	100	0	0	0	No Distress
T02AT	01	PCC	29,405	11/1/2006	86	0	75	25	Faulting, Joint Seal Damage, Joint Spalling, Shrinkage Cracking
T03AT	01	PCC	6,561	11/1/2006	78	4	41	55	Corner Break, Corner Spalling, Faulting, Joint Seal Damage, Small Patch
T04AT	01	PCC	171,675	6/3/2013	95	75	25	0	Joint Seal Damage, LTD Cracking
T05AT	01	PCC	8,310	6/3/2013	90	0	71	29	Corner Spalling, Joint Seal Damage, Joint Spalling, Shrinkage Cracking, Small Patch
TH01AT	01	AC	8,400	1/1/2000	46	33	65	2	Alligator Cracking, Depression, L&T Cracking, Raveling, Rutting, Weathering
TH01AT	02	AC	11,562	1/1/2000	45	32	68	0	Alligator Cracking, Depression, L&T Cracking, Raveling, Rutting, Weathering
TH01AT	03	PCC	2,000	1/1/2010	81	35	57	8	Joint Seal Damage, LTD Cracking, Shrinkage Cracking
TH02AT	01	AC	9,275	1/1/1994	38	45	55	0	Alligator Cracking, L&T Cracking, Raveling, Rutting, Weathering

Table 1. 2020 pavement evaluation results (continued).

Table Notes:

1. See Figure 3 for the location of the branch and section.
2. Surface Type: AC = asphalt cement concrete; AAC = asphalt overlay on AC; PCC = portland cement concrete; APC = asphalt overlay on PCC.
3. LCD = last construction date.
4. Distress due to load includes distress types that are attributed to a structural deficiency in the pavement, such as alligator cracking or rutting on asphalt-surfaced pavements or shattered slabs on PCC pavements.
5. Distress due to climate or durability includes distress types that are attributed to either the aging of the pavement and the effects of the environment (such as weathering, raveling, or block cracking on asphalt-surfaced pavements) or to a materials-related problem (such as durability cracking or alkali-silica reaction [ASR] on PCC pavements). If materials-related distresses were recorded during the inspection, further laboratory testing is required to definitively determine the type present.
6. Distress due to other refers to distress types that are not attributed to one factor but rather may be caused by a combination of factors.
7. Distress types are defined by ASTM D5340-20. L&T Cracking = Longitudinal and Transverse Cracking; LTD Cracking = Longitudinal, Transverse, and Diagonal Cracking; ASR = Alkali-Silica Reaction.

Inspection Comments

Atlantic Municipal Airport was inspected on November 14, 2020. There were twelve pavement sections defined during the inspection.

Runways

Runway 02/20 was defined by one section that had shrinkage cracking; low-severity corner break, faulting, and small patching; medium-severity corner spalling and joint spalling; and low-severity longitudinal, transverse, and diagonal (LTD) cracking. Significant amounts of high-severity joint seal damage were also recorded throughout the pavement area where joint sealant had significantly deteriorated or was missing. An atypical area of low-severity shattered slab and medium-severity LTD cracking was also identified and recorded as an additional sample unit, according to ASTM D5340-20.

Runway 12/30 contained one recently rehabilitated section that was in excellent condition, with no distresses observed during the inspection.

Taxiways

Taxiway 01 consisted of one recently rehabilitated section that was in excellent condition. No distresses were noted at the time of the inspection.

Taxiway 02 was defined by one section. Shrinkage cracking, low-severity faulting and joint spalling, and high-severity joint seal damage were recorded in Section 01.

Taxiway 03 contained one section with low-severity corner break and small patching, medium-severity corner spalling, low- and medium-severity faulting, and high-severity joint seal damage were observed during the inspection.

Taxiway 04 was defined by one section in excellent condition. An isolated area of medium-severity LTD cracking was observed in Section 01, along with low-severity joint seal damage noted throughout.

Taxiway 05 consisted of one section. Areas of shrinkage cracking, low-severity joint spalling and small patching, low- and medium-severity corner spalling, and medium-severity joint seal damage were recorded in Section 01.

Apron

The apron area was defined by one, recently rehabilitated section in which low-severity joint spalling and LTD cracking were identified.

T-Hangars

T-hangar 01 contained three sections. Low-severity depression and rutting, medium-severity weathering, medium- and high-severity raveling, low- and medium-severity alligator cracking, and all severities of longitudinal and transverse (L&T) cracking were observed in Section 01. Section 02 was in similar condition with low-severity depression and rutting, medium-severity weathering, low- and medium-severity alligator cracking and raveling, and all severities of L&T cracking recorded at the time of inspection. In both sections, the low- and medium-severity L&T cracking were unsealed, with the medium-severity cracking noted where unsealed crack widths exceeded ¼ in. The high-severity L&T cracking was identified where secondary cracking wider

than 1 ft had developed. In Section 03, small amounts of shrinkage cracking and low-severity LTD cracking were recorded, along with high-severity joint seal damage that was observed throughout.

T-hangar 02 was defined by one section in poor condition. Section 01 had areas of low-severity rutting and medium-severity alligator cracking, raveling, and weathering. All severities of L&T cracking were also recorded during the inspection. The low-severity L&T cracking was identified in unsealed condition, while the medium-severity L&T cracking was recorded where either unsealed crack widths exceeded $\frac{1}{4}$ in or secondary cracking had developed. The high-severity L&T cracking was recorded where secondary cracking wider than 1 ft had developed.

PAVEMENT MAINTENANCE AND REHABILITATION PROGRAM

Using the information collected during the pavement inspection, the PAVER pavement management software was used to develop a 5-year M&R program for Atlantic Municipal Airport. In addition, a 1-year plan for localized preventive maintenance (such as crack sealing and patching) was prepared.

Analysis Parameters

Critical PCIs

PAVER uses critical PCIs to determine whether localized preventive maintenance or major rehabilitation is the appropriate repair action. Above the critical PCI, localized preventive maintenance activities are recommended. Below the critical PCI, major rehabilitation actions, such as an overlay or reconstruction, are recommended. The Iowa DOT set the critical PCIs at 65 for runways, 60 for taxiways, and 55 for aprons and T-hangars.

Localized Preventive Maintenance Policies and Unit Costs

Localized preventive maintenance policies were developed for asphalt-surfaced and PCC pavements. These policies, shown in Appendix E, identify the localized preventive maintenance actions that the Iowa DOT considered appropriate to correct for the different distress types and severities. The Iowa DOT provided unit costs for each of the localized preventive maintenance actions included in these policies, and these costs are detailed in Appendix E. Please note that this information is of a general nature for the entire state. The localized preventive maintenance policies and unit costs may require adjustment to reflect specific conditions at Atlantic Municipal Airport.

Major Rehabilitation Unit Costs

PAVER estimates the cost of major rehabilitation based on the predicted PCI of the pavement section. The Iowa DOT provided the costs for major rehabilitation and they are presented in Appendix E. If major rehabilitation is recommended in the 5-year program, further engineering investigation will be needed to identify the most appropriate rehabilitation action and to more accurately estimate the cost of such work.

Budget and Inflation Rate

An unlimited budget with a start date of July 1, 2021 and an inflation rate of 1.4 percent was used during the analysis.

Analysis Approach

The 5-year M&R program was prepared with the goal of maintaining the pavements above established critical PCIs. During this analysis, major rehabilitation was recommended for pavements in the year they dropped below their critical PCI. For the first year (2021) of the analysis only, a localized preventive maintenance plan was developed for those pavement sections that were above their critical PCI. If major rehabilitation was triggered for a section in 2022 or 2023, then localized preventive maintenance was not recommended for 2021. While localized preventive maintenance should be an annual undertaking at Atlantic Municipal Airport, it is not possible to accurately predict the propagation of cracking and other distress types. Therefore, the airport should budget for maintenance every year and can use the 2021 localized

preventive maintenance plan as a baseline for that work. As the pavements age, it can be assumed that the amount of localized preventive maintenance required will increase.

Analysis Results

A summary of the M&R program for Atlantic Municipal Airport is presented in Table 2. Detailed information on the recommended localized preventive maintenance plan for 2021 is provided in Appendix F.

Table 2. 5-year M&R program under an unlimited funding analysis scenario.

Year	Branch	Section	Surface Type	Type of Repair	Estimated Cost
2021	R02AT	01	PCC	Localized Maintenance	\$164,572
2021	T02AT	01	PCC	Localized Maintenance	\$13,753
2021	T03AT	01	PCC	Localized Maintenance	\$3,212
2021	T04AT	01	PCC	Localized Maintenance	\$1,286
2021	T05AT	01	PCC	Localized Maintenance	\$3,703
2021	TH01AT	01	AC	Major Rehabilitation	\$66,554
2021	TH01AT	02	AC	Major Rehabilitation	\$97,700
2021	TH01AT	03	PCC	Localized Maintenance	\$606
2021	TH02AT	01	AC	Major Rehabilitation	\$92,843

Total Estimated Cost: \$444,000

Table Notes:

1. See Figure 3 for the location of the branch and section.
2. Surface Type: AC = asphalt cement concrete; AAC = asphalt overlay on AC; PCC = portland cement concrete; APC = asphalt overlay on PCC.
3. Type of Repair: Major Rehabilitation such as pavement reconstruction or an overlay; Localized Preventive Maintenance such as crack sealing or patching.
4. The estimated costs provided are of a general nature for the entire state and may require adjustment to reflect specific conditions at Atlantic Municipal Airport.

The recommendations made in this report are based on a broad network-level analysis and meant to provide Atlantic Municipal Airport with an indication of the type of pavement-related work required during the next 5 years. Further engineering investigation may be necessary to identify which repair action is most appropriate. In addition, the cost estimates provided are based on overall unit costs for the entire state, and Atlantic Municipal Airport should adjust the plan to reflect local costs.

Because an unlimited budget was used in the analysis, it is possible that the pavement repair program may need to be adjusted to consider economic or operational constraints. The identification of a project need does not necessarily mean that state or federal funding will be available in the year it is indicated. It is important to remember that regardless of the recommendations presented within this report, Atlantic Municipal Airport is responsible for repairing pavements where existing conditions pose a hazard to safe operations.

General Maintenance Recommendations

In addition to the specific maintenance actions presented in Appendix F, it is recommended that the following strategies be considered for prolonging pavement life:

1. Regularly inspect all safety areas of the airport and document all inspection activity. A sample form that can be used to perform these inspections is provided in Table 3 of this report.
2. Provide a method of tracking all maintenance activities that occur as a result of inspections. These need to be reported to the FAA and the Iowa DOT. This information is used to update the APMS records and is required to remain in compliance with Public Law 103-305 (see the next section of this report for further information on this law).
3. Conduct an aggressive campaign against weed growth through timely herbicide applications and mowing programs of the safety areas. Vegetation growth in pavement cracks is destructive and significantly increases the rate of pavement deterioration.
4. Implement a periodic crack and joint sealing program. Keeping water and debris out of the pavement system by sealing cracks and joints is a proven and cost-effective method of extending the life of the pavement system.
5. Ensure that dirt does not build up along the edges of the pavements. This can create a “bathtub” effect, reducing the ability of water to drain away from the pavement system.
6. Closely monitor the movement of heavy equipment (particularly farming, construction, and fueling equipment) to make sure it is only operating on pavements that are designed to accommodate heavy loads. Failure to restrict heavy equipment to appropriate areas may result in the premature failure of airport pavements.

FAA Requirements (Public Law 103-305)

Because Atlantic Municipal Airport is in the National Plan of Integrated Airport Systems (NPIAS), the airport sponsor is required to keep the airport in a viable operating condition. This includes maintaining airport pavements in accordance with Public Law 103-305. Public Law 103-305 states that after January 1, 1995, NPIAS airport sponsors must provide assurances or certifications that an airport has implemented an effective airport pavement maintenance management system (PMMS) before the airport will be considered for federal funding of pavement replacement or reconstruction projects. To be in full compliance with the federal law, the PMMS must include the following components at minimum: pavement inventory, pavement inspections, record keeping, information retrieval, and program funding.

This report serves as a complete pavement inventory and detailed inspection. To remain in compliance with the law, Atlantic Municipal Airport will also need to undertake monthly drive-by inspections of pavement conditions and track pavement-related maintenance activities.

FAA Advisory Circular 150/5380-7B provides detailed guidance pertaining to the requirements for an acceptable pavement management program (PMP). Appendix A of the FAA Advisory Circular 150/5380-7B outlines what needs to be included in a PMP to remain in compliance with this law and Grant Assurance #11. Following is a copy of this Appendix, along with instructions for supplementing this report so that all requirements are met. Note that the italicized words are direct quotations from the FAA Advisory Circular.

FAA Advisory Circular 150/5830-7B, Appendix A. Pavement Management Program (PMP)

A-1.0. *An effective PMP specifies the procedures to follow to assure that proper preventative and remedial pavement maintenance is performed. The program should identify funding or anticipated funding and other resources available to provide remedial and preventive maintenance activities. An airport sponsor may use any format deemed appropriate, but the program needs to, as a minimum, include the following:*

A-1.1. Pavement Inventory. *The following must be depicted:*

- a. *Identification of all runways, taxiways, and aprons with pavement broken down into sections each having similar properties.*

The network definition map provided in Figure 3 of this report shows the location of all runways, taxiways, aprons, and T-hangars at *Atlantic Municipal Airport*. If any new pavements are constructed or any pavement areas are permanently closed, this map must be updated. Project plans should be submitted to the Iowa DOT after project completion.

- b. *Dimensions of pavement sections.*

The dimensions of all runways, taxiways, aprons, and T-hangars are stored in the PAVER database. Appendix C provides information on length, width, and area. In addition, the network definition map (Figure 3) is drawn to scale. Any changes to pavement dimensions must be recorded.

- c. *Type of pavement surface.*

The type of pavement for each section at *Atlantic Municipal Airport* is listed in Table 1 of this report and is also stored in the PAVER database. Any changes to pavement type (through an overlay or reconstruction) must be recorded.

- d. *Year of construction and/or most recent major rehabilitation.*

Dates for pavement construction, rehabilitation, or reconstruction must be recorded. The current pavement history for *Atlantic Municipal Airport* is provided in Appendix D of this report.

- e. *Whether AIP [Airport Improvement Program] or PFC [Passenger Facility Charge] funds were used to construct, reconstruct, or repair the pavement.*

Funding sources for all pavement projects should be recorded.

A-1.2. PMP Pavement Inspection Schedule. *Airports must perform a detailed inspection of airfield pavements at least once a year for the PMP. If a pavement condition index (PCI) survey is performed, as set forth in ASTM D5340, Standard Test Method for Airport Pavement Condition Index Surveys, the frequency of the detailed inspection by PCI surveys may be extended to three years. Less comprehensive routine daily, weekly, and monthly maintenance inspections required for operations should be addressed.*

This report consists of a detailed inspection that will extend the inspection period to 3 years. It is the airport sponsor's responsibility to perform monthly drive-by inspections. A sample pavement inspection report form is provided in Table 3 of this report.

A-1.3. Record Keeping. *The airport must record and keep on file complete information about all detailed inspections and maintenance performed until the pavement system is replaced. The types of distress, their locations, and remedial action, scheduled or performed, must be documented. The minimum information recorded includes:*

- a. *Inspection date*
- b. *Location*
- c. *Distress types*
- d. *Maintenance scheduled or performed*

Items a through c are satisfied by this inspection report. Item d is the responsibility of the airport, as is record keeping of the monthly drive-by inspections.

A-1.4. Information Retrieval. *An airport sponsor may use any form of record keeping it deems appropriate so long as the information and records from the pavement survey can generate required reports, as necessary.*

Keep this report, monthly drive-by inspection reports, construction updates, and all records of maintenance activities in a readily accessible location so that they can be easily retrieved as requested by the FAA.

Table 3. Pavement inspection report.

Inspected By: _____

Date Inspected: _____

Branch	Section	Distress Description/Dimensions/Severity/ Recommended Action	Description of Repair	Date Performed	Cost	Funding Source
A01AT	01					
R02AT	01					
R12AT	01					
T01AT	01					
T02AT	01					
T03AT	01					

Table 3. Pavement inspection report (continued).

Inspected By: _____

Date Inspected: _____

Branch	Section	Distress Description/Dimensions/Severity/ Recommended Action	Description of Repair	Date Performed	Cost	Funding Source
T04AT	01					
T05AT	01					
TH01AT	01					
TH01AT	02					
TH01AT	03					
TH02AT	01					

Table Notes:

1. See Figure 3 for the location of the branch and section.

SUMMARY

This report documents the results of the pavement evaluation conducted at Atlantic Municipal Airport. A visual inspection of the pavements in 2020 found that the overall condition of the pavement network is a PCI of 91. A 5-year pavement repair program, shown in Table 2, was generated for Atlantic Municipal Airport, which revealed that approximately \$444,000 needs to be expended on M&R. Atlantic Municipal Airport should utilize these study results to assist in planning for future maintenance needs as part of the airport CIP planning process.

APPENDIX A

CAUSE OF DISTRESS TABLES

Table A-1. Cause of pavement distress, asphalt-surfaced pavements.

Distress Type	Probable Cause of Distress
Alligator Cracking	Fatigue failure of the asphalt surface under repeated traffic loading.
Bleeding	Excessive amounts of asphalt cement or tars in the mix or low air void content, or both.
Block Cracking	Shrinkage of the asphalt and daily temperature cycling; it is not load associated.
Corrugation	Traffic action combined with an unstable pavement layer.
Depression	Settlement of the foundation soil or can be “built up” during construction.
Jet-Blast Erosion	Bituminous binder has been burned or carbonized.
Joint Reflection Cracking	Movement of the concrete slab beneath the asphalt surface due to thermal and moisture changes.
L&T Cracking	Cracks may be caused by (1) a poorly constructed paving lane joint, (2) shrinkage of the asphalt surface due to low temperatures or hardening of the asphalt, or (3) reflective cracking caused by cracks in an underlying PCC slab.
Oil Spillage	Deterioration or softening of the pavement surface caused by the spilling of oil, fuel, or other solvents.
Patching	N/A
Polished Aggregate	Repeated traffic applications.
Raveling	Asphalt binder may have hardened significantly, causing coarse aggregate pieces to dislodge.
Rutting	Usually caused by consolidation or lateral movement of the materials due to traffic loads.
Shoving	Where PCC pavements adjoin flexible pavements, PCC “growth” may shove the asphalt pavement.
Slippage Cracking	Low strength surface mix or poor bond between the surface and the next layer of the pavement structure.
Swelling	Usually caused by frost action or by swelling soil.
Weathering	Asphalt binder and/or fine aggregate may wear away as the pavement ages and hardens.

Table A-2. Cause of pavement distress, PCC pavements.

Distress Type	Probable Cause of Distress
ASR	Chemical reaction of alkalis in the portland cement with certain reactive silica minerals. ASR may be accelerated by the use of chemical pavement deicers.
Blowup	Incompressible materials in the joints.
Corner Break	Load repetition combined with loss of support and curling stresses.
Durability Cracking	Concrete's inability to withstand environmental factors such as freeze-thaw cycles.
Faulting	Upheaval or consolidation.
Joint Seal Damage	Stripping of joint sealant, extrusion of joint sealant, weed growth, hardening of the filler (oxidation), loss of bond to the slab edges, or absence of sealant in the joint.
LTD Cracking	Combination of load repetition, curling stresses, and shrinkage stresses.
Patching (Small and Large)	N/A
Popouts	Freeze-thaw action in combination with expansive aggregates.
Pumping	Poor drainage, poor joint sealant.
Scaling	Over finishing of concrete, deicing salts, improper construction, freeze-thaw cycles, and poor aggregate.
Shattered Slab	Load repetition.
Shrinkage Cracking	Setting and curing of the concrete.
Spalling (Joint and Corner)	Excessive stresses at the joint caused by infiltration of incompressible materials or traffic loads; weak concrete at the joint combined with traffic loads.

APPENDIX B

INSPECTION PHOTOGRAPHS

A01AT-01. Overview.



A01AT-01. Joint Spalling (Sample Unit No. 14).



A01AT-01. LTD Cracking (Sample Unit No. 41).



R02AT-01. Overview.



R02AT-01. Joint Seal Damage (Sample Unit No. 103).



R02AT-01. LTD Cracking (Additional Sample Unit No. 81).



R02AT-01. LTD Cracking (Sample Unit No. 93).



R12AT-01. Overview.



T01AT-01. Overview.



T02AT-01. Overview.



T02AT-01. Faulting (Sample Unit No. 03).



T02AT-01. Joint Seal Damage (Sample Unit No. 03).



T03AT-01. Overview.



T03AT-01. Faulting (Sample Unit No. 01).



T03AT-01. Joint Seal Damage (Sample Unit No. 02).



T04AT-01. Overview.



T04AT-01. LTD Cracking (Sample Unit No. 36).



T05AT-01. Overview.



T05AT-01. Joint Seal Damage (Sample Unit No. 04).



TH01AT-01. Overview.



TH01AT-01. L&T Cracking (Sample Unit No. 02).



TH01AT-01. Weathering (Sample Unit No. 02).



TH01AT-02. Overview.



TH01AT-02. L&T Cracking (Sample Unit No. 02).



TH01AT-02. Weathering (Sample Unit No. 02).



TH01AT-03. Overview.



TH01AT-03. Joint Seal Damage (Sample Unit No. 01).



TH01AT-03. LTD Cracking (Sample Unit No. 01).



TH02AT-01. Overview.



TH02AT-01. Alligator Cracking (Sample Unit No. 02).



TH02AT-01. L&T Cracking (Sample Unit No. 02).



TH02AT-01. Weathering (Sample Unit No. 02).



APPENDIX C

INSPECTION REPORT

Re-inspection Report

IA 2020

Report Generated Date: April 08, 2021

Network: AIO Name: ATLANTIC MUNICIPAL AIRPORT

Branch: A01AT Name: APRON Use: APRON Area: 83,176.00SqFt

Section: 01 of 1 From: BUILDINGS To: TAXIWAY 01 Last Const.: 04/15/2019
Surface: PCC Family: IowaPCCAPSC Zone: Category: Rank: P
Area: 83,176.00SqFt Length: 500.00Ft Width: 250.00Ft
Slabs: 1,729 Slab Width: 8.50Ft Slab Length: 8.50Ft Joint Length: 28,661.76Ft
Shoulder: Street Type: Grade: 0.00 Lanes: 0

Section Comments:

Last Insp. Date: 11/14/2020 Total Samples: 57 Surveyed: 8

Conditions: PCI : 94

Inspection Comments:

Sample Number: 06 Type: R Area: 20.00Slabs PCI = 100

Sample Comments:
<NO DISTRESSES>

Sample Number: 10 Type: R Area: 20.00Slabs PCI = 100

Sample Comments:
<NO DISTRESSES>

Sample Number: 14 Type: R Area: 20.00Slabs PCI = 94

Sample Comments:
74 JOINT SPALLING L 4.00 Slabs Comments:

Sample Number: 27 Type: R Area: 20.00Slabs PCI = 86

Sample Comments:
63 LINEAR CRACKING L 4.00 Slabs Comments:

Sample Number: 39 Type: R Area: 20.00Slabs PCI = 100

Sample Comments:
<NO DISTRESSES>

Sample Number: 41 Type: R Area: 20.00Slabs PCI = 86

Sample Comments:
63 LINEAR CRACKING L 4.00 Slabs Comments:

Sample Number: 45 Type: R Area: 20.00Slabs PCI = 86

Sample Comments:
63 LINEAR CRACKING L 4.00 Slabs Comments:

Sample Number: 51 Type: R Area: 28.00Slabs PCI = 100

Sample Comments:
<NO DISTRESSES>

Re-inspection Report

IA 2020

Report Generated Date: April 08, 2021

Network: AIO Name: ATLANTIC MUNICIPAL AIRPORT

Branch: R02AT Name: RUNWAY 02/20 Use: RUNWAY Area: 384,590.00SqFt

Section: 01 of 1 From: RUNWAY 02 APPROACH To: RUNWAY 20 APPROACH Last Const.: 11/01/2006
Surface: PCC Family: IowaPCCRWSC_General Zone: Category: Rank: P
Area: 384,590.00SqFt Length: 5,100.00Ft Width: 75.00Ft
Slabs: 2,448 Slab Width: 12.50Ft Slab Length: 12.50Ft Joint Length: 56,025.00Ft
Shoulder: Street Type: Grade: 0.00 Lanes: 0

Section Comments:

Last Insp. Date: 11/14/2020 Total Samples: 103 Surveyed: 12

Conditions: PCI: 85

Inspection Comments:

Sample Number: 03 Type: R Area: 24.00Slabs PCI = 88
Sample Comments:
65 JOINT SEAL DAMAGE H 24.00 Slabs Comments:

Sample Number: 13 Type: R Area: 24.00Slabs PCI = 82
Sample Comments:
65 JOINT SEAL DAMAGE H 24.00 Slabs Comments:
73 SHRINKAGE CRACKING N 1.00 Slabs Comments:
71 FAULTING L 2.00 Slabs Comments:

Sample Number: 23 Type: R Area: 24.00Slabs PCI = 88
Sample Comments:
65 JOINT SEAL DAMAGE H 24.00 Slabs Comments:

Sample Number: 33 Type: R Area: 24.00Slabs PCI = 88
Sample Comments:
65 JOINT SEAL DAMAGE H 24.00 Slabs Comments:

Sample Number: 43 Type: R Area: 24.00Slabs PCI = 88
Sample Comments:
65 JOINT SEAL DAMAGE H 24.00 Slabs Comments:

Sample Number: 53 Type: R Area: 24.00Slabs PCI = 83
Sample Comments:
65 JOINT SEAL DAMAGE H 24.00 Slabs Comments:
71 FAULTING L 2.00 Slabs Comments:

Sample Number: 63 Type: R Area: 24.00Slabs PCI = 88
Sample Comments:
65 JOINT SEAL DAMAGE H 24.00 Slabs Comments:

Sample Number: 73 Type: R Area: 24.00Slabs PCI = 85
Sample Comments:
65 JOINT SEAL DAMAGE H 24.00 Slabs Comments:
75 CORNER SPALLING M 1.00 Slabs Comments:

Sample Number: 81 Type: A Area: 24.00Slabs PCI = 45
Sample Comments:
63 LINEAR CRACKING L 1.00 Slabs Comments:
63 LINEAR CRACKING M 6.00 Slabs Comments:
72 SHATTERED SLAB L 1.00 Slabs Comments:
71 FAULTING L 1.00 Slabs Comments:

Re-inspection Report

IA 2020

Report Generated Date: April 08, 2021

65	JOINT SEAL DAMAGE	H	24.00	Slabs	Comments:
74	JOINT SPALLING	M	3.00	Slabs	Comments:

Sample Number: 83 Type: R Area: 24.00Slabs PCI = 80

Sample Comments:

63	LINEAR CRACKING	L	2.00	Slabs	Comments:
62	CORNER BREAK	L	1.00	Slabs	Comments:
65	JOINT SEAL DAMAGE	H	24.00	Slabs	Comments:

Sample Number: 93 Type: R Area: 24.00Slabs PCI = 82

Sample Comments:

65	JOINT SEAL DAMAGE	H	24.00	Slabs	Comments:
63	LINEAR CRACKING	L	2.00	Slabs	Comments:
66	SMALL PATCH	L	1.00	Slabs	Comments:

Sample Number: 103 Type: R Area: 24.00Slabs PCI = 88

Sample Comments:

65	JOINT SEAL DAMAGE	H	24.00	Slabs	Comments:
----	-------------------	---	-------	-------	-----------

Re-inspection Report

IA 2020

Report Generated Date: April 08, 2021

Network: AIO Name: ATLANTIC MUNICIPAL AIRPORT

Branch: R12AT Name: RUNWAY 12/30 Use: RUNWAY Area: 266,480.00SqFt

Section: 01 of 1 From: RUNWAY 12 APPROACH To: RUNWAY 30 APPROACH Last Const.: 11/12/2020
Surface: AAC Family: IowaAACRWSC&SW Zone: Category: Rank: S
Area: 266,480.00SqFt Length: 3,130.00Ft Width: 75.00Ft
Shoulder: Street Type: Grade: 0.00 Lanes: 0

Section Comments:

Last Insp. Date: 11/14/2020 Total Samples: 50 Surveyed: 7

Conditions: PCI: 100

Inspection Comments:

Sample Number: 04 Type: R Area: 5,625.00SqFt PCI = 100

Sample Comments:

<NO DISTRESSES>

Sample Number: 13 Type: R Area: 5,625.00SqFt PCI = 100

Sample Comments:

<NO DISTRESSES>

Sample Number: 18 Type: R Area: 5,625.00SqFt PCI = 100

Sample Comments:

<NO DISTRESSES>

Sample Number: 26 Type: R Area: 5,625.00SqFt PCI = 100

Sample Comments:

<NO DISTRESSES>

Sample Number: 31 Type: R Area: 5,625.00SqFt PCI = 100

Sample Comments:

<NO DISTRESSES>

Sample Number: 35 Type: R Area: 5,625.00SqFt PCI = 100

Sample Comments:

<NO DISTRESSES>

Sample Number: 44 Type: R Area: 5,625.00SqFt PCI = 100

Sample Comments:

<NO DISTRESSES>

Re-inspection Report

IA 2020

Report Generated Date: April 08, 2021

Network: AIO Name: ATLANTIC MUNICIPAL AIRPORT

Branch: T01AT Name: TAXIWAY 01 Use: TAXIWAY Area: 29,270.00SqFt

Section: 01 of 1 From: APRON To: RUNWAY 12/30 Last Const.: 11/12/2020
Surface: AAC Family: IowaAACTWSC&SW Zone: Category: Rank: P
Area: 29,270.00SqFt Length: 700.00Ft Width: 38.00Ft
Shoulder: Street Type: Grade: 0.00 Lanes: 0

Section Comments:

Last Insp. Date: 11/14/2020 Total Samples: 6 Surveyed: 4

Conditions: PCI : 100

Inspection Comments:

Sample Number: 01 Type: R Area: 4,750.00SqFt PCI = 100

Sample Comments:

<NO DISTRESSES>

Sample Number: 02 Type: R Area: 4,750.00SqFt PCI = 100

Sample Comments:

<NO DISTRESSES>

Sample Number: 03 Type: R Area: 4,750.00SqFt PCI = 100

Sample Comments:

<NO DISTRESSES>

Sample Number: 04 Type: R Area: 4,750.00SqFt PCI = 100

Sample Comments:

<NO DISTRESSES>

Re-inspection Report

IA 2020

Report Generated Date: April 08, 2021

Network: AIO Name: ATLANTIC MUNICIPAL AIRPORT

Branch: T02AT Name: TAXIWAY 02 Use: TAXIWAY Area: 29,405.00SqFt

Section: 01 of 1 From: R02AT-01 To: T01AT-01 Last Const.: 11/01/2006
Surface: PCC Family: IowaPCCTWSC_General Zone: Category: Rank: P
Area: 29,405.00SqFt Length: 735.00Ft Width: 35.00Ft
Slabs: 357 Slab Width: 8.75Ft Slab Length: 10.00Ft Joint Length: 4,742.50Ft
Shoulder: Street Type: Grade: 0.00 Lanes: 0

Section Comments:

Last Insp. Date: 11/14/2020 Total Samples: 17 Surveyed: 7

Conditions: PCI : 86

Inspection Comments:

Sample Number: 03 Type: R Area: 20.00Slabs PCI = 77

Sample Comments:

65 JOINT SEAL DAMAGE H 20.00 Slabs Comments:
71 FAULTING L 4.00 Slabs Comments:
74 JOINT SPALLING L 1.00 Slabs Comments:

Sample Number: 04 Type: R Area: 20.00Slabs PCI = 88

Sample Comments:

65 JOINT SEAL DAMAGE H 20.00 Slabs Comments:

Sample Number: 07 Type: R Area: 20.00Slabs PCI = 88

Sample Comments:

65 JOINT SEAL DAMAGE H 20.00 Slabs Comments:

Sample Number: 10 Type: R Area: 20.00Slabs PCI = 88

Sample Comments:

65 JOINT SEAL DAMAGE H 20.00 Slabs Comments:

Sample Number: 11 Type: R Area: 20.00Slabs PCI = 82

Sample Comments:

73 SHRINKAGE CRACKING N 1.00 Slabs Comments:
65 JOINT SEAL DAMAGE H 20.00 Slabs Comments:
71 FAULTING L 1.00 Slabs Comments:

Sample Number: 13 Type: R Area: 20.00Slabs PCI = 88

Sample Comments:

65 JOINT SEAL DAMAGE H 20.00 Slabs Comments:

Sample Number: 15 Type: R Area: 28.00Slabs PCI = 87

Sample Comments:

65 JOINT SEAL DAMAGE H 28.00 Slabs Comments:
74 JOINT SPALLING L 1.00 Slabs Comments:

Re-inspection Report

IA 2020

Report Generated Date: April 08, 2021

Network: AIO Name: ATLANTIC MUNICIPAL AIRPORT

Branch: T03AT Name: TAXIWAY 03 Use: TAXIWAY Area: 6,561.00SqFt

Section: 01 of 1 From: RW 02 APPROACH To: SEE MAP Last Const.: 11/01/2006
Surface: PCC Family: IowaPCCTWSC_General Zone: Category: Rank: P
Area: 6,561.00SqFt Length: 165.00Ft Width: 35.00Ft
Slabs: 77 Slab Width: 8.75Ft Slab Length: 9.60Ft Joint Length: 1,061.56Ft
Shoulder: Street Type: Grade: 0.00 Lanes: 0

Section Comments:

Last Insp. Date: 11/14/2020 Total Samples: 4 Surveyed: 4

Conditions: PCI : 78

Inspection Comments:

Sample Number: 01 Type: R Area: 22.00Slabs PCI = 54

Sample Comments:

65 JOINT SEAL DAMAGE	H	22.00 Slabs	Comments:
71 FAULTING	L	6.00 Slabs	Comments:
71 FAULTING	M	4.00 Slabs	Comments:
66 SMALL PATCH	L	1.00 Slabs	Comments:
75 CORNER SPALLING	M	1.00 Slabs	Comments:
62 CORNER BREAK	L	1.00 Slabs	Comments:

Sample Number: 02 Type: R Area: 23.00Slabs PCI = 88

Sample Comments:

65 JOINT SEAL DAMAGE	H	23.00 Slabs	Comments:
----------------------	---	-------------	-----------

Sample Number: 03 Type: R Area: 20.00Slabs PCI = 88

Sample Comments:

65 JOINT SEAL DAMAGE	H	20.00 Slabs	Comments:
----------------------	---	-------------	-----------

Sample Number: 04 Type: R Area: 12.00Slabs PCI = 88

Sample Comments:

65 JOINT SEAL DAMAGE	H	12.00 Slabs	Comments:
----------------------	---	-------------	-----------

Re-inspection Report

IA 2020

Report Generated Date: April 08, 2021

Network: AIO Name: ATLANTIC MUNICIPAL AIRPORT

Branch: T04AT Name: TAXIWAY 04 Use: TAXIWAY Area: 171,675.00SqFt

Section: 01 of 1 From: SEE MAP To: SEE MAP Last Const.: 06/03/2013
Surface: PCC Family: IowaPCCTWSC_General Zone: Category: Rank: P
Area: 171,675.00SqFt Length: 4,730.00Ft Width: 35.00Ft
Slabs: 1,892 Slab Width: 8.75Ft Slab Length: 10.00Ft Joint Length: 30,710.00Ft
Shoulder: Street Type: Grade: 0.00 Lanes: 0

Section Comments:

Last Insp. Date: 11/14/2020 Total Samples: 99 Surveyed: 10

Conditions: PCI: 95

Inspection Comments:

Sample Number: 04 Type: R Area: 20.00Slabs PCI = 98
Sample Comments:
65 JOINT SEAL DAMAGE L 20.00 Slabs Comments:

Sample Number: 14 Type: R Area: 20.00Slabs PCI = 98
Sample Comments:
65 JOINT SEAL DAMAGE L 20.00 Slabs Comments:

Sample Number: 24 Type: R Area: 20.00Slabs PCI = 98
Sample Comments:
65 JOINT SEAL DAMAGE L 20.00 Slabs Comments:

Sample Number: 36 Type: R Area: 20.00Slabs PCI = 66
Sample Comments:
65 JOINT SEAL DAMAGE L 20.00 Slabs Comments:
63 LINEAR CRACKING M 5.00 Slabs Comments:

Sample Number: 44 Type: R Area: 20.00Slabs PCI = 98
Sample Comments:
65 JOINT SEAL DAMAGE L 20.00 Slabs Comments:

Sample Number: 54 Type: R Area: 20.00Slabs PCI = 98
Sample Comments:
65 JOINT SEAL DAMAGE L 20.00 Slabs Comments:

Sample Number: 64 Type: R Area: 20.00Slabs PCI = 98
Sample Comments:
65 JOINT SEAL DAMAGE L 20.00 Slabs Comments:

Sample Number: 74 Type: R Area: 20.00Slabs PCI = 98
Sample Comments:
65 JOINT SEAL DAMAGE L 20.00 Slabs Comments:

Sample Number: 84 Type: R Area: 20.00Slabs PCI = 98
Sample Comments:
65 JOINT SEAL DAMAGE L 20.00 Slabs Comments:

Sample Number: 92 Type: R Area: 20.00Slabs PCI = 98
Sample Comments:
65 JOINT SEAL DAMAGE L 20.00 Slabs Comments:

Re-inspection Report

IA 2020

Report Generated Date: April 08, 2021

Network: AIO Name: ATLANTIC MUNICIPAL AIRPORT

Branch: T05AT Name: TAXIWAY 05 Use: TAXIWAY Area: 8,310.00SqFt

Section: 01 of 1 From: TAXIWAY 02 To: APRON Last Const.: 06/03/2013
Surface: PCC Family: IowaPCCTWSC_General Zone: Category: Rank: P
Area: 8,310.00SqFt Length: 200.00Ft Width: 35.00Ft
Slabs: 113 Slab Width: 8.75Ft Slab Length: 10.50Ft Joint Length: 1,231.67Ft
Shoulder: Street Type: Grade: 0.00 Lanes: 0

Section Comments: SLAB SIZE VARIES (AVERAGE SIZE ENTERED)

Last Insp. Date: 11/14/2020 Total Samples: 5 Surveyed: 4

Conditions: PCI : 90

Inspection Comments:

Sample Number: 01 Type: R Area: 20.00Slabs PCI = 91

Sample Comments:

65 JOINT SEAL DAMAGE M 20.00 Slabs Comments:
66 SMALL PATCH L 2.00 Slabs Comments:

Sample Number: 02 Type: R Area: 20.00Slabs PCI = 88

Sample Comments:

73 SHRINKAGE CRACKING N 1.00 Slabs Comments:
65 JOINT SEAL DAMAGE M 20.00 Slabs Comments:
75 CORNER SPALLING M 1.00 Slabs Comments:

Sample Number: 03 Type: R Area: 23.00Slabs PCI = 90

Sample Comments:

65 JOINT SEAL DAMAGE M 23.00 Slabs Comments:
75 CORNER SPALLING L 1.00 Slabs Comments:
74 JOINT SPALLING L 1.00 Slabs Comments:

Sample Number: 04 Type: R Area: 21.00Slabs PCI = 93

Sample Comments:

65 JOINT SEAL DAMAGE M 21.00 Slabs Comments:

Re-inspection Report

IA 2020

Report Generated Date: April 08, 2021

Network: AIO Name: ATLANTIC MUNICIPAL AIRPORT

Branch: TH01AT Name: T-HANGAR 01 Use: T-HANGAR Area: 21,962.00SqFt

Section: 01 of 3 From: APRON To: SEE MAP Last Const.: 01/01/2000
Surface: AC Family: IowaASPHALTTSouthern Zone: Category: Rank: P
Area: 8,400.00SqFt Length: 240.00Ft Width: 35.00Ft
Shoulder: Street Type: Grade: 0.00 Lanes: 0

Section Comments:

Last Insp. Date: 11/14/2020 Total Samples: 2 Surveyed: 2

Conditions: PCI : 46

Inspection Comments:

Sample Number: 01 Type: R Area: 4,200.00SqFt PCI = 49

Sample Comments:

41 ALLIGATOR CRACKING	L	83.00 SqFt	Comments:
41 ALLIGATOR CRACKING	M	6.00 SqFt	Comments:
48 LONGITUDINAL/TRANSVERSE CRACKING	H	35.00 Ft	Comments:
48 LONGITUDINAL/TRANSVERSE CRACKING	M	40.00 Ft	Comments:
48 LONGITUDINAL/TRANSVERSE CRACKING	L	21.00 Ft	Comments:
57 WEATHERING	M	4,200.00 SqFt	Comments:

Sample Number: 02 Type: R Area: 4,200.00SqFt PCI = 43

Sample Comments:

45 DEPRESSION	L	35.00 SqFt	Comments:AT CRACK
52 RAVELING	H	1.00 SqFt	Comments:
48 LONGITUDINAL/TRANSVERSE CRACKING	H	35.00 Ft	Comments:1FT TRANS
48 LONGITUDINAL/TRANSVERSE CRACKING	M	155.00 Ft	Comments:W
48 LONGITUDINAL/TRANSVERSE CRACKING	L	32.00 Ft	Comments:LU
52 RAVELING	M	500.00 SqFt	Comments:
57 WEATHERING	M	3,699.00 SqFt	Comments:
53 RUTTING	L	20.00 SqFt	Comments:

Re-inspection Report

IA 2020

Report Generated Date: April 08, 2021

Network: AIO Name: ATLANTIC MUNICIPAL AIRPORT

Branch: TH01AT Name: T-HANGAR 01 Use: T-HANGAR Area: 21,962.00SqFt

Section: 02 of 3 From: APRON To: SEE MAP Last Const.: 01/01/2000
Surface: AC Family: IowaASPHALTTSouthern Zone: Category: Rank: P
Area: 11,562.00SqFt Length: 410.00Ft Width: 25.00Ft
Shoulder: Street Type: Grade: 0.00 Lanes: 0

Section Comments:

Last Insp. Date: 11/14/2020 Total Samples: 3 Surveyed: 3

Conditions: PCI: 45

Inspection Comments:

Sample Number: 01 Type: R Area: 3,425.00SqFt PCI = 53

Sample Comments:

48	LONGITUDINAL/TRANSVERSE CRACKING	H	10.00	Ft	Comments:1FT TRANS
52	RAVELING	L	500.00	SqFt	Comments:
48	LONGITUDINAL/TRANSVERSE CRACKING	M	85.00	Ft	Comments:W
48	LONGITUDINAL/TRANSVERSE CRACKING	L	124.00	Ft	Comments:LU
41	ALLIGATOR CRACKING	L	25.00	SqFt	Comments:EDGE
57	WEATHERING	M	3,425.00	SqFt	Comments:

Sample Number: 02 Type: R Area: 3,575.00SqFt PCI = 42

Sample Comments:

52	RAVELING	M	180.00	SqFt	Comments:MD
57	WEATHERING	M	3,395.00	SqFt	Comments:
52	RAVELING	L	500.00	SqFt	Comments:
48	LONGITUDINAL/TRANSVERSE CRACKING	H	25.00	Ft	Comments:1FT TRANS
48	LONGITUDINAL/TRANSVERSE CRACKING	M	134.00	Ft	Comments:W
48	LONGITUDINAL/TRANSVERSE CRACKING	L	52.00	Ft	Comments:LU
41	ALLIGATOR CRACKING	L	43.00	SqFt	Comments:EDGE

Sample Number: 03 Type: R Area: 4,562.00SqFt PCI = 42

Sample Comments:

48	LONGITUDINAL/TRANSVERSE CRACKING	M	236.00	Ft	Comments:W
41	ALLIGATOR CRACKING	L	25.00	SqFt	Comments:EDGE
57	WEATHERING	M	4,562.00	SqFt	Comments:
45	DEPRESSION	L	6.00	SqFt	Comments:
53	RUTTING	L	10.00	SqFt	Comments:
52	RAVELING	L	500.00	SqFt	Comments:
41	ALLIGATOR CRACKING	M	15.00	SqFt	Comments:
48	LONGITUDINAL/TRANSVERSE CRACKING	L	138.00	Ft	Comments:LU

Re-inspection Report

IA 2020

Report Generated Date: April 08, 2021

Network: AIO Name: ATLANTIC MUNICIPAL AIRPORT

Branch: TH01AT Name: T-HANGAR 01 Use: T-HANGAR Area: 21,962.00SqFt

Section: 03 of 3 From: APRON To: SEE MAP Last Const.: 01/01/2010
Surface: PCC Family: IowaPCCTHsouthern Zone: Category: Rank: P
Area: 2,000.00SqFt Length: 80.00Ft Width: 25.00Ft
Slabs: 12 Slab Width: 12.50Ft Slab Length: 13.00Ft Joint Length: 208.85Ft
Shoulder: Street Type: Grade: 0.00 Lanes: 0

Section Comments:

Last Insp. Date: 11/14/2020 Total Samples: 1 Surveyed: 1

Conditions: PCI : 81

Inspection Comments:

Sample Number: 01 Type: R Area: 12.00Slabs PCI = 81

Sample Comments:

63 LINEAR CRACKING	L	1.00 Slabs	Comments:
73 SHRINKAGE CRACKING	N	1.00 Slabs	Comments:
65 JOINT SEAL DAMAGE	H	12.00 Slabs	Comments:

Re-inspection Report

IA 2020

Report Generated Date: April 08, 2021

Network: AIO Name: ATLANTIC MUNICIPAL AIRPORT

Branch: TH02AT Name: T-HANGAR 02 Use: T-HANGAR Area: 9,275.00SqFt

Section: 01 of 1 From: APRON To: SEE MAP Last Const.: 01/01/1994
Surface: AC Family: IowaASPHALTTHSouthern Zone: Category: Rank: P
Area: 9,275.00SqFt Length: 265.00Ft Width: 35.00Ft
Shoulder: Street Type: Grade: 0.00 Lanes: 0

Section Comments:

Last Insp. Date: 11/14/2020 Total Samples: 2 Surveyed: 2

Conditions: PCI : 38

Inspection Comments:

Sample Number: 01 Type: R Area: 4,550.00SqFt PCI = 52

Sample Comments:

41 ALLIGATOR CRACKING	M	49.00 SqFt	Comments:
48 LONGITUDINAL/TRANSVERSE CRACKING	H	36.00 Ft	Comments:1FT TRANS
48 LONGITUDINAL/TRANSVERSE CRACKING	M	121.00 Ft	Comments:W
57 WEATHERING	M	4,550.00 SqFt	Comments:
48 LONGITUDINAL/TRANSVERSE CRACKING	L	12.00 Ft	Comments:LU

Sample Number: 02 Type: R Area: 4,725.00SqFt PCI = 25

Sample Comments:

48 LONGITUDINAL/TRANSVERSE CRACKING	L	179.00 Ft	Comments:LU
48 LONGITUDINAL/TRANSVERSE CRACKING	M	175.00 Ft	Comments:W SEC CRK
48 LONGITUDINAL/TRANSVERSE CRACKING	H	10.00 Ft	Comments:1FT TRANS
41 ALLIGATOR CRACKING	M	300.00 SqFt	Comments:
53 RUTTING	L	100.00 SqFt	Comments:
57 WEATHERING	M	4,525.00 SqFt	Comments:
52 RAVELING	M	200.00 SqFt	Comments:

APPENDIX D

WORK HISTORY REPORT

Date:03/29/2021

Work History Report

1 of 3

Pavement Database:IA 2020

Network: AIO **Branch:** A01AT (APRON) **Section:** 01 **Surface:** PCC
L.C.D.: 04/15/2019 **Use:** APRON **Rank P Length:** 500.00 Ft **Width:** 250.00 Ft **True Area:** 83,176.00 SqF

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
04/15/2019	CR-PC	Complete Reconstruction - PC	\$0	6.00	True	6" PCC
04/14/2019	SB-AG	Subbase - Aggregate	\$0	6.00	False	6" GRANULAR SUBBASE
04/13/2019	SG-ST	Subgrade - Stabilized	\$0	19.00	False	19" CEMENT STABILIZED COMPACTED SUBGRADE
01/01/2008	CS-AC	Crack Sealing - AC	\$0	0.00	False	EST. YEAR - AIRPORT HAS CRK SEALED OVER THE PAST 3 YEARS
06/01/1999	OL-AS	Overlay - AC Structural (Major	-	2.00	True	-
06/01/1979	OL-AC	Overlay - AC	-	-	True	-
06/02/1962	NC-AC	New Construction - AC	\$0	2.00	True	2" AC
06/01/1962	BA-AG	Base Course - Aggregate	\$0	10.00	False	10" P-209

Network: AIO **Branch:** R02AT (RUNWAY 02/20) **Section:** 01 **Surface:** PCC
L.C.D.: 11/01/2006 **Use:** RUNWAY **Rank P Length:** 5,100.00 Ft **Width:** 75.00 Ft **True Area:**384,590.00 SqF

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
11/01/2006	NC-PC	New Construction - PCC	\$0	0.00	True	-

Network: AIO **Branch:** R12AT (RUNWAY 12/30) **Section:** 01 **Surface:** AAC
L.C.D.: 11/12/2020 **Use:** RUNWAY **Rank S Length:** 3,130.00 Ft **Width:** 75.00 Ft **True Area:**266,480.00 SqF

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
11/12/2020	OL-AC	Overlay - AC	\$0	3.00	True	3" P-403 OVERLAY
11/11/2020	PA-AD	Patching - AC Deep	\$0	0.00	False	PRE-OVERLAY FULL DEPTH PATCHING
11/10/2020	MI-CO	Cold Milling	\$0	-2.50	False	2.5" COLD MILL
01/01/2008	CS-AC	Crack Sealing - AC	\$0	0.00	False	EST. YEAR - AIRPORT HAS CRK SEALED OVER THE PAST 3 YEARS
06/01/1999	OL-AS	Overlay - AC Structural	-	-	True	-
06/01/1979	OL-AC	Overlay - AC	-	-	True	-
06/02/1962	NC-AC	New Construction - AC	\$0	2.00	True	2" AC
06/01/1962	BA-AG	Base Course - Aggregate	\$0	10.00	False	10" P-209

Network: AIO **Branch:** T01AT (TAXIWAY 01) **Section:** 01 **Surface:** AAC
L.C.D.: 11/12/2020 **Use:** TAXIWAY **Rank P Length:** 700.00 Ft **Width:** 38.00 Ft **True Area:** 29,270.00 SqF

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
11/12/2020	OL-AC	Overlay - AC	\$0	3.00	True	3" P-403 OVERLAY
11/11/2020	PA-AD	Patching - AC Deep	\$0	0.00	False	PRE-OVERLAY FULL DEPTH PATCHING
11/10/2020	MI-CO	Cold Milling	\$0	-2.50	False	2.5" COLD MILL
01/01/2008	CS-AC	Crack Sealing - AC	\$0	0.00	False	EST. YEAR - AIRPORT HAS CRK SEALED OVER THE PAST 3 YEARS
06/01/1999	OL-AS	Overlay - AC Structural (Major	-	-	True	-
06/01/1979	OL-AC	Overlay - AC	-	-	True	-
06/02/1962	NC-AC	New Construction - AC	\$0	2.00	True	2" AC
06/01/1962	BA-AG	Base Course - Aggregate	\$0	10.00	False	10" P-209

Network: AIO **Branch:** T02AT (TAXIWAY 02) **Section:** 01 **Surface:** PCC
L.C.D.: 11/01/2006 **Use:** TAXIWAY **Rank P Length:** 735.00 Ft **Width:** 35.00 Ft **True Area:** 29,405.00 SqF

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
11/01/2006	NC-PC	New Construction - PCC	\$0	0.00	True	-

Network: AIO **Branch:** T03AT (TAXIWAY 03) **Section:** 01 **Surface:** PCC
L.C.D.: 11/01/2006 **Use:** TAXIWAY **Rank P Length:** 165.00 Ft **Width:** 35.00 Ft **True Area:** 6,561.00 SqF

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
-----------	-----------	------------------	------	----------------	-----------	----------

Date:03/29/2021

Work History Report

2 of 3

Pavement Database:IA 2020

11/01/2006	NC-PC	New Construction - PCC	\$0	0.00	True	-
------------	-------	------------------------	-----	------	------	---

Network: AIO **Branch:** T04AT (TAXIWAY 04) **Section:** 01 **Surface:** PCC
L.C.D.: 06/03/2013 **Use:** TAXIWAY **Rank P Length:** 4,730.00 Ft **Width:** 35.00 Ft **True Area:** 171,675.00 SqF

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
06/03/2013	NC-PC	New Construction - PCC	\$0	6.00	True	6" P505 PCC
06/02/2013	BA-AG	Base Course - Aggregate	\$0	6.00	False	6" P209 GRANULAR SUBBASE
06/01/2013	SG-ST	Subgrade - Stabilized	\$0	12.00	False	12" P155 LIME TREATED SUBGRADE

Network: AIO **Branch:** T05AT (TAXIWAY 05) **Section:** 01 **Surface:** PCC
L.C.D.: 06/03/2013 **Use:** TAXIWAY **Rank P Length:** 200.00 Ft **Width:** 35.00 Ft **True Area:** 8,310.00 SqF

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
06/03/2013	NC-PC	New Construction - PCC	\$0	6.00	True	6" P505 PCC
06/02/2013	BA-AG	Base Course - Aggregate	\$0	6.00	False	6" P209 GRANULAR SUBBASE
06/01/2013	SG-CO	Subgrade - Compacted	\$0	12.00	False	12" COMPACTED SUBGRADE

Network: AIO **Branch:** TH01AT (T-HANGAR 01) **Section:** 01 **Surface:** AC
L.C.D.: 01/01/2000 **Use:** T-HANGAR **Rank P Length:** 240.00 Ft **Width:** 35.00 Ft **True Area:** 8,400.00 SqF

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
01/01/2000	NC-AC	New Construction - AC	\$0	0.00	True	EST. VIA GOOGLE EARTH; CONSTRUCTED BETWEEN 10/1994-10/2004

Network: AIO **Branch:** TH01AT (T-HANGAR 01) **Section:** 02 **Surface:** AC
L.C.D.: 01/01/2000 **Use:** T-HANGAR **Rank P Length:** 410.00 Ft **Width:** 25.00 Ft **True Area:** 11,562.00 SqF

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
01/01/2000	NC-AC	New Construction - AC	\$0	0.00	True	EST. VIA GOOGLE EARTH; CONSTRUCTED BETWEEN 10/1994-10/2004

Network: AIO **Branch:** TH01AT (T-HANGAR 01) **Section:** 03 **Surface:** PCC
L.C.D.: 01/01/2010 **Use:** T-HANGAR **Rank P Length:** 80.00 Ft **Width:** 25.00 Ft **True Area:** 2,000.00 SqF

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
01/01/2010	NC-PC	New Construction - PCC	\$0	0.00	True	ESTIMATED VIA AERIAL

Network: AIO **Branch:** TH02AT (T-HANGAR 02) **Section:** 01 **Surface:** AC
L.C.D.: 01/01/1994 **Use:** T-HANGAR **Rank P Length:** 265.00 Ft **Width:** 35.00 Ft **True Area:** 9,275.00 SqF

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
01/01/1994	NC-AC	New Construction - AC	\$0	0.00	True	UNKNOWN; CONSTRUCTED PRIOR TO 1994 PER GOOGLE EARTH

Summary:

Work Description	Section Count	Area Total (SqFt)	Thickness Avg (in)	Thickness STD (in)
Base Course - Aggregate	5	558,911.00	8.40	2.19
Cold Milling	2	295,750.00	-2.50	.00
Complete Reconstruction - PCC	1	83,176.00	6.00	-
Crack Sealing - AC	3	378,926.00	.00	.00
New Construction - AC	6	408,163.00	1.00	1.10
New Construction - PCC	6	602,541.00	2.00	3.10
Overlay - AC	5	674,676.00	3.00	.00
Overlay - AC Structural	1	266,480.00	-	-
Overlay - AC Structural (Major MR)	2	112,446.00	2.00	-
Patching - AC Deep	2	295,750.00	.00	.00
Subbase - Aggregate	1	83,176.00	6.00	-
Subgrade - Compacted	1	8,310.00	12.00	-
Subgrade - Stabilized	2	254,851.00	15.50	4.95

APPENDIX E

LOCALIZED PREVENTIVE MAINTENANCE POLICIES AND UNIT COST TABLES

Table E-1. Localized preventive maintenance policy, asphalt-surfaced pavements.

Distress Type	Severity Level	Maintenance Action
Alligator Cracking	Low	Monitor
Alligator Cracking	Medium	Asphalt Patch
Alligator Cracking	High	Asphalt Patch
Bleeding	N/A	Monitor
Block Cracking	Low	Monitor
Block Cracking	Medium	Crack Seal—Asphalt
Block Cracking	High	Crack Seal—Asphalt
Corrugation	Low	Monitor
Corrugation	Medium	Asphalt Patch
Corrugation	High	Asphalt Patch
Depression	Low	Monitor
Depression	Medium	Monitor
Depression	High	Asphalt Patch
Jet-Blast Erosion	N/A	Asphalt Patch
Joint Reflection Cracking	Low	Monitor
Joint Reflection Cracking	Medium	Crack Seal—Asphalt
Joint Reflection Cracking	High	Crack Seal—Asphalt
L&T Cracking	Low	Monitor
L&T Cracking	Medium	Crack Seal—Asphalt
L&T Cracking	High	Crack Seal—Asphalt
Oil Spillage	N/A	Asphalt Patch
Patching	Low	Monitor
Patching	Medium	Asphalt Patch
Patching	High	Asphalt Patch
Polished Aggregate	N/A	Monitor
Raveling	Low	Monitor
Raveling	Medium	Asphalt Patch
Raveling	High	Asphalt Patch
Rutting	Low	Monitor
Rutting	Medium	Monitor
Rutting	High	Asphalt Patch
Shoving	Low	Monitor
Shoving	Medium	Asphalt Patch
Shoving	High	Asphalt Patch
Slippage Cracking	N/A	Asphalt Patch
Swelling	Low	Monitor
Swelling	Medium	Monitor
Swelling	High	Asphalt Patch
Weathering	Low	Monitor
Weathering	Medium	Monitor
Weathering	High	Asphalt Patch

Table E-2. Localized preventive maintenance policy, PCC pavements.

Distress Type	Severity Level	Maintenance Action
ASR	Low	Monitor
ASR	Medium	Slab Replacement
ASR	High	Slab Replacement
Blowup	Low	Slab Replacement
Blowup	Medium	Slab Replacement
Blowup	High	Slab Replacement
Corner Break	Low	Crack Seal—PCC
Corner Break	Medium	Full Depth PCC Patch
Corner Break	High	Full Depth PCC Patch
Durability Cracking	Low	Monitor
Durability Cracking	Medium	Full Depth Patch
Durability Cracking	High	Slab Replacement
Faulting	Low	Monitor
Faulting	Medium	Grinding
Faulting	High	Slab Replacement
Joint Seal Damage	Low	Monitor
Joint Seal Damage	Medium	Joint Seal
Joint Seal Damage	High	Joint Seal
LTD Cracking	Low	Monitor
LTD Cracking	Medium	Crack Seal—PCC
LTD Cracking	High	Slab Replacement
Patching (Small and Large)	Low	Monitor
Patching (Small and Large)	Medium	Full Depth PCC Patch
Patching (Small and Large)	High	Full Depth PCC Patch
Popouts	N/A	Monitor
Pumping	N/A	Monitor
Scaling	Low	Monitor
Scaling	Medium	Partial Depth PCC Patch
Scaling	High	Slab Replacement
Shattered Slab	Low	Crack Seal—PCC
Shattered Slab	Medium	Slab Replacement
Shattered Slab	High	Slab Replacement
Shrinkage Cracking	N/A	Monitor
Spalling (Joint and Corner)	Low	Monitor
Spalling (Joint and Corner)	Medium	Partial Depth PCC Patch
Spalling (Joint and Corner)	High	Partial Depth PCC Patch

Table E-3. 2021 unit costs for preventive maintenance actions.

Maintenance Action	Unit Cost
Asphalt Patch—Asphalt-Surfaced Pavement	\$14.10/sf
Crack Sealing—Asphalt-Surfaced Pavement	\$2.41/lf
Partial Depth PCC Patch—PCC Pavement	\$36.10/sf
Full Depth PCC Patch—PCC Pavement	\$16.12/sf
Crack Sealing—PCC Pavement	\$2.90/lf
Joint Sealing—PCC Pavement	\$2.90/lf
Grinding—PCC Pavement	\$0.35/sf
Slab Replacement—PCC Pavement	\$16.12/sf

Table E-4. 2021 unit costs (per square foot) based on pavement type and PCI ranges.

Pavement Type	PCI Range 0-40	PCI Range 40-50	PCI Range 50-60	PCI Range 60-70	PCI Range 70-80	PCI Range 80-90	PCI Range 90-100
AC	\$10.01	\$4.74	\$4.74	\$4.74	\$0.00	\$0.00	\$0.00
PCC	\$16.71	\$7.90	\$7.90	\$7.90	\$0.00	\$0.00	\$0.00

APPENDIX F

YEAR 2021 LOCALIZED PREVENTIVE MAINTENANCE DETAILS

Table F-1. Year 2021 localized preventive maintenance details.

Branch	Section	Distress Type	Severity	Distress Quantity	Distress Unit	Maintenance Action	Unit Cost	2021 Estimated Cost
R02AT	01	Corner Break	Low	9	Slabs	Crack Sealing - PCC	\$2.90	\$218
R02AT	01	Corner Spalling	Medium	9	Slabs	Patching - PCC Partial Depth	\$36.10	\$892
R02AT	01	Joint Seal Damage	High	2,448	Slabs	Joint Seal (Localized)	\$2.90	\$162,472
R02AT	01	Joint Spalling	Medium	3	Slabs	Patching - PCC Partial Depth	\$36.10	\$699
R02AT	01	LTD Cracking	Medium	6	Slabs	Crack Sealing - PCC	\$2.90	\$218
R02AT	01	Shattered Slab	Low	1	Slabs	Crack Sealing - PCC	\$2.90	\$73
T02AT	01	Joint Seal Damage	High	357	Slabs	Joint Seal (Localized)	\$2.90	\$13,753
T03AT	01	Corner Break	Low	1	Slabs	Crack Sealing - PCC	\$2.90	\$24
T03AT	01	Corner Spalling	Medium	1	Slabs	Patching - PCC Partial Depth	\$36.10	\$97
T03AT	01	Faulting	Medium	4	Slabs	Grinding (Localized)	\$0.35	\$12
T03AT	01	Joint Seal Damage	High	77	Slabs	Joint Seal (Localized)	\$2.90	\$3,079
T04AT	01	LTD Cracking	Medium	47	Slabs	Crack Sealing - PCC	\$2.90	\$1,286
T05AT	01	Corner Spalling	Medium	1	Slabs	Patching - PCC Partial Depth	\$36.10	\$131
T05AT	01	Joint Seal Damage	Medium	113	Slabs	Joint Seal (Localized)	\$2.90	\$3,572
TH01AT	03	Joint Seal Damage	High	12	Slabs	Joint Seal (Localized)	\$2.90	\$606

Table Notes:

1. See Figure 3 for the location of the branch and section.
2. Distress types are defined by ASTM D5340-20. L&T Cracking = Longitudinal and Transverse Cracking; LTD Cracking = Longitudinal, Transverse, and Diagonal Cracking; ASR = Alkali-Silica Reaction.
3. The costs provided are of a general nature for the entire state and may require adjustment to reflect specific conditions at Atlantic Municipal Airport.



PREPARED FOR

Iowa Department of Transportation
Aviation Bureau
800 Lincoln Way
Ames, Iowa 50010
515-239-1691
<https://iowadot.gov/aviation>

JULY 2021