



---

INDEX

**STRUCTURAL FIELD WELDING & INSPECTION**

<b><u>Section</u></b>	<b><u>Title</u></b>	<b><u>Page</u></b>
I	Opportunity and Use	2
II	Welding Process and Terminology	3
III	Essentials for an Inspector	7
IV	Welding Symbols	8
V	Inspector Duties	12
VI	Specifications for Welding Procedures	14
VII	Weldment Defects	16
VIII	Nondestructive Testing	26
IX	Welding Equipment	29
X	Inspector Responsibilities	30
XI	Structural Field Welding	35
XII	Welding of Railroad Bridge Deck Floor	43
XIII	Welding of Reinforcing Steel	44
XIII	Welder Qualification	44
XV	Welding Steel Pile/Splicing Pile	45
XVI	Sample Joint Weld Procedure Specification (WPS)	51

## **PREFACE**

This IM is written to help meet a continuing and growing need among inspectors whose common interest is to function as welding inspectors in addition to their other inspection duties. These inspectors function under the direction of the Resident Construction Engineers. Despite the wide diversity in training and background of these inspectors it becomes more evident each year that continued progress is increasingly more dependent upon technical review of the specifications.

With the increased use of the new higher strength steels it is even more important than ever before that better welding inspectors are needed to understand and to enforce the specifications so that the minimum design criteria are incorporated into the final structure.

Since welding is essentially a metallurgical operation it is best that the inspector understand a few of the basic fundamentals and the technology in applying this knowledge to obtain sound weldments. The illustrated procedures, inspection methods and data presented in this manual are for the inspector's beneficial study and to reinforce their periodic references to various welding problems.

All references are to the American Welding Society Specifications AWS D1.5 or AWS D1.1.

## **DESCRIPTION**

Field-weld metal members shall use the shielded metal arc and flux-cored arc welding processes.

## **SECTION I**

### **Opportunity & Use**

This manual outlines the inspector's duties and responsibilities for the proper inspection of weldments made under field conditions by approved welding processes. It is intended as an informational source for the inspection of methods and weldments.

It is the responsibility of the engineer or the supervisor appointed by them to see that proper methods outlined in this manual are understood and applied to the respective work.

Most of the welding specifications are incorporated into this manual but the inspector may find particular instances where the plans will carry additional welding requirements, and in those cases the plans must at all times be followed.

There are at times, errors on the plans, especially on the use of welding symbols. Whenever there is reason to question a particular drawing the inspector should consult their engineer and have them verify it with the Office of Bridges & Structures in Ames.

---


## **SECTION II**

### **Welding Processes & Terminology**

Welding is a localized coalescence of metal wherein coalescence is produced by heating to suitable temperatures, with or without the application of pressure, and with or without the application of filler metal. The filler metal either has a melting point approximately the same as the base metal or has a melting point below that of the base metal but above 800°F.

#### **Non-Pressure Welding**

Arc welding is one of the most common and widely known forms of welding in use today. It is not surprising to find that most of our problems deal with this type of welding, both in the field and in the fabricating shop. This IM is written for the sole purpose of inspection of arc welding done on the job site.

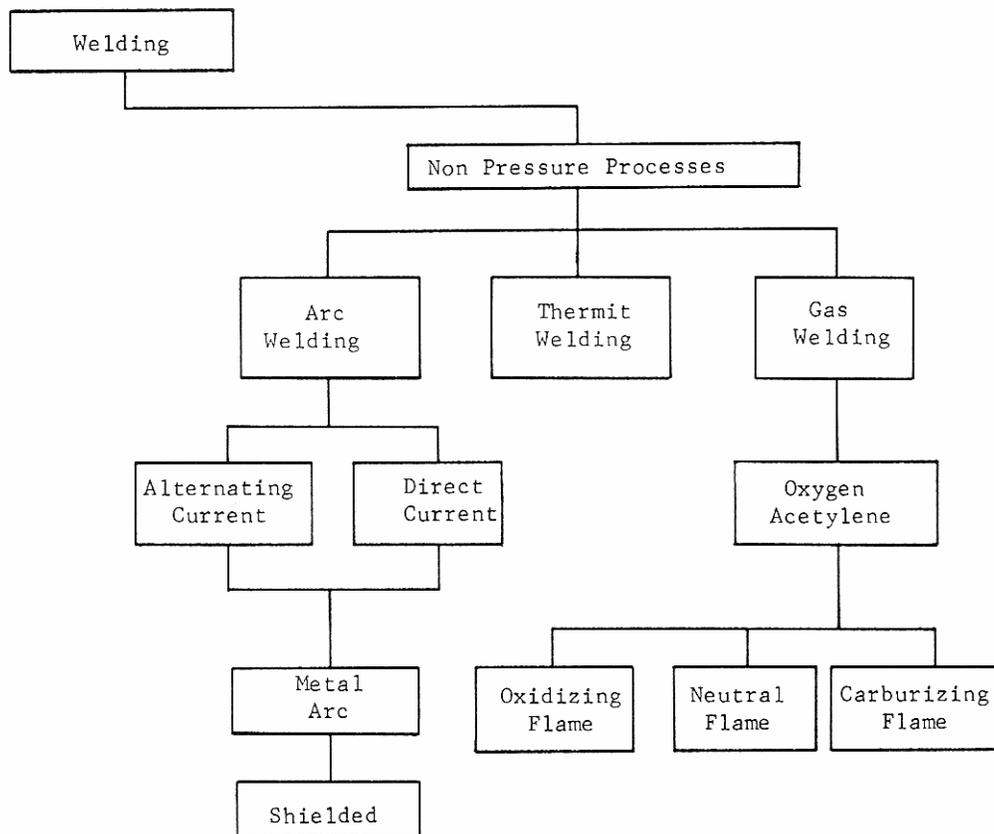

---

## **TERMINOLOGY**

**Air Carbon Arc Cutting:** An arc cutting process wherein the severing of metals is effected by melting with the heat of the arc and an air stream is used to facilitate the removal of the metal.

**Arc Blow:** The swerving of an electric arc from its normal path because of magnetic forces.

**Arc Gouging:** The application of arc cutting wherein a U-groove is formed.

**Automatic Welding:** Welding with equipment, which performs the entire welding operation without constant observation and adjustment of the controls by an operator.

**Axis of a Weld:** A line drawn through the length of a weld.

**Backing:** Material (usually metal) backing up the joint during welding to facilitate obtaining a sound weld at the root.

**Back Weld:** A weld deposited at the back of a single groove weld

**Bare Electrode:** A filler metal electrode without a coating or covering other than that used for drawing the wire.

**Base Metal:** The metal to be welded or cut.

**Bevel:** A type of edge preparation.

**Bead Weld:** A type of weld composed of one or more string or weave beads deposited on an unbroken surface.

**Butt Joint:** A joint between two members lying approximately in the same plane.

**Chamfer:** The contour prepared on the edge of a member to be welded.

**Crater:** A depression at the termination of a weld bead.

**Crater Crack:** A crack in the crater of a weld bead

**Depth of Fusion:** The distance that fusion extends into the base metal from the surface melted during welding.

**Downhand:** Position of welding wherein welding is done from the top side and the axis of the weld metal is horizontal.

**Electrode:** (Metal Arc Welding) Filler metal in the form of a wire or rod, either bare or covered, through which current is conducted between the electrode holder and the arc.

**Faying Surface:** That surface of a member, which is in contact with another member to which it is to be joined.

**Filler Metal:** Metal to be added in making a weld.

**Flux:** Material used to prevent dissolve or facilitate removal of oxides and other undesirable substances.

**Flux Cored Arc Welding:** An arc welding process in which the consumable electrode wire is hollow and is filled with flux material. Shielding may be from the solid flux only or from solid flux along with additional gas shielding.

**Gas Metal Arc Welding:** An arc welding process wherein coalescence is produced by heating with an electric arc between a filler metal (consumable) electrode and the work. Shielding, is obtained from a gas, a gas mixture (which may contain an inert gas) this process has sometimes been called Mig Welding.

**Gas Pocket:** A weld cavity caused by entrapped gas

**Heat-Affected Zone:** That portion of the base metal which has not been melted, but whose mechanical properties or micro-structures have been altered by welding.

**Interpass Temperature:** In a multiple-pass weld, the lowest temperature of the deposited weld metal before the next pass is started.

**Kerf:** The space from which metal has been removed by a cutting process.

**Manual Welding:** Welding wherein the entire welding operation is performed and controlled by hand.

**Notch Effect:** An abrupt change of contour or section, or of a defect or imperfection in workmanship which causes high local concentration of stress and constraint against ductile action, thereby affecting structural behavior adversely. Such notch effects are especially detrimental to fatigue or impact strength, and resistance to brittle fracture.

**Overlap:** Protrusion of weld metal beyond the bond at the toe of the weld.

**Parent Metal:** Metal that is to be welded or cut.

**Peening:** The mechanical working of metals by means of hammer blows

**Porosity:** Gas pockets or voids in metal.

**Postheating:** The application of heat to a weld or weldment immediately after welding.

**Preheating:** The application of heat to the base metal immediately before welding

**Reverse Polarity:** The arrangement of direct-current arc-welding leads wherein the work is the negative pole and electrode is the positive pole of the welding arc.

**Root Opening:** The separation between the members to be joined, at the root of the joint.

**Root Face:** That portion of the groove face adjacent to the root of the joints.

**Root of Joint:** The portion of a joint to be welded where the members approach closest to each other. In cross-section the root of the joint may be a point, a line or an area.

**Root of Weld:** The point, as shown in cross-section, at which the bottom of the weld intersects the base metal surfaces.

**Run-off Tab:** Plates having the same joint preparation as the joint to be welded and placed on the end of the joint to carry the weld on past the end of the welded joint.

**Semi-Automatic Arc Welding:** Arc welding with equipment, which controls only the filler metal feed. The advance of the welding is manually controlled.

**Shielded Metal-Arc Welding:** An arc-welding process where coalescence is produced by heating with an electric arc between a covered metal electrode and the work. Shielding is obtained from the decomposition of the electrode covering. Pressure is not used and filler metal is obtained from the electrode.

**Size of Weld:**

**A. Groove Weld.** The joint penetration (depth of chamfering plus the root penetration when specified)

**B. Fillet Weld.** For equal-leg fillet welds, the leg length of the largest isosceles right triangle which can be inscribed within the fillet-weld cross-section

**Slag Inclusion:** Non-metallic solid material entrapped in weld metal or between weld metal and base metal.

**Spatter:** The metal particles expelled during welding and which do not form a part of the weld metal.

**Straight Polarity:** The arrangement of direct-current arc-welding leads wherein the work is positive and the electrode is the negative of the welding arc.

**Stringer Bead:** A type of weld bead made without appreciable transverse oscillation.

**Tack Weld:** A weld made to hold parts of a weldment in proper alignment until the final welds are made.

**Underbead Crack:** A crack in the heat-affected zone not extending to the surface of the base metal.

**Undercut:** A groove melted into the base metal adjacent to the toe of a weld and left unfilled by weld metal.

**Weave Bead:** A type of weld bead made with transverse oscillation.

**Weld Metal:** That portion of a weld, which has been melted during welding.

**Welder:** One who is capable of performing a manual or semi-automatic welding operation.

**Welder Certification:** Certification in writing that a welder has produced welds meeting prescribed standards.

**Welding Procedure:** The detailed methods and practices, including joint welding procedures, involved in the production of a weldment.

**Welder Qualification:** The demonstration of welder's ability to produce welds meeting prescribed standards.

**Welding Sequence:** The order of making the welds in a weldment

**Weldment:** An assembly whose component parts are joined by welding.

**Weldment Defect:** The failure of any weldment to meet the specifications.

### **SECTION III**

#### **Essentials for an Inspector**

The inspector acts as the representative of the Iowa Department of Transportation and it is his/her responsibility to judge the quality of the welding and workmanship in relation to the outlined specifications. Although the inspector must strive for the best quality he/she must not delay the contractor without just cause.

### **Welding Knowledge**

While actual welding experience is valuable to an inspector it is not one of the necessary essentials. The inspector should have sufficient knowledge of the welding process to enable him/her to know what defects are most likely to occur. He/she should have a general knowledge of current settings and welding techniques. He/she must be familiar with the procedure specifications, and know how to apply them.

### **Knowledge of Test Methods**

It is essential that the inspector have some knowledge of the test methods used by the Iowa Department of Transportation so a better understanding of why one welder may be qualified to weld and another welder is not. This knowledge also enables the inspector to understand the limitations that may be imposed on some welders.

## **SECTION IV**

### **Welding Symbols**

Welding symbols were formulated by the American Welding Society and have since been standardized for the entire welding industries. These symbols convey the requirement set forth by the designer in a given area to meet the calculated stress load that will be applied. It is therefore important that the inspector understand their meaning thoroughly, and apply it correctly at all times.

A table of the most commonly used symbols has been prepared for this IM.

# STANDARD WELDING SYMBOLS

Basic Welding Symbols and Their Location Significance								
Flange	Groove							Location Significance
Corner	Square	V	Bevel	U	J	Flare-V	Flare-Bevel	
								Arrow Side
								Other Side
Not used								Both Sides
Not used		Not used	No Arrow Side or Other Side Significance					

Typical Welding Symbols		
<b>Slot Welding Symbol</b>  Depth of filling in inches (omission indicates filling is complete)	<b>Square-Groove Welding Symbol</b>  Omission of size indicates complete joint penetration Root opening	<b>Flare-V and Flare-Bevel-Groove Welding Symbols</b>  Root opening Size is considered as extending only to tangent points Root opening
<b>Plug Welding Symbol</b>  Included angle of countersink Pitch (distance between centers) of welds Depth of filling in inches (omission indicates filling is complete) Size (diameter of hole at root)	<b>Chain Intermittent Fillet Welding Symbol</b>  Size (length of leg) Pitch (distance between centers) of increments Length of increments	<b>Edge- and Corner- Flange Welding Symbols</b>  Radius Size of weld Height above point of tangency
<b>Backgouging Welding Symbol</b>  Back gouge Second reference line used for back gouging and welding as a second operation Note: Total effective throat not to exceed thickness of member	<b>Back or Backing Welding Symbol</b>  Any applicable single groove weld symbol	<b>Surfacing Welding Symbol Indicating Built-up Surface</b>  Size (height of deposit) Omission indicates no specific height desired Orientation, location and all dimensions other than size are shown on the drawing
<b>Flash or Upset Welding Symbol</b>  No arrow side or other side significance Process reference must be used to indicate process desired	<b>Staggered Intermittent Fillet Welding Symbol</b>  Pitch (distance between centers) of increments Length of increments Size (length of leg)	<b>Single-V Groove Welding Symbol Indicating Root Penetration</b>  Size Depth of preparation Effective throat Root opening Groove angle
<b>Spot Welding Symbol</b>  Size (diameter of weld) Strength (in lb per weld) may be used instead Process reference must be used to indicate process desired Number of welds Pitch (distance between centers) of weld	<b>Double-Bevel-Groove Welding Symbol</b>  Arrow points toward member to be prepared Omission of size dimension indicates a total depth of preparation equal to thickness of members Root opening Groove angle	
<b>Seam Welding Symbol</b>  Length of welds or increments Omission indicates that weld extends between abrupt changes in direction or as dimensioned Size (width of weld) Strength (in lb per linear inch) may be used instead Pitch (distance between centers) of increments Process reference must be used to indicate process desired	<b>Projection Welding Symbol</b>  Projection welding reference must be used Pitch (distance between centers) of welds Number of welds Size (strength in lb per weld) Diameter of weld may be used instead for circular projection welds	
<b>Welding Symbols for Combined Welds</b>  1/4 5/16 1/4	<b>Double-Fillet Welding Symbol</b>  Size (length of leg) Specification, process, or other reference Length Omission indicates that weld extends between abrupt changes in direction or as dimensioned	

Basic Joints—Identification of Arrow Side and Other Side of Joint		Process Abbreviations
<b>Lap Joint</b>  Other side member of joint Arrow of welding symbol Arrow side member of joint	<b>Edge Joint</b>  Arrow side of joint Arrow of welding symbol Joint	Where process abbreviations are to be included in the tail of the welding symbol, reference is made to Table A, Designation of Welding and Allied Processes by Letters, of AWS 2.4-79, 71.  <b>AMERICAN WELDING SOCIETY, INC.</b> 550 N.W. LeJeune Road P.O. Box 351040 Miami, Florida 33135

# AMERICAN WELDING SOCIETY




Basic Welding Symbols and Their Location Significance								
Location Significance	Fillet	Plug or Slot	Spot or Projection	Seam	Back or Backing	Surfacing	Scarf for Brazed Joint	Flange Edge
Arrow Side					Groove weld symbol 			
Other Side					Groove weld symbol 	Not used		
Both Sides		Not used	Not used	Not used	Not used	Not used		Not used
No Arrow Side or Other Side Significance	Not used	Not used			Not used	Not used	Not used	Not used

Supplementary Symbols Used with Welding Symbols															
<b>Convex Contour Symbol</b> Convex contour symbol indicates face of weld to be finished to convex contour  Finish symbol (user's standard) indicates method of obtaining specified contour but not degree of finish	<b>Weld-All-Around Symbol</b> Weld-all-around symbol indicates that weld extends completely around the joint 														
<b>Joint with Backing</b> With groove weld symbol  Note: Material and dimensions of backing as specified	<b>Joint with Spacer</b> With modified groove weld symbol  Note: Material and dimensions of spacer as specified														
<b>Flush Contour Symbol</b> Flush contour symbol indicates face of weld to be made flush. When used without a finish symbol, indicates weld without subsequent finishing  Finish symbol (user's standard) indicates method of obtaining specified contour but not degree of finish	<b>Melt-Thru Symbol</b> Any applicable weld symbol  Melt-thru symbol is not dimensioned (except height)														
<b>Field Weld Symbol</b> Field Weld symbol indicates that weld is to be made at a place other than that of initial construction 	<b>Complete Penetration</b> Indicates complete penetration regardless of type of weld or joint preparation 														
<b>Multiple Reference Lines</b> First operation shown on reference line nearest arrow Second operation, or supplementary data Third operation, or test information 	<b>Location of Elements of a Welding Symbol</b> Finish symbol Contour symbol Root opening: depth of filling for plug and slot welds Effective throat Depth of preparation; size or strength for certain welds Specification, process, or other reference Groove angle; included angle of countersink for plug welds Length of weld Pitch (center-to-center spacing) of welds Field weld symbol Arrow connecting reference line to arrow side member of joint Weld-all-around symbol Reference line Elements in this area remain as shown when tail and arrow are reversed Tail (Tail omitted when reference is not used) Basic weld symbol or detail reference (N) Number of spot or projection welds (BOTH SIDES) (ARROW SIDE) (OTHER SIDE)														
<b>Supplementary Symbols</b> <table border="1"> <tr> <th>Weld-All-Around</th> <th>Field Weld</th> <th>Melt-Thru</th> <th>Backing, Spacer</th> <th colspan="3">Contour</th> </tr> <tr> <td></td> <td></td> <td></td> <td></td> <td>Flush </td> <td>Convex </td> <td>Concave </td> </tr> </table>	Weld-All-Around	Field Weld	Melt-Thru	Backing, Spacer	Contour							Flush 	Convex 	Concave 	
Weld-All-Around	Field Weld	Melt-Thru	Backing, Spacer	Contour											
				Flush 	Convex 	Concave 									

Basic Joints—Identification of Arrow Side and Other Side of Joint		
<b>Butt Joint</b> Arrow of welding symbol Arrow side of joint Other side of joint 	<b>Corner Joint</b> Arrow side of joint Arrow of welding symbol Other side of joint 	<b>T-Joint</b> Arrow of welding symbol Arrow side of joint Other side of joint 



---
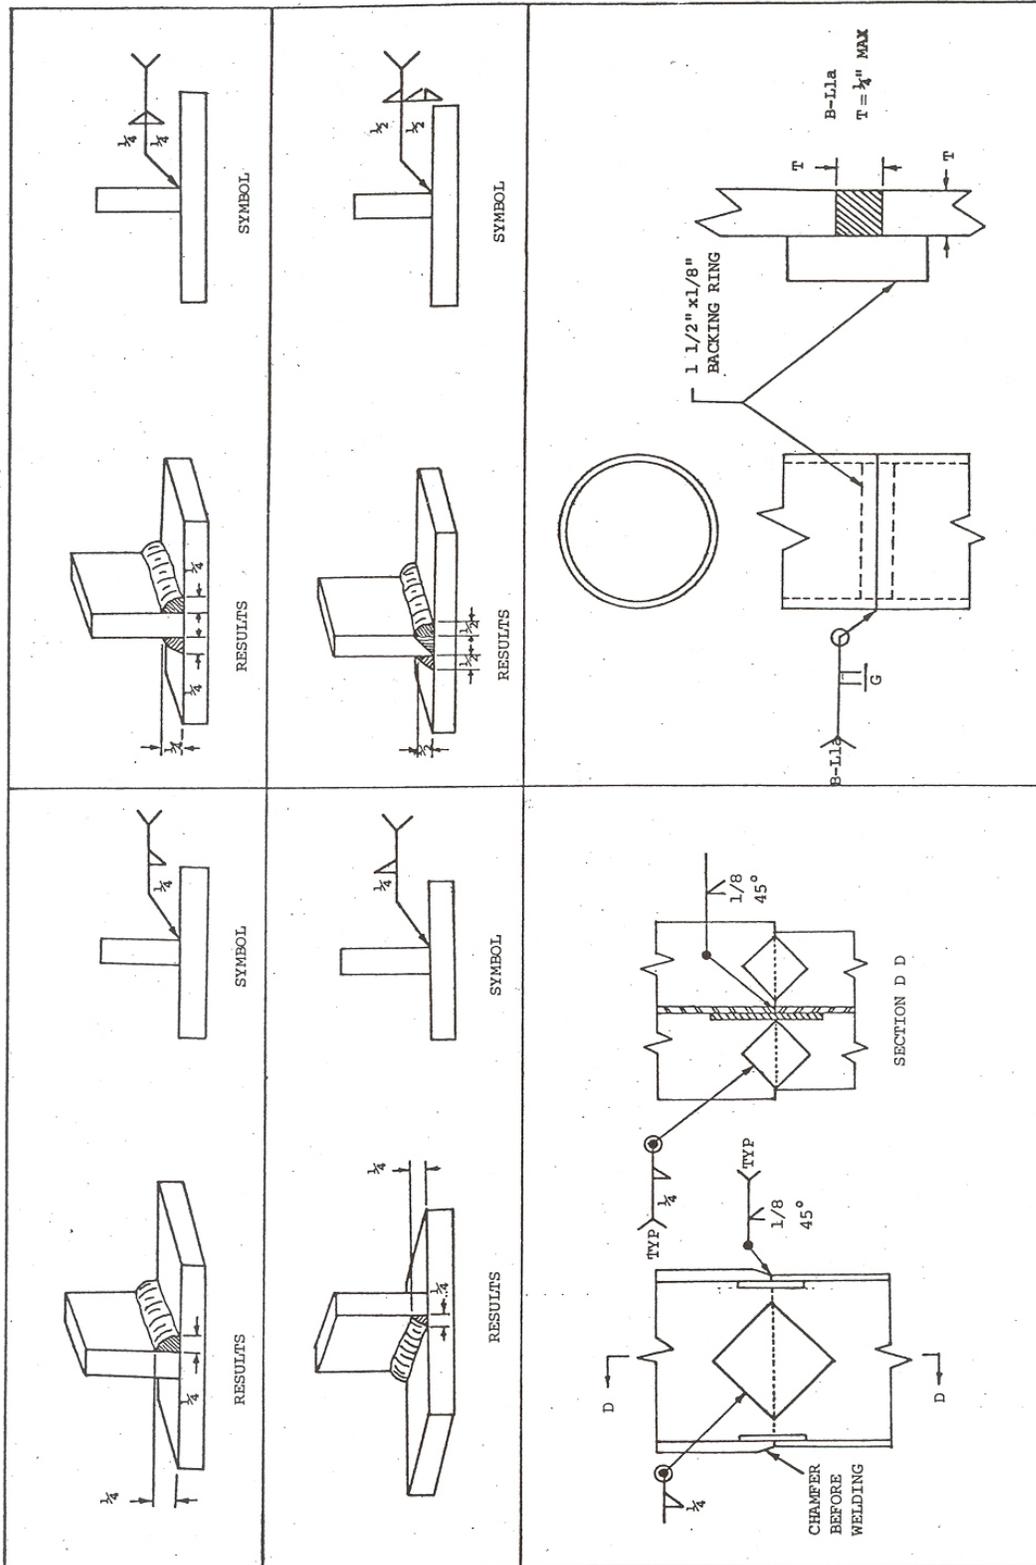
## **SECTION V**

### **Inspector Duties**

The inspector's primary function is that of inspecting the contractor work and to see that it meets the requirements of the specifications. If the contractor should request advice on changes or modifications in any way the inspector should cooperate in every way possible to obtain this information from the proper authorities. However, if changes or modifications are approved it must always be with the definite understanding that the contractor has the full responsibility for the quality of the final product.

An inspector should keep in touch with the activities of the contractor personnel. Generally, the contractor does not intentionally disregard contract requirements. However, errors can occur through worker carelessness or lack of familiarity on the part of the contractor. While the correction of any errors remains the responsibility of the contractor, the inspector should make certain these mistakes are brought to the contractor's prompt attention. Early correction of a mistake can oftentimes produce a satisfactory product.

The inspector duties will follow the general headings below:

1. Interpretation of the Plans & Specifications
2. Verification of Welder & Procedure
3. Verification of Written Welding Procedures
4. Production Welding Checks
5. Keeping Records & Reporting

### **Interpretation of Plans & Specifications**

The inspector should become familiar with the construction details pertaining to welding. Oftentimes notes on the plans will explain a welding detail or method of prescribed welding. It is also necessary to know any special provisions or proposal that may be specified in a particular contract document. These special provisions or proposals often carry the welding documentation that will require special treatments necessary to obtain a satisfactory weld.

The inspector should not accept responsibility for deviations until specifically authorized to do so. Many unknown stresses may be encountered when changes or deviations take place, which could affect the structure adversely.

### **Verification of Welder & Procedure**

The specifications that apply to the making of weldments require qualification of the welder. The procedure to qualify these welders is specified in AWS and the Standard Specifications. It is the inspector's duty to verify that each welder who works under these specifications has been properly qualified according to these specifications. The inspector must verify the test data and the results of the tests. Thus, one very important duty of the inspector is to see that the welder only works within the qualification limits. Since most field welders are qualified for only one year at a time, a requalification test is necessary to keep a welder's certificate updated at all times. Other limiting variables to be verified by the inspector are the types of weld, groove or fillet, the position to be welded and the thickness of the joint to be welded.

One specification of weldments is the requirement of a prescribed welding procedure. These welding procedures are prescribed for the type of joint to be used, and for the grade and thickness of the base metal to be employed for the work. These procedures are necessary to produce welded joints with acceptable mechanical properties in accordance with the specifications.

Before any welding is started the inspector should verify that the welding procedures have been established. For the most part the procedures required for field welding are set forth in this IM. These instructions include the necessary welding procedures for the various types of welding to be performed. However, reinforcing bars are not covered in this manual.

It is also the inspector's duty to note if any changes in a welding procedure are in excess of the limits set out in AWS. When a modified procedure is necessary the inspector should be sure it is not used in the structure until it has had final acceptance by the Offices of Materials and Design.

Once a qualification procedure has been accepted or approved it will remain approved until one of the essential variables has been changed. These variables and their limits can be found in AWS.

### **Verification of Written Welding Procedures**

The welding of some items has become so routine that they have become to be known as prequalified joints. These joints are of a basic design and the welding of them requires very little in the way of a written procedure. The inspector will find a list of these prequalified joints in the AWS book.

While some of these prequalified joints are basic fundamentals of a joint and for small weld areas, the same joint may be used in a bridge that will extend for the entire length of the structure. The more the length of any joint is involved in a procedure the more it becomes a mandatory requirement and its acceptance should be the responsibility of those people more familiar with welding problems. The field welding inspector should at no time take it upon himself/herself to accept a welding procedure but should be familiar enough with it to enforce it within the limits of the AWS Specifications.

### **Selection of Production Test Samples**

Not very often does a specification call for production test samples of field welding, but it does happen on occasions and therefore the inspector must have an idea of what is expected in taking these samples. The specification will state if the production test is to be non-destructively tested. It will also state what type of non-destructive test is to be performed.

---

When non-destructive tests are to be performed it will usually be in the form of radiographic inspection. The number or frequency of radiographs to be taken will be included in the specification document. However, when spot radiographic inspection is called for the inspector may be required to make the decision of when the radiographic inspection is to be made. These tests may be made by chance or in accord with an established order. In either case the contractor and the state are definitely concerned about new welders and some early radiographic inspection is highly desirable, followed by less frequent inspection once the welder has proven their consistent ability.

Additional non-destructive testing may be performed by magnetic particle inspection, trepanning, ultra-sonic, dye penetrant, metallurgical examination, mechanical testing to destruction of run off tabs or other detailed examinations.

### **Records & Reports**

Any work performed in the field that requires inspection or tests will also require records. However, required or not, an inspector should keep a good record of their work. This may be in the form of a set of notes or as detailed as the Resident Construction Engineer requires.

It is also the inspector's duty to check all records for detailed accuracy, in accordance with the contract documents, and to have them available when required. Any records that may require a contractor's signature should be prepared by the contractor and not by the inspector.

## **SECTION VI**

### **Specifications for Welding Procedures**

Many factors contribute to the end result of any welding operation. Because of the complexity it is desirable and essential that the vital parts, associated with the welding of a joint, are properly detailed to permit a clear understanding of the intended weld to all concerned. Generally, welding procedures have to be proved adequate by either qualification tests or enough prior use and experience to guarantee dependability. The sole purpose of welding procedures is to describe the details that are to be followed in the welding of specific materials or type of joint.

### **Description & Details**

The details of a welding procedure specification when written must be in accordance with the contract specifications and within good welding practice. They must be sufficiently detailed including welding sequence to insure welds that will satisfy the contract specifications.

The following is a list of details that are normally covered in a welding procedure specification for the shielded metal-arc process. Other welding processes may have some specification changes of varying degrees, and when used in the field a reference to AWS will most certainly be needed.

---

## **WELDING PROCESS - SHIELDED METAL-ARC**

**Filler Metal** - Unless otherwise specified in the contract the electrodes shall be E-7016, E-7018.

**Base Metal** - ASTM A709, Grade 36, or 50 or 50 W structural steel, ASTM A-252 steel pipe, ASTM A500 seamless steel structural tubing or A501 structural steel tubing

**Type of Current** -AC, DC reverse (electrode positive) or DC straight (electrode negative).

**Joint Design** - Single bevel (with backing) double bevel, square butt welds, or fillet welds, and the thickness of the base metal.

**Welder Qualification** - Welder qualified by tests given by the Iowa Department of Transportation.

**Preparation of Base Metal** – For materials up to 4 in. (100 mm) thick a max surface roughness value of 1000  $\mu$ in. (25  $\mu$ m) is permitted.

**Joint Welding Design** - Details that influence weld quality in terms of specification requirements. These details help determine the soundness of welds, and influence the structural properties of the finished joint.

**Welding Position** - Such as flat, horizontal, vertical or overhead

**Preheat Temperature** - Unless otherwise specified in the contract documents the preheat temperature shall be as specified in the AWS Bridge Welding Code. (See IM 560, the supplement to this IM).

**Interpass Temperature** - Equal to minimum preheat temperature at all times. Maximum temperature is not critical provided the heat input during welding is not excessive. However, if heat treated steels are used the maximum temperature will be found in the AWS Code or the contract documents.

### **Additional Details**

Some additional details that may not be mentioned in the welding procedure specification but still have adverse effects on the welding joint are summarized in the following paragraphs.

The indiscriminate use of peening shall not be permitted. Peening can be very detrimental to a weld if not properly used. However, the inspector should not confuse the use of the chipping hammer with peening a weld. Chipping hammers are required for the cleaning of slag from a weld. The definition of peening, in accordance with the AWS Code is, “the mechanical working of metals using impact blows or hammer blows.”

---

Excessive heat input during welding can also be detrimental to a weld. Therefore a controlled heat input is a must for a good weld. Cracks may result from welding processes involving large heat inputs. In the arc welding process the heat input is lowered by reducing the current or by increasing the travel speed while maintaining the same current level. This explanation then reveals to us that, the stringer bead is far superior to the weaving method in which the forward travel speed is drastically reduced while the current level remains constant.

When a weld is not completely satisfactory upon completion, local sections may have to be removed for repair. This shall be done by one or by a combination of the following approved processes; grinding, or air-arc gouging. These are the same methods that are permitted in preparing the joint for the first time. The repair weld shall be made by the same process and procedures as the initial weld.

Non-destructive testing of field welds is not made unless called for in the project specifications or directed by the engineer. Visual inspection of the welding is normally all that is required to be done by the inspector.

Postheat treatment of welds on structures is sometimes performed by a heat treatment of annealing process in order to develop the required mechanical properties or dependability as required. While this does not apply to the ordinary field welding work there are occasions when it has been called for. When postheat treatment is necessary it shall be part of the procedure specification and the inspector will be required to make sure the temperature is within the limits specified by the use of temperature sticks.

Welding procedure specifications are usually called for on the contract documents and then established by the contractor. Procedures that have the same basic fundamentals have been deemed as prequalified by the AWS.

## **SECTION VII**

### **WELDMENT DEFECTS**

Weldment defects can be classified into three groups:

1. Drawing or dimensional variations
2. Structural discontinuities within the weld
3. Physical or chemical properties of the weldment

#### **Drawing or Dimensional Defects**

The making of satisfactory welds in regard to dimensional defects depends upon keeping within the specified dimensions for the size and shape of welds and the finished dimensions of the product. Departure from the dimensions in any respect should be regarded as dimensional defects and must be corrected before the final acceptance of the weldment can be made. Defects of this nature may be further subdivided as follows:

**A. Incorrect Joint Preparation:**

Established welding procedures require proper joint dimensions and preparation for each joint according to the thickness of the material being welded. The failure of an inspector to require these criteria may result in a greatly increased tendency to produce the weld defects listed under structural discontinuities within the weld. Therefore it is very important that all joint preparations are the same as shown in the specifications (See Figure 1).

**B. Incorrect Weld Profiles & Sizes:**

The profile of a finished weld can have a considerable effect upon its performance under load. The profile of one layer of a multipass weld can have an effect on the next pass in that it may cause slag inclusions or incomplete fusion to occur between the passes. Requirements concerning these defects are in AWS under the article entitled Weld Profiles and the inspector should have a good working knowledge of them. Failure to conform to these requirements constitutes a weld defect. Permissible tolerances and corrections for these various defects will also be found in AWS under Articles "Quality of Welds," Article 9.21 and Repairs Article 3.7.

Overlap is a condition, which tends to produce notches, which are dangerous, due to the resultant concentrated stress under load. It is considered defective welding because the effective size of the fillet is reduced. It is also very hard for an inspector to be sure of the true fillet size, since the true size is governed by inscribing an isosceles right triangle inside the fillet weld cross section. Overlap is generally caused by improper welding technique or by improper electrical conditions. The inspector should look for overlap conditions primarily on the lower leg of fillet welds, but it can also be found at times on the last pass, or reinforcement pass of groove welds (See Figure 2).

Excess convexity, like overlap, tends to produce notches. What has been said about overlap is also true of excessive convexity. Excess convexity is also harmful in the case of an intermediate pass in a multi-layer groove weld, because slag inclusions or incomplete fusion can occur on a succeeding pass if corrective measures are not taken (See Figure 3).

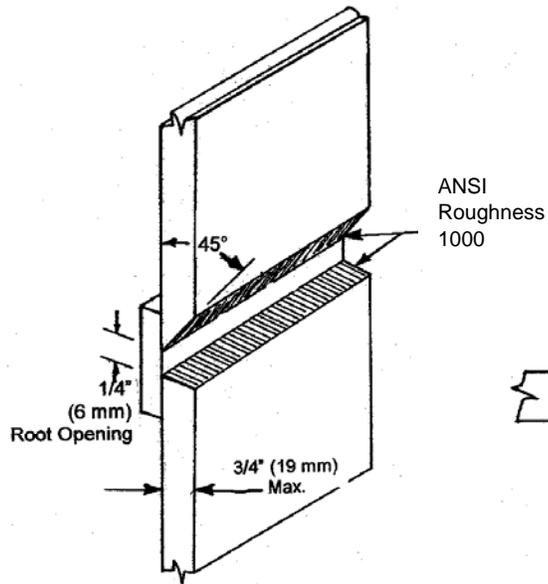


FIGURE 1

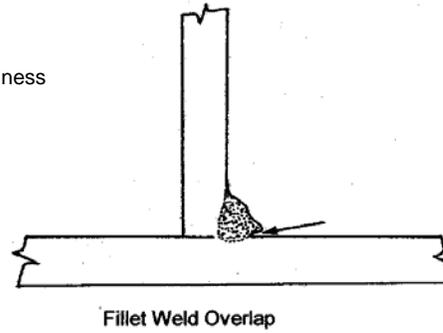


FIGURE 3

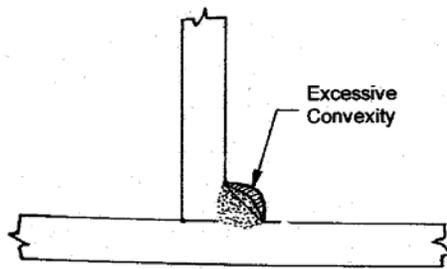


FIGURE 2

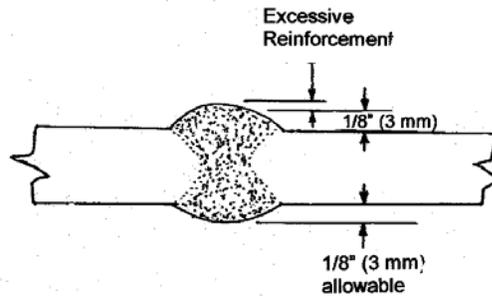


FIGURE 4

---

Excess concavity is usually associated with fillet welds. The actual strength of such welds is less than that of a standard size weld since its throat thickness is less than normal when measured by the length of the fillet leg. This condition is usually caused by excessive welding currents or arc lengths.

Excessive weld reinforcement is also undesirable in that it tends to stiffen the section and establishes notches that help create undesirable stress concentrations (See Figure 4).

### **C. Incorrect Final Dimensions:**

All weldments are fabricated to meet a plan dimension. The inspector and the welder must be aware of how much shrinkage can be expected at each weld joint and how much warpage will occur in the joint.

If the inspector visualizes the welding of a simple V on a simple plate and knows that the welding heat causes shrinkage in each pass, then they can also visualize the ends of the plate curling up. These heat shrinkage stresses will tend to produce cracking.

On welds that are designed to prevent shrinkage and warpage or welds that are restricted by manual devices it is obvious that while shrinkage must still occur it is restricted and thus produces shrinkage stresses that will tend to produce cracking.

The inspector should review the drawings to determine which dimensions are critical and then discuss the weldment dimensions and tolerance with the welder so he/she will devote major efforts to these critical areas (See Figure 5).

### **Structural Discontinuities**

When making manual shielded metal-arc welds, various types of defects may occur. These defects can be classified as structural discontinuities and consist of porosity, slag inclusions, lack of fusion, cracks etc. This terminology is used here to denote an interruption in the soundness in weld metal itself and not change in the metallographic structure of the metal such as laminations, scabs etc.

Porosity is gas pockets or voids in the weld metal which are free of any solid materials, such as slag. It is formed as a result of gases driven from the weld metal during solidification of the weld. Porosity is generally classified into different groups as follows: scattered, clustered and linear.

Scattered porosity occurs throughout the weld metal and the voids may vary in size from microscopic to slightly over 1/8 in. (3 mm) (See Figure 6).

Clustered porosity occurs in groups and may generally be associated with a change in welding conditions (See Figure 7).

Linear porosity occurs throughout the length of a weld and the voids are in a line with respect to the axis of the weld. This type of porosity generally comes in the root pass and usually can be traced to the inadequate preparation of the joint (See Figure 8).

The causes of most types of porosity can be controlled by avoiding the use of excessive currents and excessive arc lengths, the removal of rust prior to welding and proper preparation of the joint.



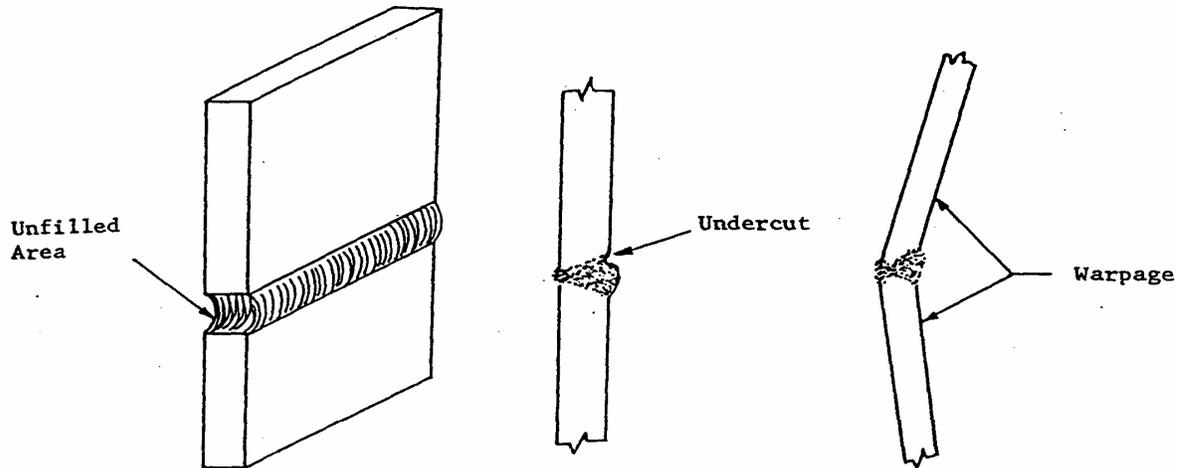


Figure 5

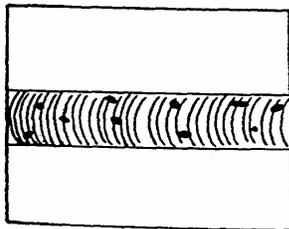


Scattered  
Porosity

Figure 6

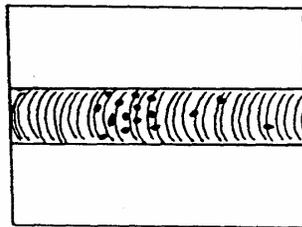

Clustered  
Porosity

Figure 7

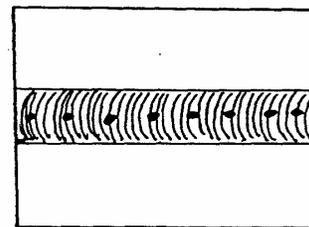

Linear  
Porosity

Figure 8

---

Slag inclusions are entrapped non-metallic solids in or near the weld metal and vary in size and location. Slag in molten weld metal will rise to the surface unless restrained by another force. When welding by any of the metal-arc processes slag or gas may be formed or forced below the surface of the molten metal by the stirring action of the electric arc. Slag can also flow ahead of the arc and thus cause metal to be deposited over it.

Slag can also form on a root pass of a V weld if the root opening is too small to permit the arc to heat the bottom of the recess to a high enough temperature to allow the slag to float to the surface (See Figure 9). The welder can create similar conditions to this by having undercutting or excessive convexity in a weld bead, or using too large an electrode in the root pass. This type of slag inclusion is elongated and usually of considerable size and thus the strength of the joint is reduced considerably.

When slag is forced into the molten metal or is formed by chemical reaction, its appearance is the same as porosity on a radiographic film. Slag of this type is most likely found in overhead welding.

The inspector should realize that most slag can be prevented by the welder using good sound welding practices, such as: proper preparation of the groove before each weld bead is deposited. Use care to correct contours that are outside specifications and the use of preheat to retard the weld metal solidification.

In making multiple pass welds the slag from the center of the pass is easily removed but the edges are usually more difficult. This slag area is often referred to as bond-line slag. In most cases this slag can be re-melted and rise to the surface in the next pass but it can also remain and will show up in a radiograph as elongated slag at the bond line. The welding inspector should use good judgement on this part of the inspection in seeing that the welder does a good job of removing the slag between passes but that a tiny amount of slag left at the bond line should work out during the next welding pass.

Where a welder does an imperfect job of slag removal and another welding pass is put down over it, the slag will tend to interrupt the arc and fusion of the weld metal is prevented along with the re-melting of the old slag. The inspector will find the result of this as scattered slag inclusions.

Incomplete fusion is another structural discontinuity of which the inspector must be aware. Incomplete fusion is sometimes referred to as lack of fusion. Actually, it is best described as the failure of weld metal to fuse to a base metal or other weld metal and may occur at any place in a weld. The cause for lack of fusion is due to the failure of raising the temperature of the base metal to the fusing point or the failure to dissolve by fluxing, the oxides or other foreign material on the surface of the metal to be welded. The best inspection for incomplete fusion is ascertaining the surfaces to be welded are free of all objectionable material (See Figure 10).

---

The term, undercut, is used primarily to describe the reduction of the base metal thickness at a line where the last bead of weld metal is fused to the surface or at the toe of a weld. It can occur on both groove and fillet welding but is most frequently found on the vertical leg of a horizontal fillet or the top side of a horizontal groove. Undercutting of both types is usually due to a technique employed by the welder, although magnetic arc blow can also be a factor. Undercutting can be detected by visual inspection and a tolerance for it has been set up in the AWS under the Article, "Weld Profiles" (See Figure 11).

Cracks in welded joints are results of a localized stress that at some point has exceeded the ultimate strength of the material. Materials that have good ductility under a single stress have been known to fail with little deformation under a multi-directional stress system. As discussed before, the unfused area of the root may result in cracks. Any material that is hard or brittle is more subject to cracking than a ductile one, therefore it is important that the inspector makes certain the right and properly cared for electrodes are used. The ability of weld metal to remain intact during the welding operation is due to the composition and structure of the weld metal. Once a crack has started it will continue through additional layers of weld metal as deposited unless it is repaired before additional layers are made.


Known causes of cracks are: the wrong use and manipulation of electrodes, improper electrical conditions, travel speed and lack of preheat.

Different types of cracks are: transverse, longitudinal, crater and base metal. The first three types are usually visible cracks that are easily found. The base metal cracks are much more difficult and test methods may be required to discover them. Like the name implies, the cracks are in the base metal and sometimes are under the weld bead (See figure 12).

Crater cracks are small and usually star-shaped and found in the weld crater itself. They start at the center of the crater and extend out to the end. Crater cracks are not detrimental to the weld metal if they are repaired. However, these may be starting points for longitudinal weld cracks when left unrepaired.


Various types of surface irregularities may occur during welding. These irregularities can vary from actual holes in the weld to surface roughness of the metal or excessive spatter. Improvement of these conditions is usually obtained by changing the electrical conditions. It is important to remove the cause of these irregularities because they can cause slag entrapment. In high quality welding it is not safe to assume that these irregularities will fuse out during the placement of the next weld bead. Good welding practice dictates their removal by grinding or chiseling.

The more uniform the weld bead surface, the better the eye appeal. Good welding that is poorly finished should not be excused except under unusual conditions even though the integrity of the job is beyond question. Such unusual conditions would be a great magnetic disturbance at the location of the weld. At times piling are driven too close to the ground for splicing and the welder has to bend over or lie down in order to make the splice.

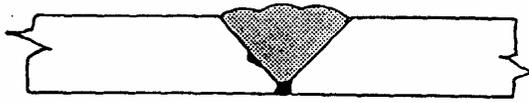




Inadequate Joint Preparation

Figure 9

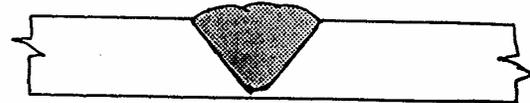


Incomplete Fusion

Figure 10

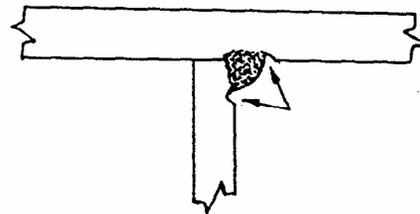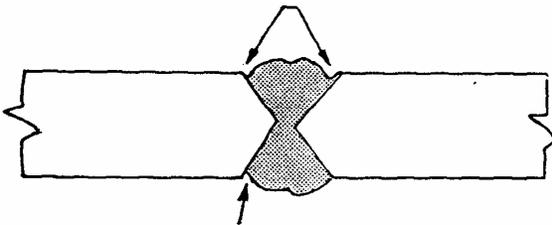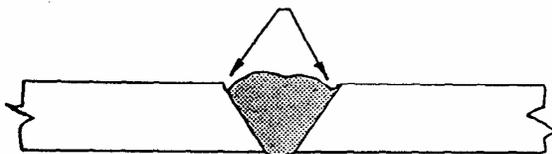

Undercutting on Groove and Fillet Welds

Figure 11

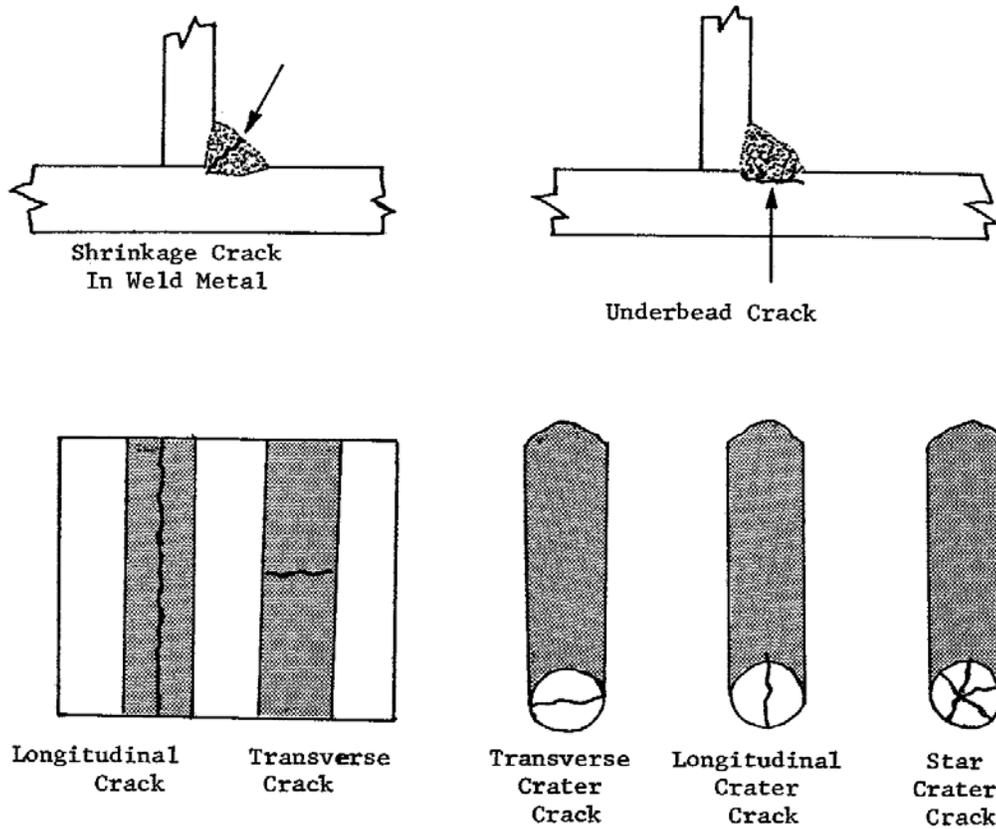

Various Types of Weld Metal Cracks

Figure 12

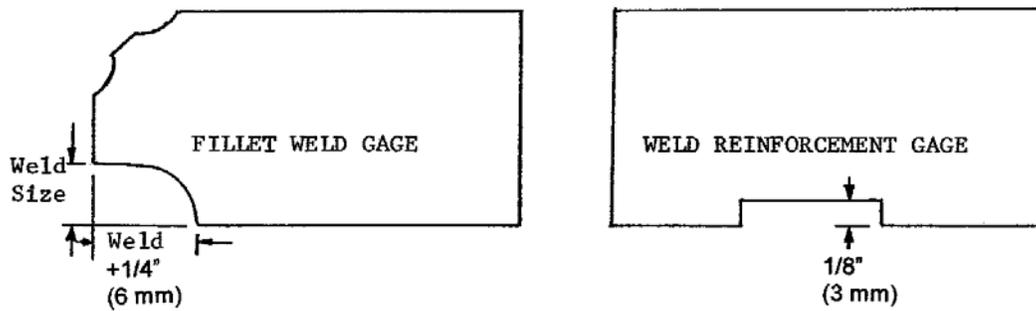


Figure 13

### **Physical & Chemical Properties of Weldments**

The physical and sometimes chemical properties are required on all weld metal. The properties are dependent upon the specifications involved. Any departure from these specifications must receive the approval of the engineer. The AWS D1.5 Bridge Welding Code specifies the type of electrode that must be used for weldments.

Every six months, the Office of Materials publishes a current list of approved electrode certifications and furnishes a list of these manufacturers and the electrode types as changes occur, to each of the District Materials Offices and the Ames Office of Construction. The welding inspectors should refer to the list periodically to assure themselves that the welder is using an approved electrode from an approved manufacturer.

### **Methods of Testing**

Various methods of testing are available to a weld inspector in a fabricating shop, but to a field weld inspector, the best inspection must be made by visual inspection and at best a few accessories such as gauges or a ruler. The following table has been set up for an inspection guide. Since radiographic inspection of field welding is rarely specified the field inspector's substitute is a periodic close observance of the welder's technique.

---

## TESTS FOR WELDS

<b>Defect</b>	<b>Methods of Testing</b>
<b><u>DIMENSIONAL DEFECTS</u></b>	
Warpage	Visual inspection with proper mechanical gauges
Incorrect joint preparation	Visual inspection - Comparison with workmanship sample
Incorrect weld size	Visual inspection with proper mechanical gauges
Incorrect weld profile	Visual inspection with proper mechanical gauges
Incorrect final dimensions	Visual inspection with proper mechanical gauges

---

## **STRUCTURAL DISCONTINUITIES**

Porosity	Radiographic - Magnetic Particle - Ultrasonic
Slag Inclusions	Radiographic - Magnetic Particle - Ultrasonic
Incomplete fusion	Radiographic - Magnetic Particle - Ultrasonic
Inadequate joint penetration	Radiographic - Magnetic Particle - Ultrasonic
Undercut	Visual inspection
Cracks	Visual inspection - Radiographic - Magnetic particle
Surface	Visual inspection - Comparison with workmanship sample

---

## **SECTION VIII**

### **NON-DESTRUCTIVE TESTING**

The purpose of nondestructive testing is to detect weld discontinuities in weldments without impairing the usefulness of the material. There is an increasing growth in the use and types of testing available to the inspector. Currently, the methods accepted for weld inspection are visual, magnetic particle, liquid penetrant, radiographic, ultrasonic, eddy-current and leak and proof test techniques.

---

Under any one circumstance, one of these methods may be more suitable for that purpose than any one of the others.

Most nondestructive testing is expensive in that the operator of the equipment must be thoroughly trained and acquainted with the theory and application of the equipment. Therefore, the Office of Bridges & Structures attempts to eliminate any field welding in critical areas as much as possible and thereby relies on visual inspection for the majority of its field welding.

### **Visual Inspection**

The visual inspection of weldments is of the first order of importance even when radiographic or other nondestructive means of testing is specified. It is the most important part of quality control. Visual inspection is also the most informative with regard to the general conformity of the weldment to specifications. It is the most extensively used of any method of inspection.

Visual inspection can be divided into four titles: inspection skills, inspection before welding, inspection during welding and inspection after welding.

#### Inspection Skills

The field inspectors should develop a definite procedure to insure adequate coverage of the various steps of welding. They must be familiar with the welding specifications, workmanship and all phases of welding.

#### Before Welding

Details to check before the welding starts are:

1. Material to Be Welded
2. Welder Qualification Certificate
3. Welder Equipment & Electrodes
4. Correct Bevel & Smoothness of Edge Preparation
5. Root Opening
6. Clearance of Backing Strip or Ring
7. Overall Alignment & Fit Up
8. Welding Procedure

#### During Welding

Details to check during the welding are:

1. Preheat & Interpass Temperature
2. Cleaning, Chipping, Grinding or Gouging
3. Structural Discontinuities
4. Postheating Temperature When Specified

---

### After Welding

Details to check after the welding are:

1. Dimensional Accuracy of Weldment
2. Conformity to Drawing Requirements
3. Acceptability of Welds With Regard To Appearance
4. Presence of Any Unfilled Craters, Undercuts, Cracks, Overlaps
5. Postheating Temperature When Specified

### Nondestructive Testing of Field Welded Steel Pile

The engineer may require nondestructive testing (NDT) of field welded steel pile.

Personnel performing NDT shall be qualified in conformance with the American Welding Society (AWS) D1.1M / D1.1.

Twenty-five percent of the pile weld joint will be tested on one pile per 10 piles with a minimum of two piles in each foundation.

Acceptance criteria shall be in accordance with AWS D1.1M / D1.1 for cyclically loaded non-tubular connections.

The contracting authority will be responsible for the initial travel costs for the NDT agency and for the testing described above. The contractor will be responsible for all costs associated with additional testing and weld repair or replacement.

If unacceptable discontinuities are found based on the NDT agency / engineer's review, the entire length of the pile weld shall be tested and two additional pile weld joints will be tested for each weld joint that is found to be unacceptable.

All welds tested with NBT that do not meet the requirements of the AWS code shall be repaired or replaced at the engineer's discretion.

After any welds have been repaired and / or replaced, additional NDT testing shall be performed to ensure the repairs are satisfactory. This testing shall include all of the repair area plus at least 2 inch (50 mm) on each side of the repaired area.

### Summary

Visual inspection is invaluable as an inspection method but caution must be used in drawing conclusions. The inspector should not judge a good surface appearance in itself as high weld quality, but rather base judgement on evidence afforded by observations made prior to and during the welding along with the good weld appearance.

Gauges and workmanship samples are also useful to the inspector and he/she should familiarize themselves in their use. Gauges can be readily made from a thin piece of sheet

metal or cardboard if necessary. Figure 13 gives the basic dimensions necessary for simple gauges.

## **SECTION IX**

### **WELDING EQUIPMENT**

Most field welding machines are portable, that is, they are on a truck and can be moved around. The welding machine is usually a generator driven by a gasoline-powered engine and puts a DC current that may be reversed by changing the leads. The welding machine must contain a gauge or some means of determining the amperage output along with some method of increasing or decreasing the amperage as desired. The leads shall be in good condition with unfrayed connections at both ends.

Good quality electrodes are a must. Welding manufacturers produce good quality electrodes that conform to the AWS Code test requirements; however, this does not ensure their good quality when delivered to the job site. The welder should discard any damaged electrodes. When using low hydrogen electrodes, he/she must furnish them from undamaged hermetically-sealed containers and have an oven for maintaining their dryness.

The welder's cleaning tools should consist of a chipping hammer and a wire brush. A cold chisel and a hammer may be substituted for the chipping hammer.

A cutting torch must also be available for cutting, beveling and fitting up of the joints of field welds when required. A grinder is also necessary for smoothing out rough cuts and for the removal of a bad weld. Few welders are so skilled with a torch that grinding is not necessary.

The welder must have knowledge of the joint to be welded. Before welding, the inspector should check this knowledge against the information furnished to the Resident Construction Engineer and make certain that it conforms to requirements outlined in these instructions.

All welders shall be responsible for being able to prove that they have a valid Iowa Department of Transportation welding certificate.

### RECOMMENDED COPPER WELDING CABLE SIZES

Power Source		AWG Cable Size for Combined Length of Electrode and Workpiece Cables				
Rating in Amperes	Duty Cycle %	0 to 50 ft. 0 to 15m	50 to 100 ft. 15 to 30m	100 to 150 ft. 30 to 46m	150 to 200 ft. 46 to 61m	200 to 250 ft. 61 to 76 m
100	20	6	4	3	2	1
180	30	4	4	3	2	1
200	60	2	2	2	1	1/0
300	60	1/0	1/0	1/0	2/0	3/0
400	60	2/0	2/0	2/0	3/0	4/0
500	60	2/0	2/0	3/0	3/0	4/0

---

600	60	2/0	2/0	3/0	4/0	*
-----	----	-----	-----	-----	-----	---

---

\*Use two 3/0 cables in parallel.

**Typical Current Ranges for Electrodes in Amperes for Shielded Metal Arc Welding**

3/32 in. (2.38 mm)	65-110	70-100	-
1/8 in. (3.18 mm)	100-150	115-165	140-190
5/32 in. (3.97 mm)	140-200	150-220	180-250
3/16 in. (4.76 mm)	180-255	200-275	230-305
7/32 in. (5.58 mm)	240-320	260-340	275-365
1/4 in. (6.35 mm)	300-390	315-400	335-430
5/16 in. (7.94 mm)	375-475	375-470	-

**TEMPERATURE STICKS**

Fahrenheit Temperature Sticks by Tempil are available as follows:

6° increments	100°-350°	50° increments	650°-900°
2°-13° increments	350°-500°	Approx. 25° increments	900°-1050°
5° increments	500°-650°	50° increments	1050°-2500°

**SECTION X**

**INSPECTOR RESPONSIBILITIES**

Under Section V the duties of the inspector were described in a general way but detailed inspection was not spelled out. In Section VII a detailed list of items was given as a check list for the inspector. It is now possible for the inspector to be familiar with the inspection required and be able to follow the instruction in this IM with a sense of responsibility.

Consultation with the welder is one responsibility the inspector should take care of as soon as it is known who the welder is going to be. If a visit with the welder before he/she comes on the job is possible, this is even better than a discussion after their arrival. After having checked their certificate, the class and polarity of the electrode should be discussed along with the proper preheat and interpass temperature. Consult with them on the need for proper joint preparation and fit-up. Give their first joint special attention so that caution will be used throughout the job.

**WELDING OF PILING**

A description of the various types of piling and the welding is well defined on pages 43 through 46 of this IM. The inspector who follows the procedures outlined in the instructions will be able

---

to carry out the inspection duties with great care. See Appendix A.

### **WELDING OF SHEAR STUD CONNECTORS**

Stud welding must comply with the AWS Code D1.5, Section 7. Only studs with a qualified stud base may be used. Those currently approved are listed in IM 453.10, Appendix A. Any other brand must submit their qualification tests to the Iowa Department of Transportation, Office of Materials, in Ames for approval.

A manufacturer studs certification and certified test reports shall be required and shall be as outlined in the AWS Code D1.5, Paragraph 7.3.3.

Operator Qualification: The first two stud shear connectors welded on a bridge member, after being allowed to cool, shall be bent to an angle of 30 degrees from their original axis' by striking the studs with a hammer. If failure does not occur in the weld zone of either stud the operator shall be qualified. If failure occurs in the weld zone of either stud, the procedure shall be corrected and two more studs shall be welded to the bridge member and tested. If either of the second two studs fails, additional welding shall be continued on separate plates until two consecutive studs are tested and found to be satisfactory. Two consecutive studs shall then be welded to the bridge member, tested, and shall be found to be satisfactory before the operator can be qualified. The inspector shall then document the test in his / her file with the name of the operator and date of test. Qualification of each operator must be documented at the start of each project.

Welding shall not be done when the temperature of the base metal is below 0°F (-18° C) or when the surface is wet or exposed to rain or falling snow. When the temperature is below 32°F (0°C) one additional stud in each 100 studs welded shall be tested (see Note 1) in addition to the first two tested.

**Note 1:** Test shall consist of bending the studs after they are allowed to cool to an angle of approximately 30° from the original axis by striking the studs on the head with a hammer.

The stud base shall not be painted, galvanized, nor cadmium-plated prior to stud welding.

Studs shall be free from rust, rust pits, scale, oil, moisture, and / or any other deleterious matter that may adversely affect the welding process.

The areas to which the studs are to be welded shall be free of scale, rust, moisture, and any other injurious material to the extent necessary to obtain satisfactory welds. These areas may be cleaned by grinding, wire brushing, scaling , prick-punching.

The arc shields or ferrules shall be kept dry. Any arc shields which show signs of surface moisture from dew or rain shall be oven dried at 250° F (120°C) for two hours before use.

Longitudinal and lateral spacing of stud shear connectors (Type B – see note # 2) with respect to each other and edges of beam or girder flanges may vary by a maximum of 1.0 inch (25.4

---

mm) from the location shown in the drawings. While the clear distance between studs shall not be less than 1.0 inch (25.4 mm), the minimum distance from the edge of a stud base to the edge of a flange shall be the diameter of the stud plus 1/3 inch (3mm) but not less than 1 ½ inch (38 mm).

After the studs have been welded to the bridge member a visual inspection shall be made and each stud shall be given a light blow with a hammer. Any stud which does not have a complete end weld (360° fillet), any stud which does not emit a ringing sound from the light hammer blow, any stud that has been repaired by welding, shall be struck with a hammer and bent 15° from the correct axis of installation, and in the case of a defective or repaired weld, the stud shall be bent 15° in the direction that will place that defective area of the weld in the greatest tension. Studs that crack either in the weld or the shank, shall be replaced.

If 10% of the studs applied to any bridge member requires bending, the welding shall be suspended until the necessary changes are secured to produce satisfactory studs on the subsequent members. If conditions warrant, the inspector may require additional studs to be bent.

**Note 2:** There are two types of studs Type A Studs have a lower strength and are for general purpose use and are prohibited for shear transfer in composite construction. The higher strength studs, Type B are used as an essential component of composite beam construction. Only Type B studs have a minimum specified yield strength, necessary for proper in-service performance.

After welding, arc shields (ferrules) shall be broken free from studs to be embedded in concrete and as well from all other studs.

**Note 3:** The fillet weld profiles shown in 3.3 of the code do not apply to the flash of automatically timed stud welds. The expelled metal around the base of the stud is designated as flash in accordance with Appendix V of this code. It is not a fillet weld such as those formed by conventional arc welding. The expelled metal, which is excess to the weld required for strength, is not detrimental but, on the contrary is essential to provide a good weld. The containment of this excess molten metal around a welded stud by the ferrule (arc shield) assists in securing sound fusion of the entire cross section of the stud base. The stud weld flash may have nonfusion in its vertical leg and overlap on its horizontal leg, and it may contain occasional small shrink fissures or other discontinuities that usually form at the top of the weld flash with essentially radial or longitudinal orientation, or both, to the axis of the stud. Such nonfusion, on the vertical leg of the flash, and small shrink fissures are acceptable.

Studs that are to be replaced for reasons cited above or because they have otherwise been rendered unacceptable may be repaired by adding a 5/16 in. (8 mm) minimum fillet weld in place of the missing weld. The shielded metal arc process with low hydrogen electrodes, 5/32 in. (4 mm), or 3/16 in. (5 mm) in diameter shall be used in accordance with the AWS code. The repair weld shall extend at least 3/8 in. (10 mm) beyond each end of the discontinuity being repaired. Whenever the shielded metal arc process is used the AWS Code minimum preheat and interpass temperature Table 4.4 applies. (See IM 560, the supplement to this IM.)

Studs that have failed the test shall be removed and replaced. The replacement area must be determined as to tension or compression and the repair shall be made as follows. In members subject to tensile stresses the stud shall be removed and the area ground smooth and flush. In the area where base metal has been pulled out with the stud it shall be filled by the shielded metal arc process using low hydrogen electrodes and a qualified welder. After filling of the base metal the entire area shall be ground smooth. In members subject to compression stresses and the failure is above the fillet weld a new stud shall be welded adjacent to the defective one. When base metal is pulled from such area the repair shall be the same as for the tensile stress area except when the depth of defect is not more than the lesser of 1/8 in. (3 mm) or 7% of the base metal thickness the defect may be faired by grinding in lieu of filling the defective area with the weld metal. Where a replacement stud is to be placed in the defective area, the above repair shall be made prior to welding the replacement stud. Replacement studs shall be tested by bending to an angle of 15° from their original axis.

Studs shall be welded with automatically timed stud welding equipment connected to a suitable source of direct current electrode negative (DCEN) power. Welding voltage, current, time, and gun settings, based on past practice, recommendations of stud and equipment manufacturer, or both.

If two or more stud welding guns are to be operated from the same power source, they shall be interlocked so that only one gun can operate at a time and so that the power source has fully recovered from making one weld before another weld is started.

While in operation the welding gun shall be held in position without movement until the weld metal has solidified.

That option of the fabricator, studs may be fillet welded by the shielded metal arc process, provided the following requirements are met:

1. The minimum fillet size to be used shall be as required in the table below (also see table 7.2 in AWS Code)
2. Welding shall be done with low-hydrogen electrodes 5/32 or 3/16 inch (4 or 5 mm) in diameter except that a smaller diameter electrode may be used on studs 7/16 in (11 mm) or less in diameter or for out-of-position welds.

Minimum Fillet Weld Size for Small Diameter Studs

<u>Stud Diameter</u>		<u>Minimum Size Fillet</u>	
<u>Inch</u>	<u>MM</u>	<u>Inch</u>	<u>MM</u>
¼ thru 7/16	6.4 thru 11.1	3/16	5
½	12.7	¼	6
5/8, 3/4 , 7/8	15.9, 19, 22.2	5/16	8
1	25.4	3/8	10

The stud base shall be prepared so that the base of the stud fits against the base metal.

All rust and mill scale at the location of the stud shall be removed from the base metal by grinding and the end of the stud shall also be clean.

The base metal to which studs are welded shall be preheated in accordance with the requirements or the table shown below (Minimum Preheat and Interpass Temperature) also see table 4.4 of AWS Code.

The inspector shall make certain that the size, length and location of all welds conform to the requirements of this IM and those of the AWS Code.

Only approved WPS can be used as required by section 5 of the AWS Code.

The inspector shall make certain that electrodes are used only in the positions and with the type of welding current and polarity for which they are classified.

The inspector shall, at suitable intervals, observe the joint preparation, welding techniques, and performance of each welder as well each tack welder to make certain that all applicable requirements of this IM and those of the code are met.

**Minimum Preheat and Interpass Temperature °F (C°)**

Group	Welding Process (Base Metal)	Thickness of Thickest Part at Point of Welding, in. (mm)			
		To 3/4 in. Incl. (19)	Over 3/4 in. to 1-1/2 in. Incl. (19 to 38)	Over 1-1/2 in. to 2-1/2 in. Incl. (38 to 63.5)	Over 2-1/2 in. (63.5)
I/II	Shielded Metal Arc Welding; Submerged Arc Welding; Gas Metal Arc Welding; or Flux Cored Arc Welding (M270 [A709] Gr. 36, 50, 50W)	50 (10)	70 (20)	150 (65)	225 (110)
IV	Shielded Metal Arc Welding; Submerged Arc Welding; Gas Metal Arc Welding; or Flux Cored Arc Welding (M270 [A709] Gr. 70W, 100, 100W) (Note 2)	50 (10)	125 (50)	175 (80)	225 (110)

---

## **WELDING FOR SUPPORT OF FLOOR FORM JOISTS & FINISHING MACHINE RAILS**

Unless otherwise authorized by the engineer, any welding to the top flange of steel members for supporting floor form joists and finishing machine rails will not be permitted. Welding of hangers and supports to shear studs will be permitted as follows:

1. The welder must be certified and use low hydrogen electrodes and proper preheat.
2. No welding shall be permitted when the ambient temperature of the air is below 32°F (0°C) or when the lowest temperature during the preceding 12 hours has been below 0°F (-18°C).
3. Windbreaks or shields shall be provided when the wind chill factor is strong or cold enough to prevent welding from being carried out in a normal manner without such protection.
4. Welding shall not be permitted on surfaces that are wet or exposed to snow.
5. Arc strikes on bridge flanges must be prevented at all times.

## **SECTION XI**

### **STRUCTURAL FIELD WELDING**

#### **DESCRIPTION**

Field welding members using the shielded metal arc and flux-cored arc welding processes

#### **MATERIALS**

Electrodes for shielded metal arc welding (SMAW) shall conform to the requirements of the latest edition of ANSI/AWS A5.1, *Specification for Mild Steel Covered Arc Welding Electrodes*, or ANSI/AWS A5.5, *Specifications for Low-Alloy Steel Covered Arc Welding Electrodes*.

Electrodes for flux-cored arc welding (FCAW) shall conform to the requirements of the latest edition of ANSI/AWS A5.20, *Specification for Carbon Steel Electrodes for Flux-Cored Arc Welding*, or ANSI/AWS A5.29, *Specification for Low-Alloy Steel Electrodes for Flux-Cored Arc Welding*.

Electrodes for SMAW and FCAW shall be on the approved list maintained by the Office of Materials. To request that a product be added to this list or to renew an expired approval, the Contractor or the consumable manufacturer must submit certified reports of all tests required by the applicable AWS A5 Specification, according to the applicable welding code, to the Materials Testing Engineer. For most structural steel construction, the applicable welding code is AASHTO/AWS D1.5, *Bridge Welding Code*, or ANSI D1.1, *Structural Welding Code – Steel*. Tests must be conducted on electrodes of the same class, size and brand and manufactured by

the same process and with the same materials as the electrodes to be furnished. Test results for electrodes shall be submitted every 12 months for renewal.

Table 1 shows the classes of electrode required. Use electrode with the type of current, with the polarity, and in the positions permitted by AWS A5.1 and A5.5 for SMAW. AWS A5.20 and A5.29 Specifications govern for FCAW. Approval shall be obtained for electrode use on steel not listed in Table 1.

**TABLE 1**  
**Classification of Electrodes Permitted**

<b>Type of Steel (ASTM Standards)</b>	<b>Electrode Specification</b>	<b>Process</b>	<b>Filler Metal Requirements</b>
A36 A572, Gr. 50 A588 A242 A709, Gr. 36, or S	AWS A5.1 or A5.5	SMAW	E7016 E7018 E7028
	AWS A5.20 or A5.29	FCAW	E7XT-1 E7XT-5 E7XT-6 E7XT-8
Weathering  A588 A242 A709, Gr. 50W	AWS A5.5	SMAW	E8018-W E8016-C3 E8018-C3 E8016-C1 E8018-C1 E8016-C2 E8018-C2
	AWS .29	FCAW	E8XT1-W E8XTX-Ni1 E8XTX-Ni2 E8XTX-Ni3
A709, GR. HPS 70W	AWS A5.5	SMAW	E9018-M-HBR

**NOTE:** Low-hydrogen electrodes applicable to the lower strength base metal may be used in joints involving base metals of different yield points or strength.

When welding fracture-critical applications, use electrodes meeting the diffusible hydrogen requirements for fracture-critical welding in AASHTO/AWS D1.5.

---

## **EQUIPMENT**

The Contractor shall provide the following equipment: Electrode drying and storing ovens that can maintain the required temperatures specified in the AWS Code D1.5-95, Section 4, along with thermometers for checking and controlling the oven temperatures, preheating equipment that can maintain the entire joint at or above the specified temperature, approve equipment for checking preheat and interpass temperatures at all times while welding is in progress, welding equipment meeting the requirement of the approved welding procedure specification (WPS), and capable of making consistent high-quality weld.

## **CONSTRUCTION**

**PROCEDURE QUALIFICATION:** The proper classification and size of electrode, arc length, voltage, and amperage for the thickness of the material, type of groove, welding positions, and other circumstances of the work shall be used.

For welding of main members, WPS for FCAW shall be qualified in accordance with AASHTO/AWS D1.5, before any field welding on a project.

Welders shall be on the IDOT approved Field Welders List. Welders shall be confined and limited to welds only with the process and in the positions for which they are certified.

**FIELD WELDER CERTIFICATION:** Before making any welds on structural steel, a welder must pass the AWS Code D1.5 qualification test for groove welds. ASTM A36 shall be used for test plates. Approved electrodes meeting the requirements of the AWS Code D1.5 and the approved WPS shall be used. Two bend specimens shall be prepared, tested and inspected for each test plate. The IDOT Materials Testing Laboratory, or an approved laboratory, shall do the preparation and testing. Radiographic examination of welder and welding operator qualification test plates may be made in lieu of a bend test. Radiography procedure and test results shall comply with the AWS Code D1.5, Sections 5.26 and 5.27.

The field welder's qualification herein specified will be considered as remaining in effect from the end of the month in which the test was taken, for a period of one year. For field welders who have successfully passed their qualification tests without failure for three consecutive years, requalification will only be required every two years. Requalification may be required at any time there is a specific reason to question a welder's ability to make sound welds.

A welder must also demonstrate to the Engineer a thorough knowledge of the required welding procedures together with the ability and desire to follow them and make welds of sound quality and good appearance.

For SMAW, a welder certified using EXX18 electrodes is qualified to weld with all approved SMAW electrodes up to E90XX to join metals with a maximum specified yield strength of 65 ksi.

---

## **WELDING STEEL STRUCTURES**

### 1. ELECTRODE CONDITION

- a. SMAW. Electrodes with low-hydrogen coverings conforming to AWS A5.1, shall be dried in conformance with the manufacturer's written drying instructions or dried for at least two hours between 450°F and 500°F. For electrodes with low-hydrogen coverings conforming to AWS A5.5, dry for at least one hour between 700°F and 800°F or as specified by the electrode manufacturer. If using electrodes from a newly opened undamaged hermetically-sealed container, drying is not required. Immediately after drying or removal from hermetically-sealed container, store electrodes in ovens held at a temperature of at least 250°F. Elapsed time permitted between removal of an electrode from the storage oven or hermetically-sealed container and use of the electrode is given in Table 2.

**TABLE 2**

**SMAW Electrode Exposure Limits**

<b>Electrode Type</b>	<b>Exposure Time (Hours)</b>
E70	4
E80	1
E90	1

If electrodes are placed back in the holding oven before the times given in Table 2 have lapsed, leave them in for at least four hours at 250°F before reusing. Do not redry electrodes more than once. Do not use electrode with flux that has been wet, cracked, or otherwise damaged.

- b. FCAW: Protect or store welding wire coils removed from the original package to keep their characteristics or welding properties intact. Do not use coils or portions of coils that are rusty.
  - c. SPECIAL APPLICATIONS: For fracture-critical applications or when welding steel not shown in Table 1, dry electrodes in accordance with the manufacturer's specifications and AASHTO/AWS D1.5.
2. ENVIRONMENTAL CONDITIONS: Do not weld when the air temperature is lower than 0°F; when surfaces are wet or exposed to rain, snow, or wind; or when operators are exposed to inclement conditions. Windbreaks shall be provided to protect the welding operations from winds greater than 5 mph.
  3. ASSEMBLY & FITUP: Ends of members to be welded shall be prepared in accordance with the welded joint detail specified.

The parts to be joined by fillet welds shall be brought into as close contact as possible not separated more than 3/16 in. If the separation is 1/16 in. or more, increase the leg of the fillet weld by the amount of the separation. Keep the separation between faying surfaces of lap joints and of butt joints landing on backing strips to no more than 1/16 in.

Make suitable allowance for shrinkage, and never restrain the joint on both sides of any weld. Bring all members into correct alignment and hold them in position by acceptable clamps while welding.

4. **PREHEAT:** Preheat ahead of welding both groove and fillet welds (including tack welding) to the temperatures shown in Table 3. Keep preheat and interpass temperatures high enough to prevent cracks. The preheat temperatures shown in Table 3 are minimums, and higher preheats may be necessary in highly restrained welds. When the base metal is below the required temperature, preheat it so that parts being welded are not cooler than the specified temperature within three inches of the point of welding.

Measures preheat temperature on the side opposite to which the heat is applied at points approximately three inches away from the joint.

When possible, completely weld a joint before allowing it to cool below the specified temperature. Always deposit enough weld to prevent cracking before allowing a joint to cool. Do not allow preheat and interpass temperatures to exceed 400°F for thickness up to 1½ in. and 450°F for greater thickness.

**TABLE 3**

**Minimum Preheat & Interpass Temperature  
For Welding with Low-Hydrogen Electrodes**

<b>Thickest Part at Point of Welding</b>	<b>Temperature</b>
Up to 3/4 in., inclusive	50°F
More than 3/4 in. up to 1 1/2 in., inclusive	70°F
More than 1 1/2 in. up to 2 1/2 in., inclusive	150°F
More than 2 1/2 in.	225°F

Preheat and interpass temperatures for the thicker plate thickness when joining steels of different thickness shall be used.

When the base metal temperature is below 32°F, preheat to at least 70°F and maintain this minimum temperature during welding. If the base metal is moist, preheat it to 200°F before starting to weld.

---

## **WELDING PRACTICE**

An approved procedure to control shrinkage and distortion shall be used. Weld as required by the contract or erection drawings. Do not change the location or size of welds without approval. Do not make temporary welds for transportation, erection, or other purposes on main members except as shown on the plans or approved by the Engineer. Use an approved method to mark each groove weld to identify the welder who performed the work.

Use the stringer bead technique where possible for groove welds. In vertical welding passes, progress upward, using a back-step sequence.

Begin and terminate groove welds at the ends of a joint on extension bars. Make edge preparation and thickness of extension bars the same as that of the member being welded, but extending at least two in. beyond the joint. After the weld is completed and cooled, remove extension bars with a cutting torch or arc-air gouging, and grind the edges smooth. If the grinding exposes any defects, clean them, fill them with weld metal, and regrind them to a uniform finish. Grind so that grind marks are parallel to the length, and avoid excess grinding of the parent metal. Clean and fuse tack welds thoroughly with the final weld. Remove defective, cracked, or broken tack welds.

Gouge, chip, or otherwise remove the root of the initial weld to sound metal for all groove welds, except those produced with the aid of backing before welding is started on the second side. Thoroughly clean the backside before placing the backup pass. For groove welds made with steel backing, thoroughly fuse the weld metal with the backing, and use backing that is continuous for the full length of the weld. Make a continuous length of backing by welding shorter sections together only under the following conditions:

- All splices in the backing shall be complete joint penetration (CJP) groove welds made with the same controls as similar CJP groove welds in the structure.
- Radiographic or ultrasonic test shall be used to assure weld soundness.
- All welding and testing of the backing shall be complete before the backing is used to make the structural weld.

## **ELECTRODE SIZE & WELD LAYER THICKNESS**

### 1. SMAW

a. ELECTRODE SIZE: Use electrode with the following maximum size:

- 1/4 in. for all welds made in the flat position except root passes
- 1/4 in. for horizontal fillet welds

- 
- 1/4 in. for root passes of fillet welds made in the flat position and of groove welds made in the flat position with backing and with a root opening of 1/4 in. or more
  - 5/32 in. for welds made with low-hydrogen electrodes in the vertical and overhead positions
  - 3/16 in. for all other welds
- b. WELD SIZE & LAYER THICKNESS: The root pass shall be large enough to prevent cracking. Make layers subsequent to the root pass in fillet welds and all layers in groove welds of the following maximum thickness:
- 1/4 in. for root passes of groove welds
  - 1/8 in. for subsequent layers of welds made in the flat position
  - 3/16 in. for subsequent layers of welds made in the vertical, overhead, and horizontal positions

Make fillet welds passes no larger than:

- 3/8 in. in the flat position
- 5/16 in. in the horizontal or overhead positions
- 1/2 in. in the vertical position

## 2. FCAW

- a. ELECTRODE SIZE: Use electrodes with the following maximum size:
- 5/32 in. for the flat and horizontal positions
  - 3/32 in. for the vertical positions
  - 5/62 in. for the overhead position
- b. WELD SIZE & LAYER THICKNESS: Make weld layers, except root and surface layers, no thicker than 1/4 in. When the root opening of a groove weld is 1/2 in. or wider, use a multiple-pass split-layer technique. Use the split-layer technique to make all multiple-pass welds when the width of the layer exceeds 5/8 in.

Ensure that each pass has complete fusion with adjacent base metal and weld metal and that there is no overlap, excessive porosity, or undercutting.

---

Do not use FCAW with external gas shielding in a draft or wind. Furnish an approved shelter of material and shape to reduce wind velocity near the welding to a maximum of 5 mph.

Make fillet weld passes no larger than:

- 1/2 in. in the flat position
- 3/8 in. in the horizontal or overhead positions; and
- 5/16 in. in the vertical position.

### **WELD QUALITY**

Weld quality and testing shall be in accordance with the drawings, specifications, and special provision as applicable.

### **CORRECTIONS**

When welding is unsatisfactory or indicates inferior workmanship, the Engineer will require corrective measures and approve the subsequent corrections.

Use arc-air gouging when required to remove part of the weld or base metal. Do not use oxygen gouging. Backgouge splices or cut out defective welds using arc-air gouging by a welder qualified to make beam and girder splices.

Where corrections require depositing additional weld metal, slope the sides of the area to be welded enough to permit depositing new metal.

Correct defective or unsound welds either by removing and replacing the entire weld or as follows:

- a. **EXCESSIVE CONVEXITY:** Reduce to size by grinding off the excess weld metal, leaving a smooth profile.
- b. **SHRINKAGE CRACKS, CRACKS IN BASE METAL, CRATERS & EXCESSIVE POROSITY:** Remove defective portions of base and weld metal down to sound metal, and replace with additional sound weld metal.
- c. **UNDERCUT, UNDERSIZE, & EXCESSIVE CONCAVITY:** Clean and deposit additional weld metal.
- d. **OVERLAP & INCOMPLETE FUSION:** Remove and replace the defective portion of weld.

- 
- e. **SLAG INCLUSIONS:** Remove the parts of the weld containing slag, and replace them with sound weld metal.
  - f. **REMOVAL OF BASE METAL DURING WELDING:** Clean and form full size by depositing additional weld metal using stringer beads.

Where corrections require depositing additional weld metal, use a smaller electrode than that used for the original weld. Clean surfaces thoroughly before rewelding.

Remove cracked welds completely and repair. If crack length is less than half the length of the weld, remove the weld metal for the length of the crack plus two inches beyond each end of the crack, and repair.

Where work performed after making a deficient weld has made the weld inaccessible or has caused new conditions making the correction of the deficiency dangerous or ineffectual, restore the original conditions by removing welds, members, or both before making the necessary corrections; otherwise, compensate for the deficiency by performing additional work according to revised and approved design.

Cut apart and reweld improperly fitted or misaligned parts.

Straighten members distorted by the heat of welding using mechanical means or the carefully supervised application of a limited amount of localized heat. Do not let heated areas exceed 1200°F as measured by temperature-indicating crayons or other approved methods for steel up to 65,000-ksi-yield strength. Do not let heated areas exceed 1100°F for higher-strength steels. Keep parts to be heat straightened substantially free of stress from external forces except when mechanical means are used with the application of heat. Before straightening, submit a straightening procedure to the Engineer for approval.

## **SECTION XII**

### **Welding of Railroad Bridge Deck Floors**

Railroad bridges that span highways are designed with a steel deck that covers the bridge and are welded together in the field. The special provisions that accompany railroad bridge lettings usually specify that a welding procedure be submitted for the field welding of the deck.

The welding procedure for the steel deck must not only cover the design of the welding joint, but it must also cover the sequence of welding. This welding procedure should receive the approval of the Office of Materials before welding is permitted.

Since railroad steel bridge decks vary in length, width and type of steel used it is somewhat difficult to have a standard welding procedure and sequence to cover them. Basically, all the requirements necessary for qualifying the procedure and sequence are in AWS under Sections 2, 3 and 5. The field inspector should understand the welding procedure and sequence thoroughly so he may help direct the welder in following the proper steps necessary.

Steel bridge decks involve longitudinal and transverse groove welds made in the flat position and are usually on plates of 1/2 in. (13 mm) thickness. Since welding is in both directions a multi-directional stress system can be built in if the procedure and sequence are not properly followed.

### **SECTION XIII**

#### **Welding of Reinforcing Steel**

The welding of deformed reinforcing steel is not permitted without the approval of the Structural Materials Engineer. The welding or tack welding of deformed reinforcing steel is detrimental to the mechanical properties of the bar, unless a special welding procedure with proper preheat and interpass temperature has been established according to the carbon and manganese content of the bar. Any field inspector who discovers welding on deformed reinforcing bars should notify their superiors, or with their permission, contact the Structural Materials Engineer.

When the welding of deformed reinforcing steel is permitted it is part of the specifications or at a location where the stresses of the steel is nil or at a minimum.

**Tack Welding of Reinforcing Steel.** See Article 2407.05 of the Standard Specifications.

### **SECTION XIII**

#### **Welder Qualification**

When a welder is tested for ability, it is conducted by the field Materials Office. These field inspectors issue the test plates and instruction to the welder, witness the welding of the plates and fill out the necessary forms. The machining, testing and reporting is done by the Office of Materials.

A copy of the instructions to field welders is included in this manual as additional information for the field construction inspector. While these instructions are for the welder they may also be helpful to field welding inspectors.

### **REFERENCES**

The American Welding Society (AWS) has published several books on welding. The following is a list of books that are available from the Office of Materials in Ames, Iowa.

---

**Filler Metal Specifications:**

A5.1-91	Mild steel Covered Arc-Welding Electrodes
A5.5-96	Low Alloy Steel Covered Arc-Welding Electrodes
A5.10-92	Aluminum and Aluminum Alloy Welding Rods and Bare Electrodes
A5.15-90	Welding Rods and Covered Electrodes for Welding Cast Iron
A5.17-97	Bare Mild Steel Electrodes and Fluxes for Submerged - Arc Welding
A5.18-93	Mild Steel Electrodes for Gas Metal - Arc Welding
A5.20-95	Mild Steel electrodes for Flux-Cored Arc Welding
A5.23-97	Bare Low-Alloy Steel Electrodes and fluxes for Submerged Arc Welding
A5.28-96	Low Alloy Steel Filler Metals for Gas Metal Arc Welding
A5.29-98	Low Alloy Steel Electrodes for Flux Cored Arc Welding

**SECTION XV**

**Welding Steel Pile, Splicing Pile & Welding Pile Points**

Specification 2408.13 requires that all welds conform to the Structural Welding Code ANSI/AWS D1.1 of the American Welding Society.

**A. Field Welding**

Welding shall be performed by a State-certified welder. When the Office of Materials qualifies a welder, a certificate is issued showing the types of welds, which they are qualified to perform. Inspectors should ask to see the welder's certificate, and note: (1) certificate number, (2) date issued, and (3) qualified positions on the Log of Piling form. Certificates are good for one year and must be renewed annually, except requalification will only be required every two years for field welders who have successfully passed their qualification tests without failure for three consecutive years.

Welding and repair shall be done in accordance with Welding Procedure Specifications (WPS).

Only Shielded Metal Arc Welding (SMAW) and/or Flux Cored Arc Welding (FCAW) shall be permitted for welding steel piles. Filler Metal shall be in accordance with the requirements of AWS Specifications. For SMAW, low hydrogen electrodes shall be used.

The welding electrode must be on the approved list published by the Office of Materials semiannually or be specifically approved by the Office of Materials.

Welding electrodes shall be kept dry and protected from moisture and humidity during storage and/or use.

Surfaces to be welded and surfaces adjacent to the weld shall be cleaned with a grinder or a wire brush and shall be dry and free of scale, slag, rust, moisture, grease and any other foreign material that would prevent proper welding.

---

**Pile welds shall be air-cooled for not less than 15 minutes PRIOR to being driven into the ground.**

**Quenching (in water) shall not be allowed.**

B. Shell Pile

Shell pile manufactured by Union Metal requires splices to be fillet welded. The fillet weld should be equal in size to the thickness of the shell wall. The pile extension must be telescoped into the pile to be extended a minimum of 6 inches (150 mm). For splicing pile manufactured by Armco, a butt joint and square groove weld must be used as shown in Figure A, Appendix A of this IM.

C. Pipe Piles

Pipe pile may be extended using Figure A, or B, or C (Appendix A of this IM) depending on wall thickness and pile position at the time of splicing.

D. Steel H-Piles

Specifications require that field extension of Steel H-piles shall be made only by approved welding procedures involving the use of backing plates. Steel H-piles are extended with a butt joint requiring a single-bevel groove weld when welded in the horizontal position (Figure B, Appendix A of this IM) and a vee groove weld in the flat position (Figure C, Appendixes A and B of this IM). The backing plate must be at least 1/4 inch (6 mm) thick, 1 1/2 inches (38 mm) wide and of the required length to extend full width of web and flanges. **NOTE:** HP 14 x 117 (HP 360 mm x 174 kg) steel H-piles require a special welding procedure due to flange thickness.

If a backing plate thickness of more than 3/8 inch (10 mm) is used, weld the backing plate all around with a fillet weld. A backing plate 1/4 to 3/8 inch (6 mm to 10 mm) thick may be tack welded in place. Backing plates must be bent or ground to fit snug against the flanges, web, and have chamfered corners to fit between the flanges and web. The required root opening is 1/4 inch (6 mm) with a tolerance of plus 1/4 inch (6 mm) and minus 1/16 inch (2 mm).

The top of the pile being extended must be cut square with flat ends; the lower end of the extension, both flanges and web, must be beveled to a 45° angle, as shown in Figure B, Appendixes A and B of this IM. The groove angle in the flat position is to be cut to a 45° included angle as shown in Figure C, Appendix A. The tolerance of a groove angle joint is ± 5°. The root face of the weld joints in Figures B and C shall be no greater than 1/16 inch (2 mm). When welding H piles, the web must be welded first.

---

#### E. Surface Roughness

Grinding will be required on all free hand oxygen cut joints to achieve the proper angles and surface smoothness. The roughness of oxygen cut surfaces shall not be greater than 1000 micro-inches (25 micrometers) as compared to a Surface Roughness Scale. The inspector should occasionally spot check joint preparation for roughness, prior to welding.

#### F. Pile Alignment

Sections of piles to be joined by butt welds shall be carefully aligned. Should the end of the pile to be extended be bent from driving, the bent portion of the pile shall be cut off. In aligning the piles for welding, the webs shall be brought into alignment first. If there is some slight dimensional variation due to fabrication, the pile extension shall be centered so that eccentricity of the flanges is reduced to a minimum.

#### G. Welder Certification

Welders qualified to work on Iowa DOT projects are qualified on 3/8-inch (10 mm) plates. The maximum thickness of plates that may be welded from one side under our normal certification is 3/4 inch (19 mm). If material thicker than 3/4 inch (19 mm) is to be welded, for example an HP 14 x 117 (HP 360 x 174), qualification tests on 1-inch (25-mm) plates will be required.

#### H. Welding Electrode and Preheat Requirements

The requirements regarding procedures for welding electrodes and preheating temperatures for the various types of steel piling are as follows:

1. Welding must be done with the same process (SMAW or FCAW) used for qualification.
2. If the operator has qualified on welding ASTM A-36 steel, that same operator is qualified to weld on steel meeting the requirements of ASTM A 572 Grade 50 (H-Pile, ASTM A 328 (Sheet Pile) and ASTM A 252 (Pipe Pile) Grade 2 or 3.
3. A welder qualified for manual shielded metal-arc welding with an E7018 electrode may also weld with E7016 electrodes. For welding steel piles, E7018 and E7016 are preferred.

Identifying electrode numbers are as follows:

- The 70 designation shall be understood to mean the 70 series unless an alloy steel of higher strength is to be welded.
- The third digit indicates the position permitted. If the digit is "1," the electrode may be used for welding in any position. If "2," only the down hand position may be used.

- 
- The fourth digit indicates the chemical make-up of the electrode coating. The digit 6 indicates low hydrogen potassium, and 8 a low hydrogen iron powder.

Preheating of the base metal means that the surfaces of the parts being welded, within 3 inches (75 mm) laterally and in advance of the welding, must be at or above the following prescribed temperature:

1. For A572 steel Grade 50 (H-Pile), A328 steel (Sheet Pile) and A252 Grade 2 or 3 pipe piling up to and including  $\frac{3}{4}$  inch (19 mm) thickness, when welding with low hydrogen electrodes the preheat temperature requirement shall be 50°F (10°C). For thickness of over  $\frac{3}{4}$  inch (19 mm) and over, the preheat temperature requirement is 70°F (21°C).

Welding when the ambient temperature is below 0°F (-18°C) is not permitted. In inclement or windy weather, suitable shielding must be provided to permit welding in the normal manner.

All electrodes having low hydrogen coverings shall be purchase in hermetically sealed containers or shall be dried for at least two hours between 450°F and 500°F (232°C and 260°C) before being used. Immediately after drying or removal from hermetically sealed containers, electrodes shall be kept in storage ovens of at least 250°F (121°C). Electrodes no used within four hours after removal from the drying or storage oven must be re-dried before use. For the ordinary field pile welding job, electrodes should be purchased in small packages, allowing for use within the prescribed time limit, unless provision for storage at 250°F (121°C) is made.

Electrodes that are allowed for the Flux Cored Arc Welding are:  
E70T-1, E70T-5, E70T-6, and E70T-8

I. Welding Pile Points to H-Steel Piles

Welding Pile Points to H-steel piles shall be in accordance with the requirements of this IM and shall be performed by a qualified / certified welder (at the piling suppliers and / or at the field locations). Welding shall conform to the following requirements:

1. Welder Certification/Qualification (see IM 468 requirements)
2. Welding Procedures
3. Weld Quality
4. Joint Preparation
5. Preheat
6. Electrode Handling, Storage and Care

Exceptions:

1. For manual shield metal arc welding, any E70 x 8 electrode listed on the approved filler metals list can be used.
2. For flux core arc welding, electrodes shall meet the requirements of one of the following: E71T-8J, E70T-6, E71T-8, E6T8-K6 and/or E71R8-Ni2.
3. The end of the pile does not require a bevel if a pre-beveled pile point is used.
4. The one-piece pile points shall be attached to the pile with a full-width groove weld along the outside of each flange with a weld size according to the table below:

<b>PILE SIZE</b>	<b>FLANGE THICKNESS</b>	<b>MMINIMUM SIZE GROOVE WELD</b>
<b>HP 14 x 117</b>	<b>.805</b>	<b>7/16</b>
<b>x 102</b>	<b>.705</b>	<b>3/8</b>
<b>x 89</b>	<b>.615</b>	<b>3/8</b>
<b>x 73</b>	<b>.505</b>	<b>5/16</b>
<b>HP 12 x 84</b>	<b>.685</b>	<b>3/8</b>
<b>x 74</b>	<b>.610</b>	<b>3/8</b>
<b>x 63</b>	<b>.515</b>	<b>5/16</b>
<b>x 53</b>	<b>.435</b>	<b>5/16</b>
<b>HP 10 x 57</b>	<b>.565</b>	<b>5/16</b>
<b>x 42</b>	<b>.420</b>	<b>5/16</b>

### **Steel Pile Cutoffs**

Steel pile cutoffs that are intended to be used on a project shall be properly identified with heat number, project number and or some other number(s) to indicate the project from which it came.

Minimum length of steel pile cutoffs intended for use on a project shall have a minimum of 5 feet (1.5 m) or more in length.

**SECTION XVI**

**JOINT WELDING  
 PROCEDURE SPECIFICATION**

Material specification \_\_\_\_\_  
 Welding process \_\_\_\_\_  
 Manual or machine \_\_\_\_\_  
 Position of welding \_\_\_\_\_  
 Filler metal specification \_\_\_\_\_  
 Filler metal classification \_\_\_\_\_  
 Flux \_\_\_\_\_  
 Shielding gas \_\_\_\_\_ Flow rate \_\_\_\_\_  
 Single or multiple pass \_\_\_\_\_  
 Single or multiple arc \_\_\_\_\_  
 Welding current \_\_\_\_\_  
 Polarity \_\_\_\_\_  
 Welding progression \_\_\_\_\_  
 Root treatment \_\_\_\_\_  
 Preheat and interpass temperature \_\_\_\_\_  
 Postheat treatment \_\_\_\_\_  
 Heat Input Min \_\_\_\_\_ Max \_\_\_\_\_

**WELDING PROCEDURE**

Pass no.	Electrode size	Welding current		Travel speed	Joint detail
		Amperes	Volts		

This procedure may vary due to fabrication sequence, fit-up, pass size, etc., within the limitation of variables given in Section 5.

Procedure no. \_\_\_\_\_ Contractor \_\_\_\_\_  
 Revision no. \_\_\_\_\_ Authorized by \_\_\_\_\_  
 Date \_\_\_\_\_