

Keokuk Municipal Airport



IOWA | DOT

Pavement Management Report

PREPARED BY

Applied Pavement Technology, Inc.
115 West Main Street, Suite 400
Urbana, Illinois 61801
(217) 398-3977
www.appliedpavement.com

JULY 2024



The preparation of this document was financed in part through an Airport Improvement Program grant from the Federal Aviation Administration (Project Number 3-19-0000-031-2023) as provided under Section 505 of the Airport and Airway Improvement Act of 1982, as amended. The contents do not necessarily reflect the DOT's official views or the policy of the FAA. Acceptance of this report by the FAA does not in any way constitute a commitment on the part of the United States to participate in any development depicted therein nor does it indicate the proposed development is environmentally acceptable in accordance with appropriate public laws.

KEOKUK MUNICIPAL AIRPORT PAVEMENT MANAGEMENT REPORT



Prepared For:

Iowa Department of Transportation
Modal Transportation Bureau – Aviation
800 Lincoln Way
Ames, Iowa 50010
515-239-1691
<https://iowadot.gov/aviation/>



Prepared By:

Applied Pavement Technology, Inc.
115 West Main Street, Suite 400
Urbana, Illinois 61801
217-398-3977
<https://www.appliedpavement.com>



In Association With:

Robinson Engineering Company
Consulting Engineers
819 Second Street NE
Independence, Iowa 50644
319-334-7211

TABLE OF CONTENTS

INTRODUCTION.....	1
PAVEMENT INVENTORY.....	3
PAVEMENT EVALUATION.....	6
Pavement Evaluation Procedure.....	6
Pavement Evaluation Results.....	8
Inspection Comments.....	13
Runways.....	13
Taxiways.....	13
Apron.....	14
T-Hangar.....	14
PAVEMENT MAINTENANCE AND REHABILITATION PROGRAM.....	15
Analysis Parameters.....	15
Critical PCIs.....	15
Localized Preventive Maintenance Policies and Unit Costs.....	15
Major Rehabilitation Unit Costs.....	15
Budget and Inflation Rate.....	15
Analysis Approach.....	15
Analysis Results.....	16
General Maintenance Recommendations.....	17
FAA Requirements (Public Law 103-305).....	17
FAA Advisory Circular 150/5830-7B, Appendix A. Pavement Management Program (PMP).....	18
SUMMARY.....	25

LIST OF FIGURES

Figure 1. Pavement condition versus cost of repair.....	1
Figure 2. Pavement area by branch use at Keokuk Municipal Airport.....	4
Figure 3. Keokuk Municipal Airport network definition map.....	5
Figure 4. Visual representation of PCI scale on typical pavement surfaces.....	6
Figure 5. PCI versus repair type.....	7
Figure 6. Pavement area by PCI range at Keokuk Municipal Airport.....	8
Figure 7. Area-weighted PCI by branch use at Keokuk Municipal Airport.....	9
Figure 8. Keokuk Municipal Airport PCI map.....	10

LIST OF TABLES

Table 1. 2023 pavement evaluation results.....	11
Table 2. 5-year M&R program under an unlimited funding analysis scenario.....	16
Table 3. Pavement inspection report.....	20

APPENDIXES

Appendix A. Cause of Distress Tables	A-1
Appendix B. Inspection Photographs	B-1
Appendix C. Inspection Report	C-1
Appendix D. Work History Report	D-1
Appendix E. Localized Preventive Maintenance Policies and Unit Cost Tables.....	E-1
Appendix F. Year 2024 Localized Preventive Maintenance Details	F-1


INTRODUCTION

Applied Pavement Technology, Inc. (APTech), with assistance from Robinson Engineering Company Consulting Engineers (Robinson), updated the Airport Pavement Management System (APMS) for the Iowa Department of Transportation, Modal Transportation Bureau – Aviation (Iowa DOT). The APMS provides a means to monitor the condition of the pavements within the State of Iowa and to proactively plan for their preservation.

As part of this project, pavement conditions at Keokuk Municipal Airport were visually assessed in November 2023 using the Pavement Condition Index (PCI) procedure. During a PCI inspection, the types, severities, and amounts of distress present on the pavement surface are quantified. This information is then used to develop a composite index that represents the overall condition of the pavement in numerical terms, ranging from 0 (failed) to 100 (excellent). The PCI provides an overall measure of condition and an indication of the level of work that will be required to maintain or repair a pavement. The distress information also provides insight into what is causing the pavement to deteriorate, which is the first step in selecting the appropriate repair action to correct the problem.

Programmed into an APMS, PCI information is used to determine when preventive maintenance actions (such as crack or joint sealing) are advisable and to identify the most cost-effective time to perform major rehabilitation (such as an overlay or whitetopping). Delaying maintenance and rehabilitation (M&R) until a pavement structure has seriously degraded can cost many times more than if M&R was applied earlier in a pavement's life cycle, as shown in Figure 1. From a safety perspective, pavement distresses, such as cracks and loose debris, may pose risks in terms of the potential for aircraft tire damage and the ability of a pilot to safely control aircraft.

Figure 1. Pavement condition versus cost of repair.

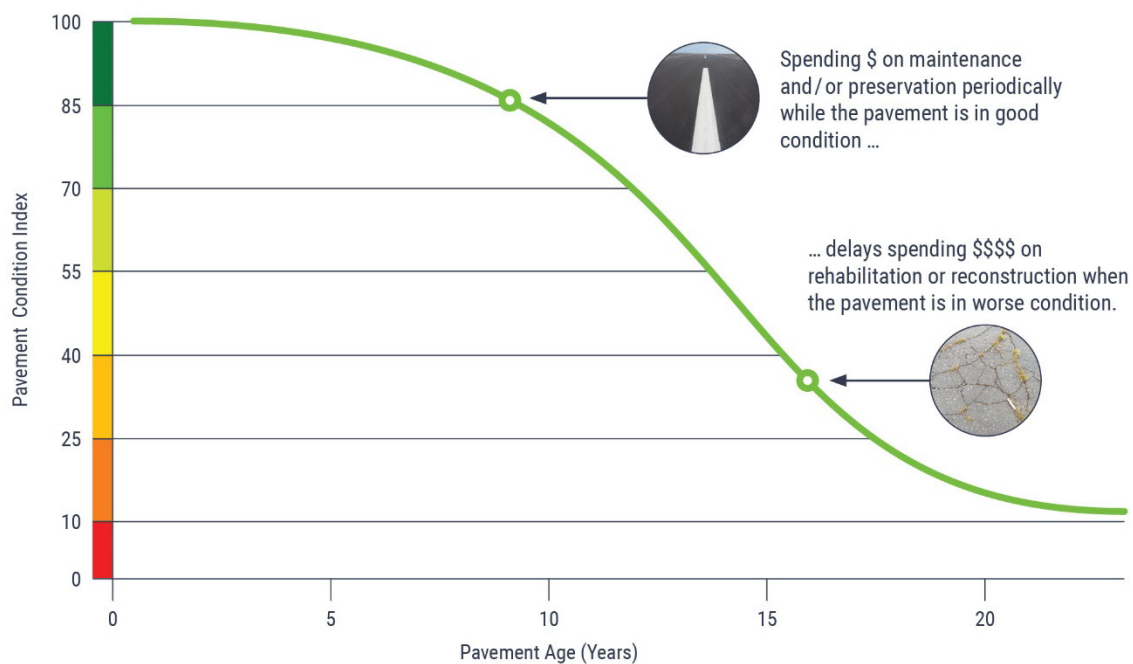

The pavement evaluation results for Keokuk Municipal Airport are presented within this report and can be used by Keokuk Municipal Airport, the Iowa DOT, and the Federal Aviation Administration (FAA) to identify, prioritize, and schedule pavement M&R actions at the airport. In addition to this report, the web-based interactive pavement data visualization tool IDEA, containing the information collected during this project, was updated and may be accessed from the [Iowa DOT's website](#) or directly ([Iowa APMS IDEA](#)).

PAVEMENT INVENTORY

The project began with a review of the existing inventory information pertaining to the pavements at Keokuk Municipal Airport. The date of original construction, along with the date of any subsequent rehabilitation; the location of completed work; and the type of work undertaken were gathered. The information was used to update the pavement management database and associated maps, as necessary, to account for pavement-related work that had been undertaken since the last time the airport was evaluated in 2020.

The pavement network at Keokuk Municipal Airport was then divided into branches, sections, and sample units. A branch is a single entity that serves a distinct function. For example, a runway is considered a branch because it serves a single function (allowing aircraft to take off and land). Taxiways, aprons, and T-hangars are also separate branches.

Each branch was further divided into sections. Traditionally, sections are defined as parts of the branch that share common attributes, such as cross-section, date of last construction, traffic level, and performance. Using this approach, if a runway was built in 1968 and then extended in 1984, it would contain two separate sections.

To estimate the overall condition of a pavement section, each section was subdivided into sample units. Portions of these sample units were evaluated during the pavement inspection, and the collected information was extrapolated to predict the overall section condition and quantities of distress.

Approximately 1,436,800 square feet of pavement were evaluated at Keokuk Municipal Airport, as illustrated in Figure 2. This figure also shows the area-weighted age in years of the pavements at the time of the inspection. Figure 3 provides a map that details how the pavement network was divided into management units and identifies the sample units that were evaluated during the pavement inspection at Keokuk Municipal Airport.

Figure 2. Pavement area by branch use at Keokuk Municipal Airport.


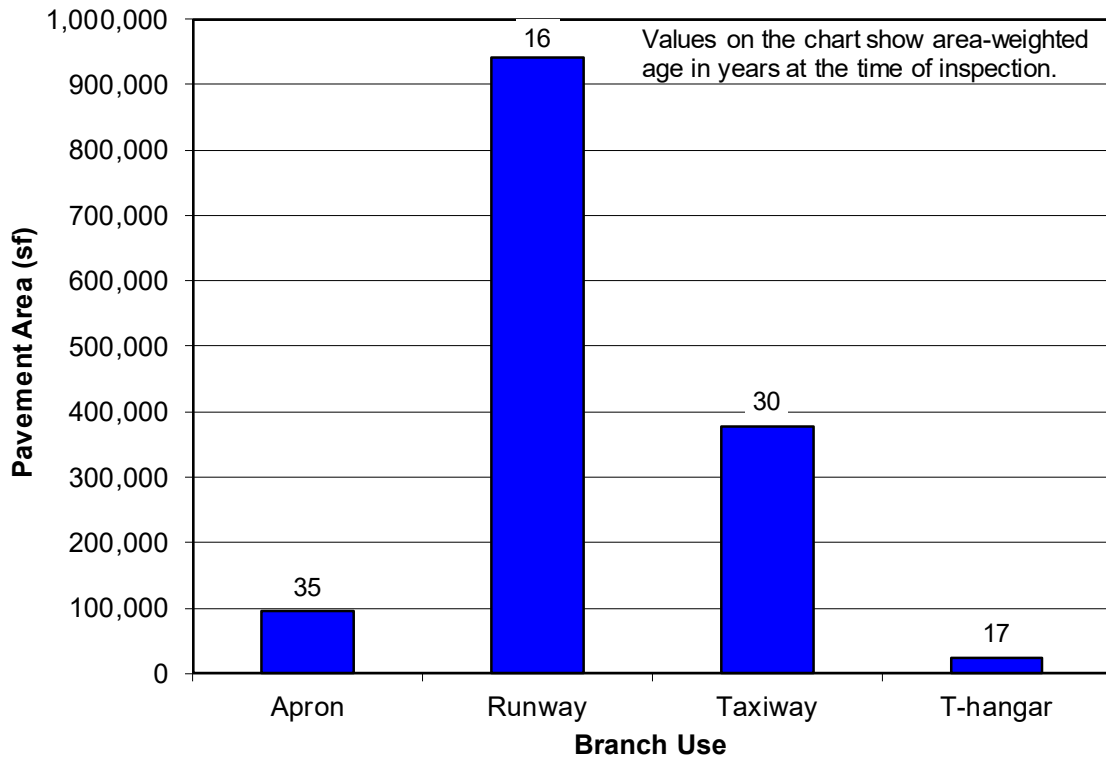


FIGURE 3. NETWORK DEFINITION MAP.

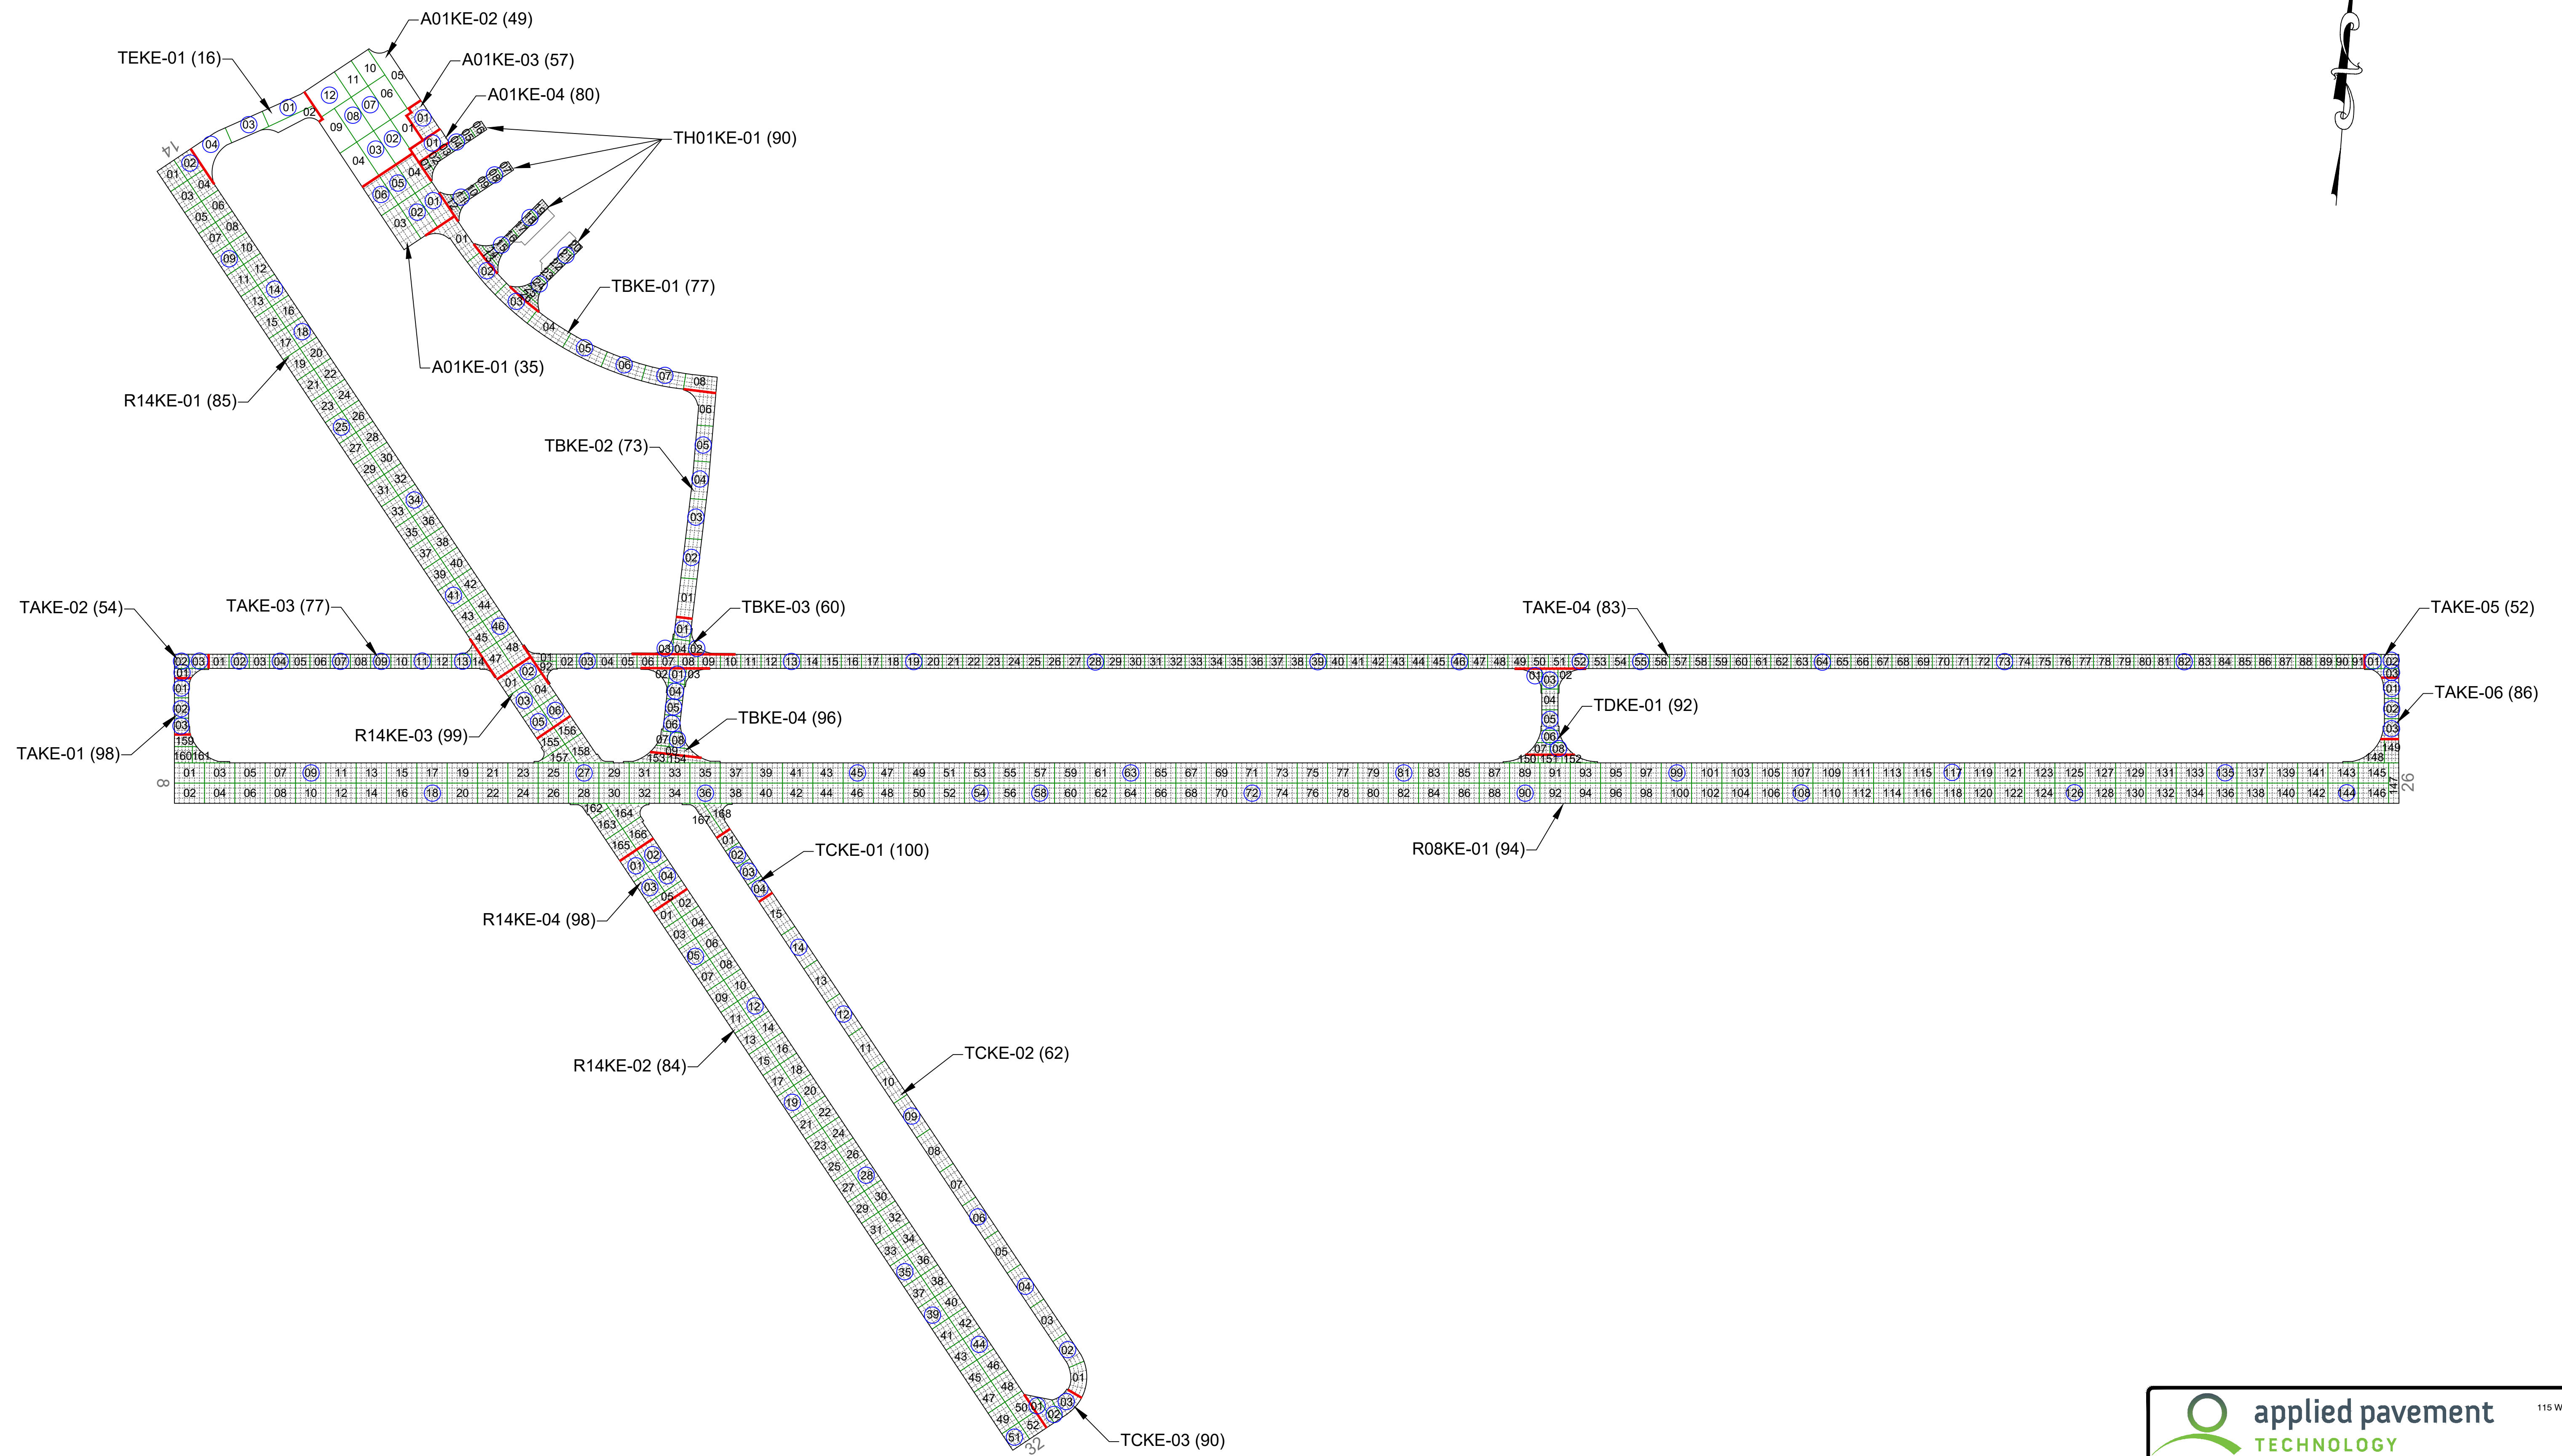

applied pavement TECHNOLOGY			
115 W. Main Street, Suite 400 Urbana, IL 61801 Tel: (217) 398-3977 Fax: (217) 398-4027			
AGENCY: Iowa Department of Transportation Modal Transportation Bureau - Aviation			
LOCATION: Keokuk Municipal Airport Keokuk, Iowa			
PAGE TITLE: Network Definition Map			
PROJECT DATE: OCT. 2023	CREATION DATE: OCT. 2023	PROJECT MANAGER: LJR	JOB NUMBER: 2021-125-AM02
DRAWING SCALE: 1"=200'	LAST MODIFIED DATE: FEB. 2024	REVISED BY: DMS	DRAWN BY: ABF
FILENAME: Keokuk.dwg		LAYOUT NAME/NUMBER: NET. DEF.	PAGE NUMBER: 5

NETWORK DEFINITION LEGEND

	BRANCH IDENTIFIER
	SECTION IDENTIFIER
	PCI VALUE
	SECTION BREAK LINE
	SAMPLE UNIT BREAK LINE
	SLAB JOINT
	SAMPLE UNIT NUMBER
	SAMPLE UNIT INSPECTED
	ADDITIONAL SAMPLE UNIT

PAVEMENT EVALUATION

Pavement Evaluation Procedure

APTech visually inspected the pavements at Keokuk Municipal Airport using the PCI procedure described in:

- FAA Advisory Circular 150/5380-6C, [Guidelines and Procedures for Maintenance of Airport Pavements](#).
- FAA Advisory Circular 150/5380-7B, [Airport Pavement Management Program \(PMP\)](#).
- ASTM D5340-20, *Standard Test Method for Airport Pavement Condition Index Surveys*.

During the PCI inspection, a cursory inspection of the entirety of a pavement section was performed. Sample units identified for more detailed inspection were verified, and adjustments to the selected sample units for inspection were made as needed to ensure an accurate assessment of the pavement’s condition. Data pertaining to the types, severities, and quantities of observed pavement distresses were then collected within each sample unit. These data were then used to calculate the composite PCI of each pavement section. The PCI provides a numerical indication of overall pavement condition, as illustrated in Figure 4. The PCI ranges from a value of 0, which represents a pavement in a failed condition, to a value of 100, which represents a pavement in excellent condition with no visible signs of deterioration. It is important to note that factors other than overall PCI need to be considered when identifying the appropriate type of repair, including types of distress present and rate of deterioration. Also, since the PCI does not assess the structural integrity or capacity of the pavement structure, further testing may be needed to validate and refine the treatment strategy.

Figure 4. Visual representation of PCI scale on typical pavement surfaces.



Note: Photographs shown are not specific to Keokuk Municipal Airport.

Generally, pavements with relatively high PCIs that are not exhibiting significant load-related distress will benefit from preventive maintenance actions, such as crack sealing or joint resealing. As the PCI drops, the pavements may require major rehabilitation, such as an overlay or whitetopping. In some situations where the PCI has dropped low enough, reconstruction may be the only viable alternative due to the substantial damage to the pavement structure. Figure 5 illustrates how the appropriate repair type varies with the PCI of a pavement section and provides the corresponding colors used for the maps and charts in this report for each range of PCIs.

Figure 5. PCI versus repair type.

PCI Range	Repair
86-100	Preventive Maintenance
71-85	
56-70	Major Rehabilitation
41-55	
26-40	Reconstruction
11-25	
0-10	

The types of distress identified during the PCI inspection provide insight into the cause of pavement deterioration, which is useful when selecting M&R strategies. Understanding the cause of distress helps in selecting a rehabilitation alternative that corrects the cause and thus eliminates or delays its recurrence. PCI distress types are characterized as:

- Load-related—These distress types are defined as being caused by aircraft or vehicular traffic and may indicate a structural deficiency. Examples of load-related distress include alligator cracking on asphalt-surfaced pavements and corner breaks on portland cement concrete (PCC) pavements.
- Climate/durability-related—These distress types often signify the presence of aged or environmentally susceptible (or both) material and include durability-related issues. Examples of climate/durability-related distress include weathering on asphalt-surfaced pavements, which is climate-related, and durability cracking on PCC pavements, which is durability-related.
- Other—Distress types that fall into this category cannot be attributed solely to load or climate/durability. Examples of this type of distress include depressions on asphalt-surfaced pavements and shrinkage cracking on PCC pavements.

Appendix A identifies the distress types considered during a PCI inspection and describes the likely cause of each distress type. It should be noted that a PCI is based on visual signs of pavement deterioration and does not provide a measure of structural capacity.

Pavement Evaluation Results

The pavements at Keokuk Municipal Airport were inspected in November 2023. The 2023 area-weighted condition of Keokuk Municipal Airport is 84, with conditions ranging from 16 to 100 (on a scale of 0 [failed] to 100 [excellent]). During the previous pavement inspection in 2020, the area-weighted PCI of the airport was 86.

Figure 6 summarizes the overall condition of the pavements at Keokuk Municipal Airport, and Figure 7 presents area-weighted condition (average PCI adjusted to account for the relative size of the pavement sections) by branch use. Figure 8 is a map that displays the condition of the evaluated pavements. Table 1 summarizes the results of the pavement evaluation. Appendix B presents photographs taken during the PCI inspection, and Appendix C contains detailed information on the distress types observed during the visual survey. Appendix D includes detailed work history information that was collected during the record review process.

Figure 6. Pavement area by PCI range at Keokuk Municipal Airport.

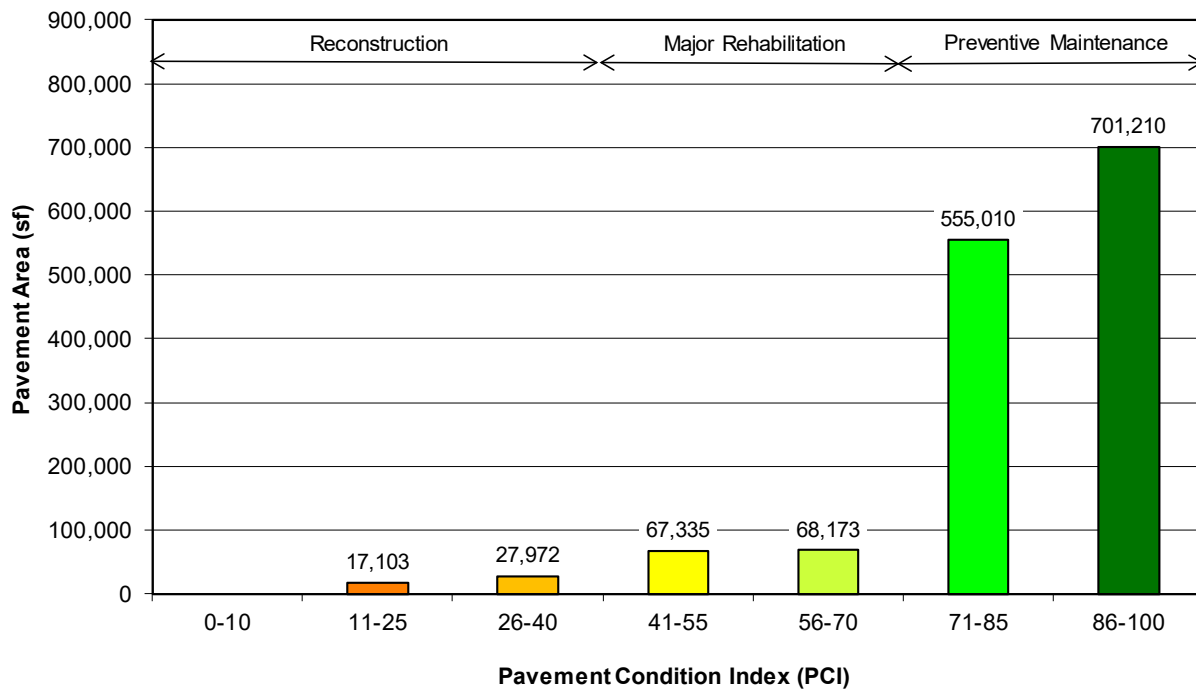


Figure 7. Area-weighted PCI by branch use at Keokuk Municipal Airport.
(Values on chart are area-weighted)



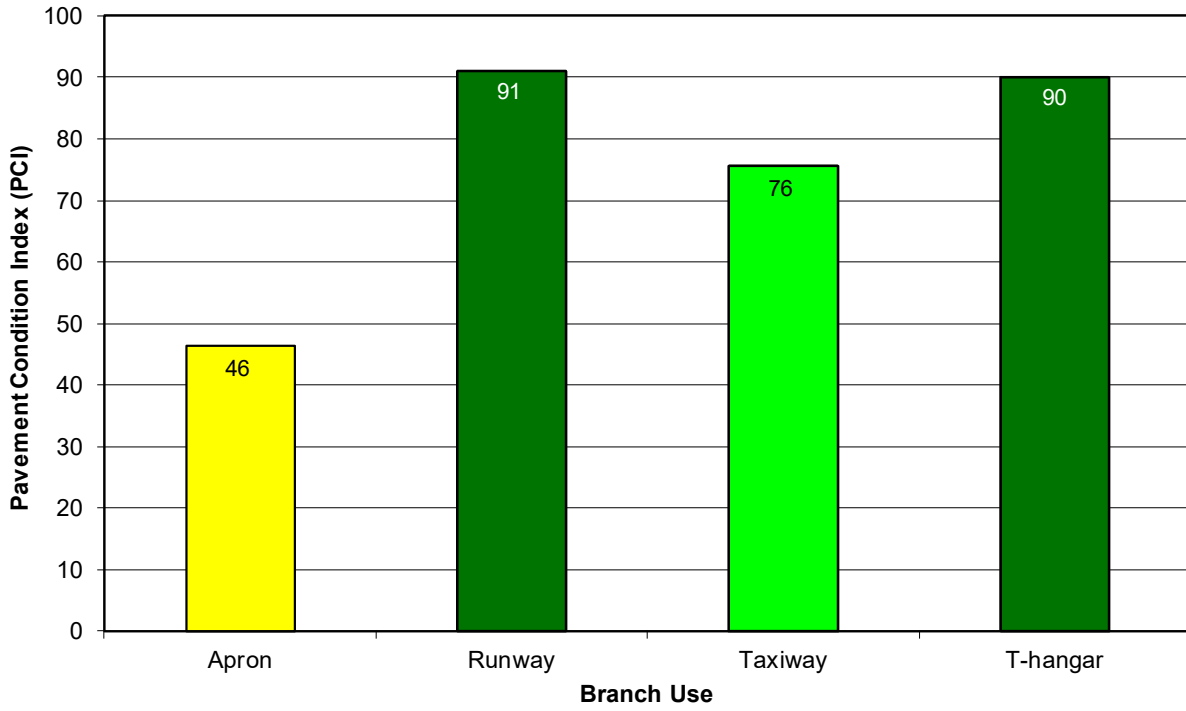


FIGURE 8. PCI MAP.

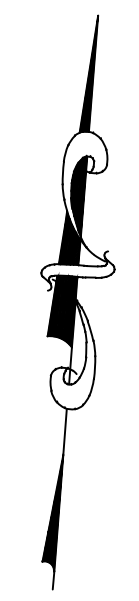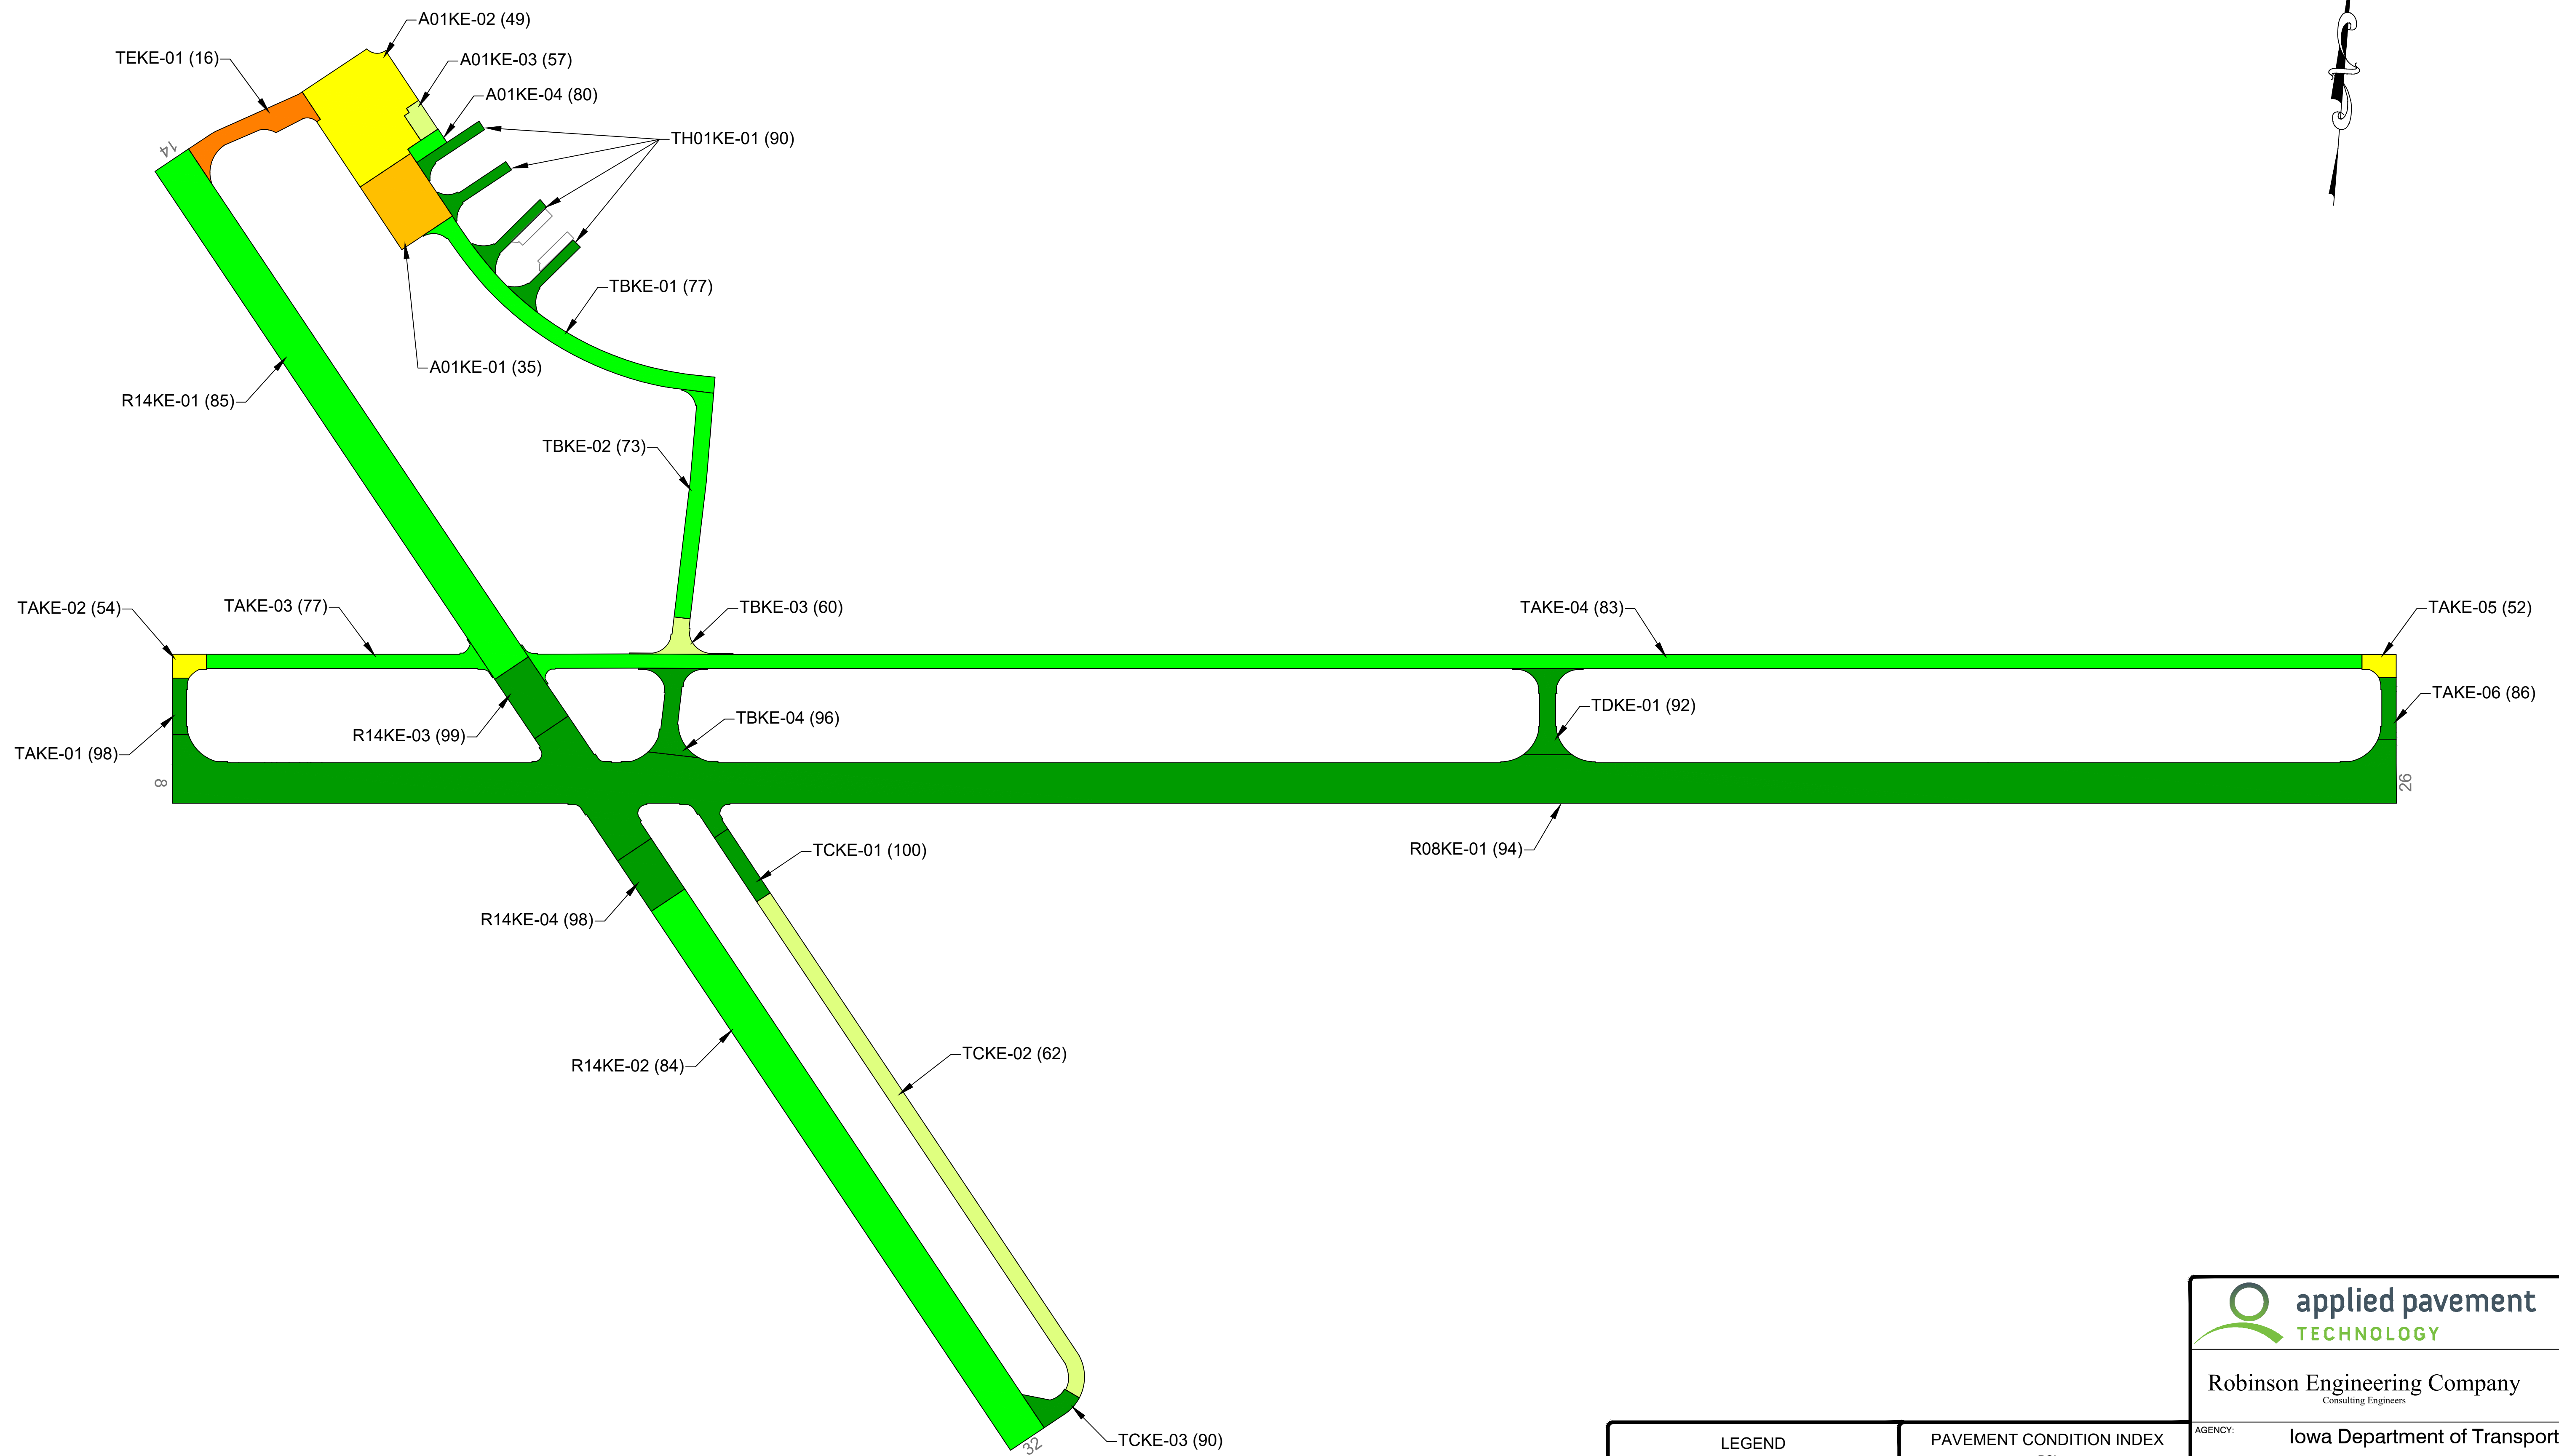

LEGEND	
	BRANCH IDENTIFIER
	SECTION IDENTIFIER
	PCI VALUE
	SECTION BREAK LINE

PAVEMENT CONDITION INDEX	
PCI	
86-100	
71-85	
56-70	
41-55	
26-40	
11-25	
0-10	

		115 W. Main Street, Suite 400 Urbana, IL 61801 Tel: (217) 998-3977 Fax: (217) 998-4027	
Robinson Engineering Company Consulting Engineers		819 Second Street NE Independence, Iowa 50644 319-334-7211	
AGENCY: Iowa Department of Transportation Modal Transportation Bureau - Aviation			
LOCATION: Keokuk Municipal Airport Keokuk, Iowa			
PAGE TITLE: 2023 Pavement Condition Index Map			
PROJECT DATE: OCT. 2023	CREATION DATE: OCT. 2023	PROJECT MANAGER: LJR	JOB NUMBER: 2021-125-AM02
DRAWING SCALE: 1"=200'	LAST MODIFIED DATE: MAR. 2024	REVISED BY: DMS	DRAWN BY: ABF
FILENAME: Keokuk.dwg		LAYOUT NAME/NUMBER: PCI	PAGE NUMBER: 10

Table 1. 2023 pavement evaluation results.

Branch	Section	Surface Type	Section Area (sf)	LCD	2023 PCI	% Distress Due to Load	% Distress Due to Climate/Durability	% Distress Due to Other	Type of Distress
A01KE	01	PCC	27,972	6/2/1966	35	36	7	57	ASR, Faulting, Joint Seal Damage, Large Patch, LTD Cracking, Shattered Slab, Small Patch
A01KE	02	APC	58,838	6/1/2001	49	0	100	0	Block Cracking, Joint Reflection Cracking, Raveling, Weathering
A01KE	03	PCC	4,121	6/2/1949	57	29	13	58	Corner Spalling, Faulting, Joint Spalling, Joint Seal Damage, LTD Cracking, Shrinkage Cracking
A01KE	04	PCC	3,598	1/1/1999	80	58	0	42	Joint Spalling, LTD Cracking
R08KE	01	PCC	595,927	7/2/2013	94	0	19	81	ASR, Faulting, Joint Spalling, Joint Seal Damage, Scaling
R14KE	01	PCC	151,474	6/1/1995	85	7	77	16	Joint Spalling, Joint Seal Damage, LTD Cracking, Scaling, Small Patch
R14KE	02	PCC	160,173	6/1/1995	84	7	65	28	Corner Spalling, Joint Spalling, Joint Seal Damage, Large Patch, LTD Cracking, Scaling, Shrinkage Cracking, Small Patch
R14KE	03	PCC	17,657	7/2/2013	99	0	0	100	ASR
R14KE	04	PCC	15,005	7/2/2013	98	0	58	42	Joint Seal Damage, Scaling
TAKE	01	PCC	5,033	7/3/2013	98	0	100	0	Joint Seal Damage
TAKE	02	PCC	4,288	7/31/1991	54	0	19	81	ASR, Joint Seal Damage, Small Patch
TAKE	03	PCC	24,563	6/1/1997	77	0	37	63	ASR, Joint Seal Damage, Scaling
TAKE	04	PCC	159,167	6/1/1997	83	0	28	72	ASR, Joint Seal Damage, Large Patch, Small Patch
TAKE	05	PCC	4,209	7/31/1991	52	6	18	76	ASR, Joint Seal Damage, LTD Cracking
TAKE	06	PCC	5,674	7/3/2013	86	0	83	17	Corner Spalling, Joint Spalling, Joint Seal Damage
TBKE	01	PCC	32,956	6/1/1992	77	0	36	64	ASR, Corner Spalling, Joint Spalling, Joint Seal Damage, Scaling, Small Patch

Table 1. 2023 pavement evaluation results (continued).

Branch	Section	Surface Type	Section Area (sf)	LCD	2023 PCI	% Distress Due to Load	% Distress Due to Climate/Durability	% Distress Due to Other	Type of Distress
TBKE	02	PCC	23,080	6/1/1992	73	31	34	35	ASR, Faulting, Joint Spalling, Joint Seal Damage, Large Patch, LTD Cracking, Scaling, Small Patch
TBKE	03	PCC	5,577	8/1/1995	60	3	13	84	ASR, Corner Spalling, Joint Seal Damage, LTD Cracking
TBKE	04	PCC	12,390	7/3/2013	96	0	86	14	Joint Spalling, Joint Seal Damage
TCKE	01	PCC	7,579	7/2/2013	100	0	0	100	Scaling
TCKE	02	PCC	58,475	6/2/1966	62	28	20	52	ASR, Corner Spalling, Joint Spalling, Joint Seal Damage, Large Patch, LTD Cracking, Shrinkage Cracking, Small Patch
TCKE	03	PCC	6,229	8/1/1995	90	0	91	9	Joint Seal Damage, Scaling, Shrinkage Cracking
TDKE	01	PCC	12,226	7/3/2013	92	0	86	14	Joint Spalling, Joint Seal Damage
TEKE	01	APC	17,103	6/1/1997	16	0	100	0	Block Cracking, L&T Cracking, Raveling, Weathering
TH01KE	01	PCC	23,489	1/1/2006	90	22	75	3	Corner Break, Joint Spalling, Joint Seal Damage, LTD Cracking, Shrinkage Cracking

Table Notes:

1. See Figure 3 for the location of the branch and section.
2. Surface Type: AC = asphalt cement concrete; AAC = asphalt overlay on AC; PCC = portland cement concrete; APC = asphalt overlay on PCC.
3. LCD = last construction date.
4. Distress due to load includes distress types that are attributed to a structural deficiency in the pavement, such as alligator cracking or rutting on asphalt-surfaced pavements or shattered slabs on PCC pavements.
5. Distress due to climate or durability includes distress types that are attributed to either the aging of the pavement and the effects of the environment (such as weathering, raveling, or block cracking on asphalt-surfaced pavements) or to a materials-related problem (such as durability cracking or alkali-silica reaction [ASR] on PCC pavements). If materials-related distresses were recorded during the inspection, further laboratory testing is required to definitively determine the type present.
6. Distress due to other refers to distress types that are not attributed to one factor but rather may be caused by a combination of factors.
7. Distress types are defined by ASTM D5340-20. L&T Cracking = Longitudinal and Transverse Cracking; LTD Cracking = Longitudinal, Transverse, and Diagonal Cracking; ASR = Alkali-Silica Reaction.

Inspection Comments

Keokuk Municipal Airport was inspected on November 13, 2023. There were twenty-five pavement sections defined during the inspection. Suspected alkali-silica reaction (ASR) was recorded at this airport in accordance with ASTM D5340. It should be noted that laboratory testing in the form of petrographic analysis is the only definitive way to validate the presence of ASR; however, the formation of a precipitate is evidence of a reaction consistent with this type of materials-related distress.

Runways

Runway 08/26 consisted of one section. Areas of low-severity faulting and joint seal damage, low- and medium-severity ASR and scaling, and medium-severity joint spalling were identified in Section 01.

Runway 14/32 was defined by four sections. Section 01 comprised most of the Runway 32 approach and had areas of low-severity scaling, small patching, and longitudinal, transverse, and diagonal (LTD) cracking; medium-severity joint spalling; and high-severity joint seal damage observed during the inspection. Low-severity large patching, LTD cracking, scaling, and small patching; low- and medium-severity joint spalling; medium-severity corner spalling; high-severity joint seal damage; and shrinkage cracking were recorded in Section 02. Section 03 was in excellent condition with only a small amount of low-severity ASR observed. Section 04, located at the Runway 14 approach, was also in excellent condition with areas of low-severity joint seal damage and low- and medium-severity scaling recorded during the inspection.

Taxiways

Taxiway A contained six sections and connected Runway 08/26 to the apron area. Section 01 was in excellent condition with only low-severity joint seal damage recorded. Section 02 contained areas of low-severity small patching, low- and medium-severity ASR, and high-severity joint seal damage. Areas of low-severity scaling, low- and medium-severity ASR, and high-severity joint seal damage were identified in Section 03. Low-severity large patching, low- and medium-severity ASR, medium-severity joint seal damage, and high-severity small patching were observed in Section 04. Low- and medium-severity ASR, medium-severity LTD cracking, and high-severity joint seal damage were recorded in Section 05. Medium-severity corner spalling and joint spalling and high-severity joint seal damage were observed in Section 06.

Taxiway B consisted of four section that connected the apron area to Taxiway A. Section 01 contained low- and medium-severity ASR, low- and high-severity small patching, medium-severity joint spalling and scaling, high-severity joint seal damage, and all severities of corner spalling. Low-severity ASR, faulting, large patching, scaling, and small patching; medium-severity joint spalling and LTD cracking; and high-severity joint seal damage were observed in Section 02. Low-severity LTD cracking, low- and medium-severity ASR, and medium-severity corner spalling and joint seal damage were recorded in Section 03. Section 04 was in excellent condition with medium-severity joint spalling and high-severity joint seal damage observed.

Taxiway C contained three sections that connected the Runway 14 approach to the apron area. Section 01 was in excellent condition with only low-severity scaling recorded. Section 02 contained low-severity large patching, low- and medium-severity ASR and LTD cracking, low- and high-severity small patching, medium-severity corner spalling and joint spalling, high-severity joint seal damage, and shrinkage cracking. Areas of low-severity scaling, medium- and high-severity joint seal damage, and shrinkage cracking were identified in Section 03.

Taxiway D was defined by one section and connected Taxiway A and Runway 08/26. Areas of low- and medium-severity joint spalling and low- and high-severity joint seal damage were identified in Section 01.

Taxiway E contained one section and connected the Runway 32 approach to the apron area. Section 01 was in poor condition with low- and medium-severity block cracking and longitudinal and transverse (L&T) cracking, low- and high-severity weathering, and all severities of raveling observed. The low-severity cracking was unsealed and the medium-severity cracking was identified where unsealed crack widths exceeded 1/4 inch.

Apron

The apron area consisted of four sections. Section 01 was in poor condition with low-severity faulting and large patching; low- and medium-severity ASR, LTD cracking, and small patching; and medium-severity joint seal damage and shattered slab observed. Areas of low-severity block cracking, raveling, and weathering and medium-severity joint reflection cracking were recorded in Section 02. The low-severity block cracking was unsealed and the medium-severity joint reflection cracking was identified where unsealed crack widths were greater than 1/4 inch. Low-severity faulting, low- and medium-severity joint spalling and LTD cracking, medium-severity corner spalling and joint seal damage, and shrinkage cracking were recorded in Section 03. Section 04 contained low-severity LTD cracking and low- and medium-severity joint spalling.

T-Hangar

The T-hangar area was defined by one section. Areas of low-severity joint spalling and LTD cracking, low- and medium-severity corner break, medium- and high-severity joint seal damage, and shrinkage cracking were recorded in Section 01.

PAVEMENT MAINTENANCE AND REHABILITATION PROGRAM

Using the information collected during the pavement inspection, the PAVER pavement management software was used to develop a 5-year M&R program for Keokuk Municipal Airport. In addition, a 1-year plan for localized preventive maintenance (such as crack sealing and patching) was prepared.

Analysis Parameters

Critical PCIs

PAVER uses critical PCIs to determine whether localized preventive maintenance or major rehabilitation is the appropriate repair action. Above the critical PCI, localized preventive maintenance activities are recommended. Below the critical PCI, major rehabilitation actions, such as an overlay or reconstruction, are recommended. The Iowa DOT set the critical PCIs at 65 for runways, 60 for taxiways, and 55 for aprons and T-hangars.

Localized Preventive Maintenance Policies and Unit Costs

Localized preventive maintenance policies were developed for asphalt-surfaced and PCC pavements. These policies, shown in Appendix E, identify the localized preventive maintenance actions that the Iowa DOT considered appropriate to correct the different distress types and severities. The Iowa DOT provided unit costs for each of the localized preventive maintenance actions included in these policies, and these costs are detailed in Appendix E. Please note that this information is of a general nature for the entire State. The localized preventive maintenance policies and unit costs may require adjustment to reflect specific conditions at Keokuk Municipal Airport.

Major Rehabilitation Unit Costs

PAVER estimates the cost of major rehabilitation based on the predicted PCI of the pavement section. The Iowa DOT provided the costs for major rehabilitation, and they are presented in Appendix E. If major rehabilitation is recommended in the 5-year program, further engineering investigation will be needed to identify the most appropriate rehabilitation action and to estimate the cost of such work more accurately.

Budget and Inflation Rate

An unlimited budget with a start date of July 1, 2024, and an inflation rate of 2.0 percent was used during the analysis.

Analysis Approach

The 5-year M&R program was prepared with the goal of maintaining the pavements above established critical PCIs. During this analysis, major rehabilitation was recommended for pavements in the year they dropped below their critical PCI. For the first year (2024) of the analysis only, a localized preventive maintenance plan was developed for those pavement sections that were above their critical PCI. If major rehabilitation was triggered for a section in 2025 or 2026, then localized preventive maintenance was not recommended for 2024. While localized preventive maintenance should be an annual undertaking at Keokuk Municipal Airport, it is not possible to accurately predict the propagation of cracking and other distress types. Therefore, the airport should budget for maintenance every year and can use the 2024 localized preventive maintenance plan as a baseline for that work. As the pavements age, it can be assumed that the amount of localized preventive maintenance required will increase.

Analysis Results

A summary of the M&R program for Keokuk Municipal Airport is presented in Table 2. Detailed information on the recommended localized preventive maintenance plan for 2024 is provided in Appendix F.

Table 2. 5-year M&R program under an unlimited funding analysis scenario.

Year	Branch	Section	Surface Type	Type of Repair	Estimated Cost
2024	A01KE	01	PCC	Major Rehabilitation	\$515,839
2024	A01KE	02	APC	Major Rehabilitation	\$373,242
2024	A01KE	03	PCC	Preventive Maintenance	\$2,890
2024	A01KE	04	PCC	Preventive Maintenance	\$257
2024	R08KE	01	PCC	Preventive Maintenance	\$145,271
2024	R14KE	01	PCC	Preventive Maintenance	\$75,502
2024	R14KE	02	PCC	Preventive Maintenance	\$82,190
2024	R14KE	04	PCC	Preventive Maintenance	\$2,450
2024	TAKE	02	PCC	Major Rehabilitation	\$37,404
2024	TAKE	03	PCC	Preventive Maintenance	\$18,127
2024	TAKE	04	PCC	Preventive Maintenance	\$120,600
2024	TAKE	05	PCC	Major Rehabilitation	\$36,719
2024	TAKE	06	PCC	Preventive Maintenance	\$3,644
2024	TBKE	01	PCC	Preventive Maintenance	\$32,850
2024	TBKE	02	PCC	Preventive Maintenance	\$12,160
2024	TBKE	03	PCC	Major Rehabilitation	\$48,652
2024	TBKE	04	PCC	Preventive Maintenance	\$1,973
2024	TCKE	03	PCC	Preventive Maintenance	\$3,037
2024	TDKE	01	PCC	Preventive Maintenance	\$3,825
2024	TEKE	01	APC	Major Rehabilitation	\$188,766
2024	TH01KE	01	PCC	Preventive Maintenance	\$16,741
2025	TCKE	02	PCC	Major Rehabilitation	\$520,312
2027	A01KE	03	PCC	Major Rehabilitation	\$38,150

Total Estimated Cost: \$2,281,000

Table Notes:

1. See Figure 3 for the location of the branch and section.
2. Surface Type: AC = asphalt cement concrete; AAC = asphalt overlay on AC; PCC = portland cement concrete; APC = asphalt overlay on PCC.
3. Type of Repair: Major Rehabilitation such as pavement reconstruction or an overlay; Localized Preventive Maintenance such as crack sealing or patching.
4. The estimated costs provided are of a general nature for the entire state and may require adjustment to reflect specific conditions at Keokuk Municipal Airport.

The recommendations made in this report are based on a broad network-level analysis and meant to provide Keokuk Municipal Airport with an indication of the type of pavement-related work required during the next 5 years. Further engineering investigation may be necessary to identify which repair action is most appropriate. In addition, the cost estimates provided are

based on overall unit costs for the entire state, and Keokuk Municipal Airport should adjust the plan to reflect local costs.

Because an unlimited budget was used in the analysis, it is possible that the pavement repair program may need to be adjusted to consider economic or operational constraints. The identification of a project need does not necessarily mean that State or Federal funding will be available in the year it is indicated. It is important to remember that regardless of the recommendations presented within this report, Keokuk Municipal Airport is responsible for repairing pavements where existing conditions pose a hazard to safe operations.

General Maintenance Recommendations

In addition to the specific maintenance actions presented in Appendix F, it is recommended that the following strategies be considered for prolonging pavement life:

1. Regularly inspect all safety areas of the airport and document all inspection activity. A sample form that can be used to perform these inspections is provided in Table 3 of this report.
2. Provide a method of tracking all maintenance activities that occur because of these inspections. This documentation needs to be reported to the FAA and the Iowa DOT. This information is used to update the APMS records and is required to remain in compliance with Public Law 103-305 (see the next section of this report for further information on this law).
3. Conduct an aggressive campaign against weed growth through timely herbicide applications and mowing programs of the safety areas. Vegetation growth in pavement cracks is destructive and significantly increases the rate of pavement deterioration.
4. Implement a periodic crack and joint sealing program. Keeping water and debris out of the pavement system by sealing cracks and joints is a proven and cost-effective method of extending the life of the pavement system.
5. Ensure all edges of pavement maintain the required 1.5-inch lip. This enables the water to drain away from the pavement system.
6. Closely monitor the movement of heavy equipment (particularly farming, construction, mowing, and fueling equipment) to make sure it is only operating on pavements that are designed to accommodate heavy loads. Failure to restrict heavy equipment to appropriate areas may result in the premature failure of airport pavements.

FAA Requirements (Public Law 103-305)

Because Keokuk Municipal Airport is in the National Plan of Integrated Airport Systems (NPIAS), the airport sponsor is required to keep the airport in a viable operating condition. This includes maintaining airport pavements in accordance with Public Law 103-305. Public Law 103-305 states that after January 1, 1995, NPIAS airport sponsors must provide assurances or certifications that an airport has implemented an effective airport pavement maintenance management system (PMMS) before the airport will be considered for Federal funding of pavement replacement or reconstruction projects. To be in full compliance with the Federal law, the PMMS must include the following components at minimum: pavement inventory, pavement inspections, record keeping, information retrieval, and program funding.

This report serves as a complete pavement inventory and detailed inspection. To remain in compliance with the law, Keokuk Municipal Airport will also need to undertake monthly drive-by inspections of pavement conditions and track pavement-related maintenance activities.

FAA Advisory Circular 150/5380-7B provides detailed guidance pertaining to the requirements for an acceptable pavement management program (PMP). Appendix A of the FAA Advisory Circular 150/5380-7B outlines what needs to be included in a PMP to remain in compliance with this law and Grant Assurance #11. The following is a copy of this appendix, along with instructions for supplementing this report so that all requirements are met. Note that the italicized text is a direct quotation from the FAA Advisory Circular.

FAA Advisory Circular 150/5830-7B, Appendix A. Pavement Management Program (PMP)

A-1.0. *An effective PMP specifies the procedures to follow to assure that proper preventative and remedial pavement maintenance is performed. The program should identify funding or anticipated funding and other resources available to provide remedial and preventive maintenance activities. An airport sponsor may use any format deemed appropriate, but the program needs to, as a minimum, include the following:*

A-1.1. Pavement Inventory. *The following must be depicted:*

- a. *Identification of all runways, taxiways, and aprons with pavement broken down into sections each having similar properties.*

The network definition map provided in Figure 3 of this report shows the location of all runways, taxiways, aprons, and T-hangars at Keokuk Municipal Airport. If any new pavements are constructed or any pavement areas are permanently closed, this map must be updated. Project plans should be submitted to the Iowa DOT after project completion.

- b. *Dimensions of pavement sections.*

The dimensions of all runways, taxiways, aprons, and T-hangars are stored in the PAVER database. Appendix C provides information on length, width, and area. In addition, the network definition map provided in Figure 3 is drawn to scale. Any changes to pavement dimensions must be recorded.

- c. *Type of pavement surface.*

The type of pavement for each section at Keokuk Municipal Airport is listed in Table 1 of this report and is also stored in the PAVER database. Any changes to the pavement type (through an overlay or reconstruction) must be recorded.

- d. *Year of construction and/or most recent major rehabilitation.*

Dates for pavement construction, rehabilitation, or reconstruction must be recorded. The current pavement history for Keokuk Municipal Airport is provided in Appendix D of this report.

- e. *Whether AIP [Airport Improvement Program] or PFC [Passenger Facility Charge] funds were used to construct, reconstruct, or repair the pavement.*

Funding sources for all pavement projects should be recorded.

A-1.2. PMP Pavement Inspection Schedule. *Airports must perform a detailed inspection of airfield pavements at least once a year for the PMP. If a pavement condition index (PCI) survey is performed, as set forth in ASTM D5340, "Standard Test Method for Airport Pavement Condition Index Surveys," the frequency of the detailed inspection by PCI surveys may be extended to three years. Less comprehensive routine daily, weekly, and monthly maintenance inspections required for operations should be addressed.*

This report consists of a detailed inspection that will extend the inspection period to 3 years. It is the airport sponsor's responsibility to perform monthly drive-by inspections. A sample pavement inspection report form is provided in Table 3 of this report.

A-1.3. Record Keeping. *The airport must record and keep on file complete information about all detailed inspections and maintenance performed until the pavement system is replaced. The types of distress, their locations, and remedial action, scheduled or performed, must be documented. The minimum information recorded includes:*

- a. *Inspection date*
- b. *Location*
- c. *Distress types*
- d. *Maintenance scheduled or performed*

Items A through C are satisfied by this inspection report. Item D is the responsibility of the airport, as is record keeping of the monthly drive-by inspections.

A-1.4. Information Retrieval. *An airport sponsor may use any form of record keeping it deems appropriate so long as the information and records from the pavement survey can generate required reports, as necessary.*

Keep this report, monthly drive-by inspection reports, construction updates, and all records of maintenance activities in a readily accessible location so that they can be easily retrieved as requested by the FAA.

Table 3. Pavement inspection report.

Inspected By: _____

Date Inspected: _____

Branch	Section	Distress Description/Dimensions/Severity/ Recommended Action	Description of Repair	Date Performed	Cost	Funding Source
A01KE	01					
A01KE	02					
A01KE	03					
A01KE	04					
R08KE	01					
R14KE	01					

Table 3. Pavement inspection report (continued).

Inspected By: _____

Date Inspected: _____

Branch	Section	Distress Description/Dimensions/Severity/ Recommended Action	Description of Repair	Date Performed	Cost	Funding Source
R14KE	02					
R14KE	03					
R14KE	04					
TAKE	01					
TAKE	02					
TAKE	03					

Table 3. Pavement inspection report (continued).

Inspected By: _____

Date Inspected: _____

Branch	Section	Distress Description/Dimensions/Severity/ Recommended Action	Description of Repair	Date Performed	Cost	Funding Source
TAKE	04					
TAKE	05					
TAKE	06					
TBKE	01					
TBKE	02					
TBKE	03					

Table 3. Pavement inspection report (continued).

Inspected By: _____

Date Inspected: _____

Branch	Section	Distress Description/Dimensions/Severity/ Recommended Action	Description of Repair	Date Performed	Cost	Funding Source
TBKE	04					
TCKE	01					
TCKE	02					
TCKE	03					
TDKE	01					
TEKE	01					

Table 3. Pavement inspection report (continued).

Inspected By: _____

Date Inspected: _____

Branch	Section	Distress Description/Dimensions/Severity/ Recommended Action	Description of Repair	Date Performed	Cost	Funding Source
TH01KE	01					

Table Note: See Figure 3 for the location of the branch and section.

SUMMARY

This report documents the results of the pavement evaluation conducted at Keokuk Municipal Airport. A visual inspection of the pavements in 2023 found that the overall condition of the pavement network is a PCI of 84. A 5-year pavement repair program, shown in Table 2, was generated for Keokuk Municipal Airport, which revealed that approximately \$2,281,000 needs to be expended on M&R. Keokuk Municipal Airport should utilize these study results to assist in planning for future maintenance needs as part of the airport CIP planning process.

APPENDIX A

CAUSE OF DISTRESS TABLES

Table A-1. Cause of pavement distress, asphalt-surfaced pavements.

Distress Type	Probable Cause of Distress
Alligator Cracking	Fatigue failure of the asphalt surface under repeated traffic loading.
Bleeding	Excessive amounts of asphalt cement or tars in the mix or low air void content, or both.
Block Cracking	Shrinkage of the asphalt and daily temperature cycling; it is not load associated.
Corrugation	Traffic action combined with an unstable pavement layer.
Depression	Settlement of the foundation soil or can be "built up" during construction.
Jet-Blast Erosion	Bituminous binder has been burned or carbonized.
Joint Reflection Cracking	Movement of the concrete slab beneath the asphalt surface due to thermal and moisture changes.
L&T Cracking	Cracks may be caused by (1) a poorly constructed paving lane joint, (2) shrinkage of the asphalt surface due to low temperatures or hardening of the asphalt, or (3) reflective cracking caused by cracks in an underlying PCC slab.
Oil Spillage	Deterioration or softening of the pavement surface caused by the spilling of oil, fuel, or other solvents.
Patching	N/A
Polished Aggregate	Repeated traffic applications.
Raveling	Asphalt binder may have hardened significantly, causing coarse aggregate pieces to dislodge.
Rutting	Usually caused by consolidation or lateral movement of the materials due to traffic loads.
Shoving	Where PCC pavements adjoin flexible pavements, PCC "growth" may shove the asphalt pavement.
Slippage Cracking	Low strength surface mix or poor bond between the surface and the next layer of the pavement structure.
Swelling	Usually caused by frost action or by swelling soil.
Weathering	Asphalt binder and/or fine aggregate may wear away as the pavement ages and hardens.

Table A-2. Cause of pavement distress, PCC pavements.

Distress Type	Probable Cause of Distress
ASR	Chemical reaction of alkalis in the portland cement with certain reactive silica minerals. ASR may be accelerated by the use of chemical pavement deicers.
Blowup	Incompressible materials in the joints.
Corner Break	Load repetition combined with loss of support and curling stresses.
Durability Cracking	Concrete's inability to withstand environmental factors such as freeze-thaw cycles.
Faulting	Upheaval or consolidation.
Joint Seal Damage	Stripping of joint sealant, extrusion of joint sealant, weed growth, hardening of the filler (oxidation), loss of bond to the slab edges, or absence of sealant in the joint.
LTD Cracking	Combination of load repetition, curling stresses, and shrinkage stresses.
Patching (Small and Large)	N/A
Popouts	Freeze-thaw action in combination with expansive aggregates.
Pumping	Poor drainage, poor joint sealant.
Scaling	Over finishing of concrete, deicing salts, improper construction, freeze-thaw cycles, and poor aggregate.
Shattered Slab	Load repetition.
Shrinkage Cracking	Setting and curing of the concrete.
Spalling (Joint and Corner)	Excessive stresses at the joint caused by infiltration of incompressible materials or traffic loads; weak concrete at the joint combined with traffic loads.

APPENDIX B

INSPECTION PHOTOGRAPHS

A01KE-01. Overview.



A01KE-01. ASR (Sample Unit No. 06).



A01KE-01. LTD Cracking (Sample Unit No. 02).



A01KE-02. Overview.



A01KE-02. Block Cracking (Sample Unit No. 02).



A01KE-02. Weathering (Sample Unit No. 08).



A01KE-03. Overview.



A01KE-03. Joint Spalling (Sample Unit No. 01).



A01KE-03. LTD Cracking (Sample Unit No. 01).



A01KE-04. Overview.



A01KE-04. Joint Spalling (Sample Unit No. 01).



A01KE-04. LTD Cracking (Sample Unit No. 01).



R08KE-01. Overview.



R08KE-01. ASR (Sample Unit No. 063).



R08KE-01. Joint Seal Damage (Sample Unit No. 036).



R08KE-01. Scaling (Sample Unit No. 054).



R08KE-01. Scaling (Sample Unit No. 126).



R14KE-01. Overview.



R14KE-01. Joint Seal Damage (Sample Unit No. 18).



R14KE-01. Joint Spalling (Sample Unit No. 25).



R14KE-02. Overview.



R14KE-02. LTD Cracking (Sample Unit No. 05).



R14KE-02. Scaling (Sample Unit No. 12).



R14KE-03. Overview.



R14KE-03. ASR (Sample Unit No. 02).



R14KE-04. Overview.



R14KE-04. Joint Seal Damage (Sample Unit No. 04).



R14KE-04. Scaling (Sample Unit No. 01).



TAKE-01. Overview.



TAKE-01. Joint Seal Damage (Sample Unit No. 03).



TAKE-02. Overview.



TAKE-02. ASR (Sample Unit No. 02).



TAKE-02. Joint Seal Damage (Sample Unit No. 01).



TAKE-03. Overview.



TAKE-03. ASR (Sample Unit No. 04).



TAKE-03. Joint Seal Damage (Sample Unit No. 07).



TAKE-04. Overview.




TAKE-04. ASR (Sample Unit No. 19).



TAKE-04. Joint Seal Damage (Sample Unit No. 82).



TAKE-04. Small Patching (Sample Unit No. 73).

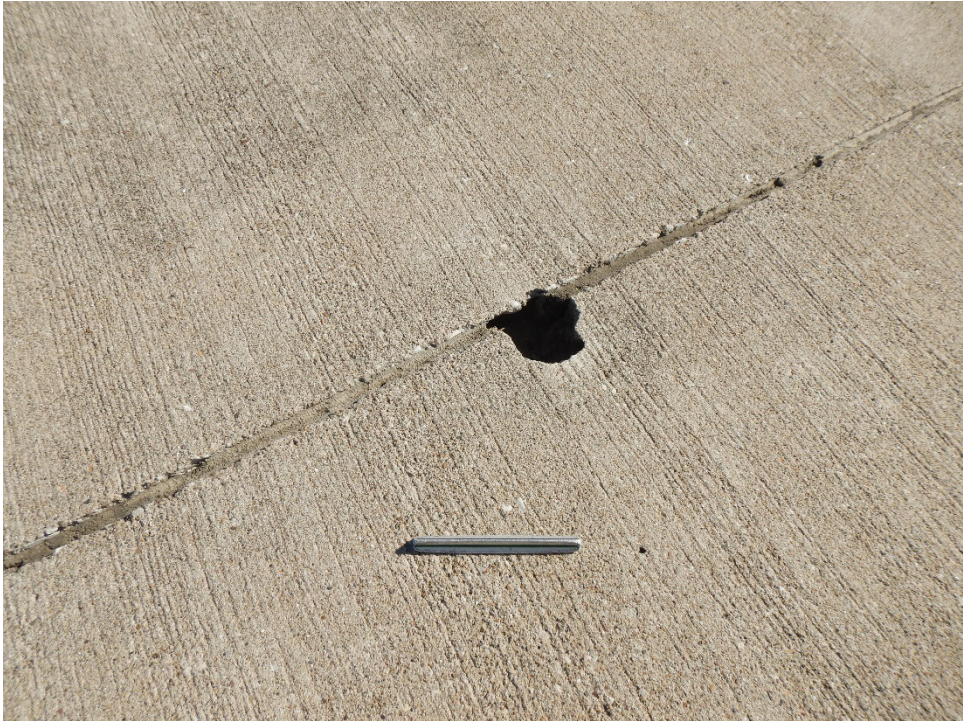

TAKE-05. Overview.



TAKE-05. ASR (Sample Unit No. 02).



TAKE-05. Joint Seal Damage (Sample Unit No. 02).



TAKE-05. LTD Cracking (Sample Unit No. 03).



TAKE-06. Overview.



TAKE-06. Joint Seal Damage (Sample Unit No. 03).



TAKE-06. Joint Spalling (Sample Unit No. 01).



TBKE-01. Overview.



TBKE-01. ASR (Sample Unit No. 03).



TBKE-01. Joint Spalling (Sample Unit No. 05).



TBKE-01. Scaling (Sample Unit No. 06).



TBKE-01. Small Patching (Sample Unit No. 02).



TBKE-02. Overview.



TBKE-02. ASR (Sample Unit No. 02).



TBKE-02. Joint Spalling (Sample Unit No. 04).



TBKE-03. Overview.



TBKE-03. ASR (Sample Unit No. 03).



TBKE-03. Joint Seal Damage (Sample Unit No. 01).



TBKE-04. Overview.



TBKE-04. Joint Seal Damage (Sample Unit No. 01).



TBKE-04. Joint Spalling (Sample Unit No. 08).



TCKE-01. Overview.



TCKE-01. Scaling (Sample Unit No. 02).



TCKE-02. Overview.



TCKE-02. ASR (Sample Unit No. 09).



TCKE-02. LTD Cracking (Sample Unit No. 06).



TCKE-02. Small Patching (Sample Unit No. 04).



TCKE-03. Overview.



TCKE-03. Joint Seal Damage (Sample Unit No. 03).



TCKE-03. Scaling (Sample Unit No. 02).



TDKE-01. Overview.



TDKE-01. Joint Seal Damage (Sample Unit No. 05).



TDKE-01. Joint Spalling (Sample Unit No. 08).



TEKE-01. Overview.



TEKE-01. L&T Cracking (Sample Unit No. 03).



TEKE-01. Raveling (Sample Unit No. 04).



TH01KE-01. Overview.



TH01KE-01. Corner Break (Sample Unit No. 24).



TH01KE-01. Joint Seal Damage (Sample Unit No. 18).



APPENDIX C

INSPECTION REPORT

RE-INSPECTION REPORT KEOKUK MUNICIPAL AIRPORT

Pavement Database: IA 2023

Generate Date: 4/16/2024

Network ID: EOK

Page 1

Branch - Section ID: A01KE - 001

Branch Name: APRON 01

Use: APRON

LCD: 6/2/1966
 Surface Type: PCC
 Rank: P
 Section Area (sf): 27,972.00
 Length (ft): 189.00
 Width (ft): 151.00
 From: TAXIWAY 02 SECT 05
 To: APRON 01 SECT 02

PCI Family: IowaPCCAP_SE_CommEnhanced

Slabs: 120
 Slab Length (ft): 20.00
 Slab Width (ft): 11.70
 Joint Length (ft): 3,456.12
 Last Insp Date: 11/13/2023
 PCI: 35
 Total Samples: 6
 Surveyed: 4

Section Comments:

Inspection Comments:

Sample Number: 01

Sample Type: R
 Sample PCI: 36
 Sample Area (Slabs): 20.00

Sample Comments:

63 LINEAR CR	M	4.00 Slabs
65 JT SEAL DMG	M	20.00 Slabs
66 SMALL PATCH	L	1.00 Slabs
67 LARGE PATCH	L	1.00 Slabs
76 ASR	L	5.00 Slabs
76 ASR	M	4.00 Slabs

Sample Number: 02

Sample Type: R
 Sample PCI: 25
 Sample Area (Slabs): 20.00

Sample Comments:

63 LINEAR CR	M	7.00 Slabs
65 JT SEAL DMG	M	20.00 Slabs
67 LARGE PATCH	L	1.00 Slabs
71 FAULTING	L	1.00 Slabs
72 SHAT. SLAB	M	1.00 Slabs
76 ASR	L	8.00 Slabs
76 ASR	M	3.00 Slabs

Sample Number: 05

Sample Type: R
 Sample PCI: 45
 Sample Area (Slabs): 20.00

Sample Comments:

63 LINEAR CR	L	1.00 Slabs
65 JT SEAL DMG	M	20.00 Slabs
76 ASR	L	4.00 Slabs
76 ASR	M	8.00 Slabs

RE-INSPECTION REPORT KEOKUK MUNICIPAL AIRPORT

Pavement Database: IA 2023

Generate Date: 4/16/2024

Network ID: EOK

Page 2

Sample Number: 06

Sample Type: R

Sample Comments:

Sample PCI: 34

Sample Area (Slabs): 20.00

63 LINEAR CR	M	3.00 Slabs
65 JT SEAL DMG	M	20.00 Slabs
66 SMALL PATCH	L	1.00 Slabs
66 SMALL PATCH	M	1.00 Slabs
76 ASR	L	12.00 Slabs
76 ASR	M	5.00 Slabs

RE-INSPECTION REPORT KEOKUK MUNICIPAL AIRPORT

Pavement Database: IA 2023

Generate Date: 4/16/2024

Network ID: EOK

Page 3

Branch - Section ID: A01KE - 002

Branch Name: APRON 01

Use: APRON

LCD: 6/1/2001
 Surface Type: APC
 Rank: P
 Section Area (sf): 58,837.64
 Length (ft): 308.00
 Width (ft): 207.00
 From: HANGARS
 To: TAXIWAY 01 SECT 01

PCI Family: IowaAPCAP_All

Slabs:
 Slab Length (ft):
 Slab Width (ft):
 Joint Length (ft):

Section Comments:

Last Insp Date: 11/13/2023
 PCI: 49
 Total Samples: 12
 Surveyed: 5

Inspection Comments:

Sample Number: 02

Sample Type: R
 Sample PCI: 49
 Sample Area (SF): 5,000.00

Sample Comments:

43 BLOCK CR	L	5,000.00 SF	LU 5X6
47 JT REF. CR	M	100.00 Ft	W
52 RAVELING	L	1,000.00 SF	
57 WEATHERING	L	5,000.00 SF	

Sample Number: 03

Sample Type: R
 Sample PCI: 47
 Sample Area (SF): 5,000.00

Sample Comments:

43 BLOCK CR	L	5,000.00 SF	LU 5X6
47 JT REF. CR	M	300.00 Ft	W
52 RAVELING	L	1,000.00 SF	
57 WEATHERING	L	5,000.00 SF	

Sample Number: 07

Sample Type: R
 Sample PCI: 49
 Sample Area (SF): 5,000.00

Sample Comments:

43 BLOCK CR	L	5,000.00 SF	LU 5X6
47 JT REF. CR	M	150.00 Ft	W
52 RAVELING	L	1,000.00 SF	
57 WEATHERING	L	5,000.00 SF	

Sample Number: 08

Sample Type: R
 Sample PCI: 49
 Sample Area (SF): 5,000.00

Sample Comments:

43 BLOCK CR	L	5,000.00 SF	LU 5X6
47 JT REF. CR	M	200.00 Ft	W
52 RAVELING	L	1,000.00 SF	
57 WEATHERING	L	5,000.00 SF	

RE-INSPECTION REPORT KEOKUK MUNICIPAL AIRPORT

Pavement Database: IA 2023

Generate Date: 4/16/2024

Network ID: EOK

Page 4

Sample Number: 12

Sample Type: R

Sample Comments:

Sample PCI: 49

Sample Area (SF): 6,713.00

43 BLOCK CR	L	6,713.00 SF	LU 5X6
47 JT REF. CR	M	100.00 Ft	W
52 RAVELING	L	1,000.00 SF	
57 WEATHERING	L	6,713.00 SF	

RE-INSPECTION REPORT KEOKUK MUNICIPAL AIRPORT

Pavement Database: IA 2023

Generate Date: 4/16/2024

Network ID: EOK

Page 5

Branch - Section ID: A01KE - 003

Branch Name: APRON 01

Use: APRON

LCD: 6/2/1949

PCI Family: IowaPCCAP_SE_CommEnhanced

Surface Type: PCC

Rank: P

Section Area (sf): 4,121.00

Length (ft): 88.00

Width (ft): 52.00

From: BUILDING

To: APRON 01 SECT 02

Slabs: 20

Section Comments: avg

Slab Length (ft): 16.50

Slab Width (ft): 12.50

Joint Length (ft): 453.36

Last Insp Date: 11/13/2023

Inspection Comments:

PCI: 57

Total Samples: 1

Surveyed: 1

Sample Number: 01

Sample Type: R

Sample Comments:

Sample PCI: 57

Sample Area (Slabs): 20.00

63 LINEAR CR	L	1.00 Slabs
63 LINEAR CR	M	1.00 Slabs
65 JT SEAL DMG	M	20.00 Slabs
71 FAULTING	L	2.00 Slabs
73 SHRINKAGE CR	N	2.00 Slabs
74 JOINT SPALL	L	1.00 Slabs
74 JOINT SPALL	M	5.00 Slabs
75 CORNER SPALL	M	1.00 Slabs

RE-INSPECTION REPORT KEOKUK MUNICIPAL AIRPORT

Pavement Database: IA 2023

Generate Date: 4/16/2024

Network ID: EOK

Page 6

Branch - Section ID: A01KE - 004

Branch Name: APRON 01

Use: APRON

LCD: 1/1/1999

PCI Family: IowaPCCAP_SE_CommEnhanced

Surface Type: PCC

Rank: P

Section Area (sf): 3,598.32

Length (ft): 90.00

Width (ft): 40.00

From: SEE MAP

To: SEE MAP

Slabs: 12

Section Comments:

Slab Length (ft): 20.00

Slab Width (ft): 15.00

Joint Length (ft): 289.86

Last Insp Date: 11/13/2023

Inspection Comments:

PCI: 80

Total Samples: 1

Surveyed: 1

Sample Number: 01

Sample Type: R

Sample Comments:

Sample PCI: 80

Sample Area (Slabs): 12.00

63 LINEAR CR

L

2.00 Slabs

74 JOINT SPALL

L

1.00 Slabs

74 JOINT SPALL

M

1.00 Slabs

RE-INSPECTION REPORT KEOKUK MUNICIPAL AIRPORT

Pavement Database: IA 2023

Generate Date: 4/16/2024

Network ID: EOK

Page 7

Branch - Section ID: R08KE - 001

Branch Name: RUNWAY 08/26

Use: RUNWAY

LCD: 7/2/2013

PCI Family: IowaPCCRW_SE_Enhanced

Surface Type: PCC

Rank: P

Section Area (sf): 595,926.88

Length (ft): 5,500.00

Width (ft): 100.00

From: RUNWAY 08 END

To: RUNWAY 26 END

Slabs: 3,814

Section Comments:

Slab Length (ft): 12.50

Slab Width (ft): 12.50

Joint Length (ft): 89,280.68

Last Insp Date: 11/13/2023

Inspection Comments:

PCI: 94

Total Samples: 168

Surveyed: 17

Sample Number: 009

Sample Type: R

Sample Comments:

Sample PCI: 100

Sample Area (Slabs): 24.00

NO DISTRESS

Sample Number: 018

Sample Type: R

Sample Comments:

Sample PCI: 100

Sample Area (Slabs): 24.00

NO DISTRESS

Sample Number: 027

Sample Type: R

Sample Comments:

Sample PCI: 100

Sample Area (Slabs): 24.00

NO DISTRESS

Sample Number: 036

Sample Type: R

Sample Comments:

Sample PCI: 98

Sample Area (Slabs): 24.00

65 JT SEAL DMG

L

24.00 Slabs

Sample Number: 045

Sample Type: R

Sample Comments:

Sample PCI: 97

Sample Area (Slabs): 24.00

65 JT SEAL DMG

L

24.00 Slabs

70 SCALING

L

1.00 Slabs

Sample Number: 054

Sample Type: R

Sample Comments:

Sample PCI: 96

Sample Area (Slabs): 24.00

65 JT SEAL DMG

L

24.00 Slabs

70 SCALING

L

2.00 Slabs

RE-INSPECTION REPORT KEOKUK MUNICIPAL AIRPORT

Pavement Database: IA 2023

Generate Date: 4/16/2024

Network ID: EOK

Page 8

Sample Number: 058

Sample Type: R

Sample Comments:

Sample PCI: 97

Sample Area (Slabs): 24.00

65 JT SEAL DMG

L

24.00 Slabs

70 SCALING

L

1.00 Slabs

Sample Number: 063

Sample Type: R

Sample Comments:

Sample PCI: 94

Sample Area (Slabs): 24.00

65 JT SEAL DMG

L

24.00 Slabs

76 ASR

L

1.00 Slabs

Sample Number: 072

Sample Type: R

Sample Comments:

Sample PCI: 86

Sample Area (Slabs): 24.00

65 JT SEAL DMG

L

24.00 Slabs

70 SCALING

L

3.00 Slabs

71 FAULTING

L

3.00 Slabs

Sample Number: 081

Sample Type: R

Sample Comments:

Sample PCI: 98

Sample Area (Slabs): 24.00

65 JT SEAL DMG

L

24.00 Slabs

Sample Number: 090

Sample Type: R

Sample Comments:

Sample PCI: 82

Sample Area (Slabs): 24.00

65 JT SEAL DMG

L

24.00 Slabs

71 FAULTING

L

1.00 Slabs

76 ASR

M

1.00 Slabs

Sample Number: 099

Sample Type: R

Sample Comments:

Sample PCI: 98

Sample Area (Slabs): 24.00

65 JT SEAL DMG

L

24.00 Slabs

Sample Number: 108

Sample Type: R

Sample Comments:

Sample PCI: 93

Sample Area (Slabs): 24.00

65 JT SEAL DMG

L

24.00 Slabs

70 SCALING

L

1.00 Slabs

71 FAULTING

L

1.00 Slabs

Sample Number: 117

Sample Type: R

Sample Comments:

Sample PCI: 98

Sample Area (Slabs): 24.00

65 JT SEAL DMG

L

24.00 Slabs

RE-INSPECTION REPORT KEOKUK MUNICIPAL AIRPORT

Pavement Database: IA 2023

Generate Date: 4/16/2024

Network ID: EOK

Page 9

Sample Number: 126

Sample Type: R

Sample Comments:

Sample PCI: 77

Sample Area (Slabs): 24.00

65 JT SEAL DMG

L

24.00 Slabs

70 SCALING

M

6.00 Slabs

Sample Number: 135

Sample Type: R

Sample Comments:

Sample PCI: 92

Sample Area (Slabs): 24.00

65 JT SEAL DMG

L

24.00 Slabs

74 JOINT SPALL

M

2.00 Slabs

Sample Number: 144

Sample Type: R

Sample Comments:

Sample PCI: 94

Sample Area (Slabs): 24.00

65 JT SEAL DMG

L

24.00 Slabs

71 FAULTING

L

1.00 Slabs

RE-INSPECTION REPORT KEOKUK MUNICIPAL AIRPORT

Pavement Database: IA 2023

Generate Date: 4/16/2024

Network ID: EOK

Page 10

Branch - Section ID: R14KE - 001

Branch Name: RUNWAY 14/32

Use: RUNWAY

LCD: 6/1/1995

PCI Family: IowaPCCRW_SE_Enhanced

Surface Type: PCC

Rank: S

Section Area (sf): 151,473.57

Length (ft): 1,512.00

Width (ft): 100.00

From: RUNWAY 14 END

To: RUNWAY 08 INTERSECTION

Slabs: 969

Section Comments:

Slab Length (ft): 12.50

Slab Width (ft): 12.50

Joint Length (ft): 22,620.85

Last Insp Date: 11/13/2023

Inspection Comments:

PCI: 85

Total Samples: 48

Surveyed: 8

Sample Number: 02

Sample Type: R

Sample Comments:

Sample PCI: 83

Sample Area (Slabs): 20.00

63 LINEAR CR

L

1.00 Slabs

65 JT SEAL DMG

H

20.00 Slabs

Sample Number: 09

Sample Type: R

Sample Comments:

Sample PCI: 86

Sample Area (Slabs): 20.00

65 JT SEAL DMG

H

20.00 Slabs

66 SMALL PATCH

L

2.00 Slabs

Sample Number: 14

Sample Type: R

Sample Comments:

Sample PCI: 84

Sample Area (Slabs): 20.00

65 JT SEAL DMG

H

20.00 Slabs

74 JOINT SPALL

M

1.00 Slabs

Sample Number: 18

Sample Type: R

Sample Comments:

Sample PCI: 88

Sample Area (Slabs): 20.00

65 JT SEAL DMG

H

20.00 Slabs

Sample Number: 25

Sample Type: R

Sample Comments:

Sample PCI: 82

Sample Area (Slabs): 20.00

65 JT SEAL DMG

H

20.00 Slabs

66 SMALL PATCH

L

2.00 Slabs

74 JOINT SPALL

M

1.00 Slabs

RE-INSPECTION REPORT KEOKUK MUNICIPAL AIRPORT

Pavement Database: IA 2023

Generate Date: 4/16/2024

Network ID: EOK

Page 11

Sample Number: 34

Sample Type: R

Sample Comments:

Sample PCI: 87

Sample Area (Slabs): 20.00

65 JT SEAL DMG

H

20.00 Slabs

70 SCALING

L

1.00 Slabs

Sample Number: 41

Sample Type: R

Sample Comments:

Sample PCI: 86

Sample Area (Slabs): 20.00

65 JT SEAL DMG

H

20.00 Slabs

70 SCALING

L

3.00 Slabs

Sample Number: 46

Sample Type: R

Sample Comments:

Sample PCI: 86

Sample Area (Slabs): 20.00

65 JT SEAL DMG

H

20.00 Slabs

66 SMALL PATCH

L

2.00 Slabs

RE-INSPECTION REPORT KEOKUK MUNICIPAL AIRPORT

Pavement Database: IA 2023

Generate Date: 4/16/2024

Network ID: EOK

Page 12

Branch - Section ID: R14KE - 002

Branch Name: RUNWAY 14/32

Use: RUNWAY

LCD: 6/1/1995

PCI Family: IowaPCCRW_SE_Enhanced

Surface Type: PCC

Rank: S

Section Area (sf): 160,172.57

Length (ft): 1,590.00

Width (ft): 100.00

From: RUNWAY 08 INTERSECTION

To: RUNWAY 32 END

Slabs: 1,025

Section Comments:

Slab Length (ft): 12.50

Slab Width (ft): 12.50

Joint Length (ft): 23,925.15

Last Insp Date: 11/13/2023

Inspection Comments:

PCI: 84

Total Samples: 52

Surveyed: 8

Sample Number: 05

Sample Type: R

Sample Comments:

Sample PCI: 77

Sample Area (Slabs): 20.00

63 LINEAR CR	L	1.00 Slabs
65 JT SEAL DMG	H	20.00 Slabs
66 SMALL PATCH	L	1.00 Slabs
67 LARGE PATCH	L	1.00 Slabs
74 JOINT SPALL	L	1.00 Slabs

Sample Number: 12

Sample Type: R

Sample Comments:

Sample PCI: 86

Sample Area (Slabs): 20.00

65 JT SEAL DMG	H	20.00 Slabs
70 SCALING	L	4.00 Slabs

Sample Number: 19

Sample Type: R

Sample Comments:

Sample PCI: 78

Sample Area (Slabs): 20.00

63 LINEAR CR	L	1.00 Slabs
65 JT SEAL DMG	H	20.00 Slabs
66 SMALL PATCH	L	1.00 Slabs
74 JOINT SPALL	M	1.00 Slabs

Sample Number: 28

Sample Type: R

Sample Comments:

Sample PCI: 88

Sample Area (Slabs): 20.00

65 JT SEAL DMG	H	20.00 Slabs
----------------	---	-------------

RE-INSPECTION REPORT KEOKUK MUNICIPAL AIRPORT

Pavement Database: IA 2023

Generate Date: 4/16/2024

Network ID: EOK

Page 13

Sample Number: 35

Sample Type: R

Sample Comments:

Sample PCI: 85

Sample Area (Slabs): 20.00

65 JT SEAL DMG

H

20.00 Slabs

73 SHRINKAGE CR

N

3.00 Slabs

Sample Number: 39

Sample Type: R

Sample Comments:

Sample PCI: 88

Sample Area (Slabs): 20.00

65 JT SEAL DMG

H

20.00 Slabs

Sample Number: 44

Sample Type: R

Sample Comments:

Sample PCI: 83

Sample Area (Slabs): 20.00

65 JT SEAL DMG

H

20.00 Slabs

70 SCALING

L

1.00 Slabs

75 CORNER SPALL

M

1.00 Slabs

Sample Number: 51

Sample Type: R

Sample Comments:

Sample PCI: 83

Sample Area (Slabs): 20.00

65 JT SEAL DMG

H

20.00 Slabs

74 JOINT SPALL

M

2.00 Slabs

RE-INSPECTION REPORT KEOKUK MUNICIPAL AIRPORT

Pavement Database: IA 2023

Generate Date: 4/16/2024

Network ID: EOK

Page 14

Branch - Section ID: R14KE - 003

Branch Name: RUNWAY 14/32

Use: RUNWAY

LCD: 7/2/2013

PCI Family: IowaPCCRW_SE_Enhanced

Surface Type: PCC

Rank: S

Section Area (sf): 17,657.15

Length (ft): 175.00

Width (ft): 100.00

From: SEE MAP

To: SEE MAP

Slabs: 113

Section Comments:

Slab Length (ft): 12.50

Slab Width (ft): 12.50

Joint Length (ft): 2,547.67

Last Insp Date: 11/13/2023

Inspection Comments:

PCI: 99

Total Samples: 6

Surveyed: 4

Sample Number: 02

Sample Type: R

Sample Comments:

Sample PCI: 94

Sample Area (Slabs): 16.00

76 ASR

L

1.00 Slabs

Sample Number: 03

Sample Type: R

Sample Comments:

Sample PCI: 100

Sample Area (Slabs): 20.00

NO DISTRESS

Sample Number: 05

Sample Type: R

Sample Comments:

Sample PCI: 100

Sample Area (Slabs): 20.00

NO DISTRESS

Sample Number: 06

Sample Type: R

Sample Comments:

Sample PCI: 100

Sample Area (Slabs): 20.00

NO DISTRESS

RE-INSPECTION REPORT KEOKUK MUNICIPAL AIRPORT

Pavement Database: IA 2023

Generate Date: 4/16/2024

Network ID: EOK

Page 15

Branch - Section ID: R14KE - 004

Branch Name: RUNWAY 14/32

Use: RUNWAY

LCD: 7/2/2013

PCI Family: IowaPCCRW_SE_Enhanced

Surface Type: PCC

Rank: S

Section Area (sf): 15,005.16

Length (ft): 150.00

Width (ft): 100.00

From: SEE MAP

To: SEE MAP

Slabs: 96

Section Comments:

Slab Length (ft): 12.50

Slab Width (ft): 12.50

Joint Length (ft): 2,150.74

Last Insp Date: 11/13/2023

Inspection Comments:

PCI: 98

Total Samples: 5

Surveyed: 4

Sample Number: 01

Sample Type: R

Sample Comments:

Sample PCI: 94

Sample Area (Slabs): 20.00

70 SCALING

L

1.00 Slabs

70 SCALING

M

1.00 Slabs

Sample Number: 02

Sample Type: R

Sample Comments:

Sample PCI: 100

Sample Area (Slabs): 20.00

NO DISTRESS

Sample Number: 03

Sample Type: R

Sample Comments:

Sample PCI: 100

Sample Area (Slabs): 20.00

NO DISTRESS

Sample Number: 04

Sample Type: R

Sample Comments:

Sample PCI: 98

Sample Area (Slabs): 20.00

65 JT SEAL DMG

L

20.00 Slabs

RE-INSPECTION REPORT KEOKUK MUNICIPAL AIRPORT

Pavement Database: IA 2023

Generate Date: 4/16/2024

Network ID: EOK

Page 16

Branch - Section ID: TAKE - 001

Branch Name: TAXIWAY A

Use: TAXIWAY

LCD: 7/3/2013

PCI Family: IowaPCCTW_SE_Enhanced

Surface Type: PCC

Rank: P

Section Area (sf): 5,033.48

Length (ft): 136.00

Width (ft): 35.00

From: SEE MAP

To: SEE MAP

Slabs: 61

Section Comments:

Slab Length (ft): 9.50

Slab Width (ft): 8.75

Joint Length (ft): 924.27

Last Insp Date: 11/13/2023

Inspection Comments:

PCI: 98

Total Samples: 3

Surveyed: 3

Sample Number: 01

Sample Type: R

Sample Comments:

Sample PCI: 98

Sample Area (Slabs): 23.00

65 JT SEAL DMG

L

23.00 Slabs

Sample Number: 02

Sample Type: R

Sample Comments:

Sample PCI: 98

Sample Area (Slabs): 20.00

65 JT SEAL DMG

L

20.00 Slabs

Sample Number: 03

Sample Type: R

Sample Comments:

Sample PCI: 98

Sample Area (Slabs): 18.00

65 JT SEAL DMG

L

18.00 Slabs

RE-INSPECTION REPORT KEOKUK MUNICIPAL AIRPORT

Pavement Database: IA 2023

Generate Date: 4/16/2024

Network ID: EOK

Page 17

Branch - Section ID: TAKE - 002

Branch Name: TAXIWAY A

Use: TAXIWAY

LCD: 7/31/1991

PCI Family: IowaPCCTW_SE_Enhanced

Surface Type: PCC

Rank: P

Section Area (sf): 4,287.72

Length (ft): 85.00

Width (ft): 35.00

From: SEE MAP

To: SEE MAP

Slabs: 56

Section Comments:

Slab Length (ft): 8.80

Slab Width (ft): 8.75

Joint Length (ft): 804.32

Last Insp Date: 11/13/2023

Inspection Comments:

PCI: 54

Total Samples: 3

Surveyed: 3

Sample Number: 01

Sample Type: R

Sample Comments:

Sample PCI: 63

Sample Area (Slabs): 20.00

65 JT SEAL DMG	H	20.00 Slabs
66 SMALL PATCH	L	2.00 Slabs
76 ASR	L	19.00 Slabs
76 ASR	M	1.00 Slabs

Sample Number: 02

Sample Type: R

Sample Comments:

Sample PCI: 47

Sample Area (Slabs): 16.00

65 JT SEAL DMG	H	16.00 Slabs
76 ASR	L	11.00 Slabs
76 ASR	M	5.00 Slabs

Sample Number: 03

Sample Type: R

Sample Comments:

Sample PCI: 51

Sample Area (Slabs): 20.00

65 JT SEAL DMG	H	20.00 Slabs
76 ASR	L	13.00 Slabs
76 ASR	M	4.00 Slabs

RE-INSPECTION REPORT KEOKUK MUNICIPAL AIRPORT

Pavement Database: IA 2023

Generate Date: 4/16/2024

Network ID: EOK

Page 18

Branch - Section ID: TAKE - 003

Branch Name: TAXIWAY A

Use: TAXIWAY

LCD: 6/1/1997

PCI Family: IowaPCCTW_SE_Enhanced

Surface Type: PCC

Rank: P

Section Area (sf): 24,563.00

Length (ft): 690.00

Width (ft): 35.00

From: TAXIWAY 03

To: RUNWAY 14/32

Slabs: 281

Section Comments:

Slab Length (ft): 10.00

Slab Width (ft): 8.75

Joint Length (ft): 4,526.10

Last Insp Date: 11/13/2023

Inspection Comments:

PCI: 77

Total Samples: 14

Surveyed: 6

Sample Number: 02

Sample Type: R

Sample Comments:

Sample PCI: 72

Sample Area (Slabs): 20.00

65 JT SEAL DMG

H

20.00 Slabs

76 ASR

L

18.00 Slabs

Sample Number: 04

Sample Type: R

Sample Comments:

Sample PCI: 72

Sample Area (Slabs): 20.00

65 JT SEAL DMG

H

20.00 Slabs

76 ASR

L

18.00 Slabs

Sample Number: 07

Sample Type: R

Sample Comments:

Sample PCI: 87

Sample Area (Slabs): 20.00

65 JT SEAL DMG

H

20.00 Slabs

70 SCALING

L

1.00 Slabs

Sample Number: 09

Sample Type: R

Sample Comments:

Sample PCI: 68

Sample Area (Slabs): 20.00

65 JT SEAL DMG

H

20.00 Slabs

76 ASR

L

9.00 Slabs

76 ASR

M

1.00 Slabs

Sample Number: 11

Sample Type: R

Sample Comments:

Sample PCI: 79

Sample Area (Slabs): 20.00

65 JT SEAL DMG

H

20.00 Slabs

76 ASR

L

6.00 Slabs

RE-INSPECTION REPORT KEOKUK MUNICIPAL AIRPORT

Pavement Database: IA 2023

Generate Date: 4/16/2024

Network ID: EOK

Page 19

Sample Number: 13

Sample Type: R

Sample Comments:

Sample PCI: 81

Sample Area (Slabs): 20.00

65 JT SEAL DMG

H

20.00 Slabs

76 ASR

L

4.00 Slabs

RE-INSPECTION REPORT KEOKUK MUNICIPAL AIRPORT

Pavement Database: IA 2023

Generate Date: 4/16/2024

Network ID: EOK

Page 20

Branch - Section ID: TAKE - 004

Branch Name: TAXIWAY A

Use: TAXIWAY

LCD: 6/1/1997

PCI Family: IowaPCCTW_SE_Enhanced

Surface Type: PCC

Rank: P

Section Area (sf): 159,166.62

Length (ft): 4,530.00

Width (ft): 35.00

From: RUNWAY 14/32

To: TAXIWAY 04

Slabs: 1,819

Section Comments:

Slab Length (ft): 10.00

Slab Width (ft): 8.75

Joint Length (ft): 29,524.38

Last Insp Date: 11/13/2023

Inspection Comments:

PCI: 83

Total Samples: 92

Surveyed: 11

Sample Number: 03

Sample Type: R

Sample Comments:

Sample PCI: 58

Sample Area (Slabs): 20.00

65 JT SEAL DMG

M

20.00 Slabs

76 ASR

L

18.00 Slabs

76 ASR

M

2.00 Slabs

Sample Number: 13

Sample Type: R

Sample Comments:

Sample PCI: 93

Sample Area (Slabs): 20.00

65 JT SEAL DMG

M

20.00 Slabs

Sample Number: 19

Sample Type: R

Sample Comments:

Sample PCI: 78

Sample Area (Slabs): 20.00

65 JT SEAL DMG

M

20.00 Slabs

76 ASR

L

9.00 Slabs

Sample Number: 28

Sample Type: R

Sample Comments:

Sample PCI: 83

Sample Area (Slabs): 20.00

65 JT SEAL DMG

M

20.00 Slabs

76 ASR

L

4.00 Slabs

Sample Number: 39

Sample Type: R

Sample Comments:

Sample PCI: 83

Sample Area (Slabs): 20.00

65 JT SEAL DMG

M

20.00 Slabs

76 ASR

L

4.00 Slabs

RE-INSPECTION REPORT KEOKUK MUNICIPAL AIRPORT

Pavement Database: IA 2023

Generate Date: 4/16/2024

Network ID: EOK

Page 21

Sample Number: 46

Sample Type: R

Sample Comments:

Sample PCI: 83

Sample Area (Slabs): 20.00

65 JT SEAL DMG

M

20.00 Slabs

76 ASR

L

4.00 Slabs

Sample Number: 52

Sample Type: R

Sample Comments:

Sample PCI: 78

Sample Area (Slabs): 20.00

65 JT SEAL DMG

M

20.00 Slabs

67 LARGE PATCH

L

4.00 Slabs

76 ASR

L

4.00 Slabs

Sample Number: 55

Sample Type: R

Sample Comments:

Sample PCI: 93

Sample Area (Slabs): 20.00

65 JT SEAL DMG

M

20.00 Slabs

Sample Number: 64

Sample Type: R

Sample Comments:

Sample PCI: 83

Sample Area (Slabs): 20.00

65 JT SEAL DMG

M

20.00 Slabs

76 ASR

L

4.00 Slabs

Sample Number: 73

Sample Type: R

Sample Comments:

Sample PCI: 88

Sample Area (Slabs): 20.00

65 JT SEAL DMG

M

20.00 Slabs

66 SMALL PATCH

H

1.00 Slabs

Sample Number: 82

Sample Type: R

Sample Comments:

Sample PCI: 93

Sample Area (Slabs): 20.00

65 JT SEAL DMG

M

20.00 Slabs

RE-INSPECTION REPORT KEOKUK MUNICIPAL AIRPORT

Pavement Database: IA 2023

Generate Date: 4/16/2024

Network ID: EOK

Page 22

Branch - Section ID: TAKE - 005

Branch Name: TAXIWAY A

Use: TAXIWAY

LCD: 7/31/1991

PCI Family: IowaPCCTW_SE_Enhanced

Surface Type: PCC

Rank: P

Section Area (sf): 4,209.20

Length (ft): 94.00

Width (ft): 35.00

From: SEE MAP

To: SEE MAP

Slabs: 56

Section Comments:

Slab Length (ft): 8.60

Slab Width (ft): 8.75

Joint Length (ft): 805.45

Last Insp Date: 11/13/2023

Inspection Comments:

PCI: 52

Total Samples: 3

Surveyed: 3

Sample Number: 01

Sample Type: R

Sample Comments:

Sample PCI: 63

Sample Area (Slabs): 16.00

65 JT SEAL DMG

H

16.00 Slabs

76 ASR

L

15.00 Slabs

76 ASR

M

1.00 Slabs

Sample Number: 02

Sample Type: R

Sample Comments:

Sample PCI: 50

Sample Area (Slabs): 20.00

65 JT SEAL DMG

H

20.00 Slabs

76 ASR

L

16.00 Slabs

76 ASR

M

4.00 Slabs

Sample Number: 03

Sample Type: R

Sample Comments:

Sample PCI: 44

Sample Area (Slabs): 20.00

63 LINEAR CR

M

1.00 Slabs

65 JT SEAL DMG

H

20.00 Slabs

76 ASR

L

15.00 Slabs

76 ASR

M

5.00 Slabs

RE-INSPECTION REPORT KEOKUK MUNICIPAL AIRPORT

Pavement Database: IA 2023

Generate Date: 4/16/2024

Network ID: EOK

Page 23

Branch - Section ID: TAKE - 006

Branch Name: TAXIWAY A

Use: TAXIWAY

LCD: 7/3/2013

PCI Family: IowaPCCTW_SE_Enhanced

Surface Type: PCC

Rank: P

Section Area (sf): 5,673.66

Length (ft): 141.00

Width (ft): 35.00

From: SEE MAP

To: SEE MAP

Slabs: 66

Section Comments:

Slab Length (ft): 9.80

Slab Width (ft): 8.75

Joint Length (ft): 1,025.02

Last Insp Date: 11/13/2023

Inspection Comments:

PCI: 86

Total Samples: 3

Surveyed: 3

Sample Number: 01

Sample Type: R

Sample Comments:

Sample PCI: 81

Sample Area (Slabs): 23.00

65 JT SEAL DMG

H

23.00 Slabs

74 JOINT SPALL

M

1.00 Slabs

75 CORNER SPALL

M

1.00 Slabs

Sample Number: 02

Sample Type: R

Sample Comments:

Sample PCI: 88

Sample Area (Slabs): 20.00

65 JT SEAL DMG

H

20.00 Slabs

Sample Number: 03

Sample Type: R

Sample Comments:

Sample PCI: 88

Sample Area (Slabs): 23.00

65 JT SEAL DMG

H

23.00 Slabs

RE-INSPECTION REPORT KEOKUK MUNICIPAL AIRPORT

Pavement Database: IA 2023

Generate Date: 4/16/2024

Network ID: EOK

Page 24

Branch - Section ID: TBKE - 001

Branch Name: TAXIWAY B

Use: TAXIWAY

LCD: 6/1/1992

PCI Family: IowaPCCTW_SE_Enhanced

Surface Type: PCC

Rank: P

Section Area (sf): 32,956.00

Length (ft): 815.00

Width (ft): 40.00

From: APRON

To: SECTION 04

Slabs: 188

Section Comments:

Slab Length (ft): 17.50

Slab Width (ft): 10.00

Joint Length (ft): 4,314.46

Last Insp Date: 11/13/2023

Inspection Comments:

PCI: 77

Total Samples: 8

Surveyed: 5

Sample Number: 02

Sample Type: R

Sample Comments:

Sample PCI: 86

Sample Area (Slabs): 24.00

65 JT SEAL DMG	H	24.00 Slabs
66 SMALL PATCH	L	2.00 Slabs

Sample Number: 03

Sample Type: R

Sample Comments:

Sample PCI: 65

Sample Area (Slabs): 24.00

65 JT SEAL DMG	H	24.00 Slabs
66 SMALL PATCH	L	1.00 Slabs
76 ASR	L	8.00 Slabs
76 ASR	M	2.00 Slabs

Sample Number: 05

Sample Type: R

Sample Comments:

Sample PCI: 76

Sample Area (Slabs): 24.00

65 JT SEAL DMG	H	24.00 Slabs
66 SMALL PATCH	L	2.00 Slabs
74 JOINT SPALL	M	2.00 Slabs
75 CORNER SPALL	H	1.00 Slabs
75 CORNER SPALL	L	1.00 Slabs

Sample Number: 06

Sample Type: R

Sample Comments:

Sample PCI: 74

Sample Area (Slabs): 24.00

65 JT SEAL DMG	H	24.00 Slabs
66 SMALL PATCH	H	1.00 Slabs
66 SMALL PATCH	L	1.00 Slabs
70 SCALING	M	3.00 Slabs
74 JOINT SPALL	M	1.00 Slabs

RE-INSPECTION REPORT KEOKUK MUNICIPAL AIRPORT

Pavement Database: IA 2023

Generate Date: 4/16/2024

Network ID: EOK

Page 25

Sample Number: 07

Sample Type: R

Sample Comments:

Sample PCI: 83

Sample Area (Slabs): 24.00

65 JT SEAL DMG

H

24.00 Slabs

66 SMALL PATCH

L

2.00 Slabs

75 CORNER SPALL

M

1.00 Slabs

RE-INSPECTION REPORT KEOKUK MUNICIPAL AIRPORT

Pavement Database: IA 2023

Generate Date: 4/16/2024

Network ID: EOK

Page 26

Branch - Section ID: TBKE - 002

Branch Name: TAXIWAY B

Use: TAXIWAY

LCD: 6/1/1992

PCI Family: IowaPCCTW_SE_Enhanced

Surface Type: PCC

Rank: P

Section Area (sf): 23,080.21

Length (ft): 566.00

Width (ft): 40.00

From: SEE MAP

To: SECTION 05

Slabs: 126

Section Comments:

Slab Length (ft): 18.30

Slab Width (ft): 10.00

Joint Length (ft): 2,951.45

Last Insp Date: 11/13/2023

Inspection Comments:

PCI: 73

Total Samples: 6

Surveyed: 4

Sample Number: 02

Sample Type: R

Sample Comments:

Sample PCI: 45

Sample Area (Slabs): 20.00

63 LINEAR CR	M	4.00 Slabs
65 JT SEAL DMG	H	20.00 Slabs
66 SMALL PATCH	L	4.00 Slabs
67 LARGE PATCH	L	2.00 Slabs
71 FAULTING	L	1.00 Slabs
74 JOINT SPALL	M	1.00 Slabs
76 ASR	L	1.00 Slabs

Sample Number: 03

Sample Type: R

Sample Comments:

Sample PCI: 82

Sample Area (Slabs): 20.00

65 JT SEAL DMG	H	20.00 Slabs
70 SCALING	L	3.00 Slabs
74 JOINT SPALL	M	1.00 Slabs

Sample Number: 04

Sample Type: R

Sample Comments:

Sample PCI: 82

Sample Area (Slabs): 20.00

65 JT SEAL DMG	H	20.00 Slabs
70 SCALING	L	1.00 Slabs
74 JOINT SPALL	M	2.00 Slabs

Sample Number: 05

Sample Type: R

Sample Comments:

Sample PCI: 82

Sample Area (Slabs): 20.00

65 JT SEAL DMG	H	20.00 Slabs
66 SMALL PATCH	L	1.00 Slabs
74 JOINT SPALL	M	2.00 Slabs

RE-INSPECTION REPORT KEOKUK MUNICIPAL AIRPORT

Pavement Database: IA 2023

Generate Date: 4/16/2024

Network ID: EOK

Page 27

Branch - Section ID: TBKE - 003

Branch Name: TAXIWAY B

Use: TAXIWAY

LCD: 8/1/1995

PCI Family: IowaPCCTW_SE_Enhanced

Surface Type: PCC

Rank: P

Section Area (sf): 5,577.08

Length (ft): 90.00

Width (ft): 40.00

From: TAXIWAY 06

To: SECTION 04

Slabs: 74

Section Comments:

Slab Length (ft): 7.50

Slab Width (ft): 10.00

Joint Length (ft): 1,099.92

Last Insp Date: 11/13/2023

Inspection Comments:

PCI: 60

Total Samples: 4

Surveyed: 3

Sample Number: 01

Sample Type: R

Sample Comments:

Sample PCI: 71

Sample Area (Slabs): 24.00

65 JT SEAL DMG	M	24.00 Slabs
76 ASR	L	12.00 Slabs
76 ASR	M	1.00 Slabs

Sample Number: 02

Sample Type: R

Sample Comments:

Sample PCI: 49

Sample Area (Slabs): 25.00

63 LINEAR CR	L	1.00 Slabs
65 JT SEAL DMG	M	25.00 Slabs
76 ASR	L	8.00 Slabs
76 ASR	M	8.00 Slabs

Sample Number: 03

Sample Type: R

Sample Comments:

Sample PCI: 62

Sample Area (Slabs): 14.00

65 JT SEAL DMG	M	14.00 Slabs
75 CORNER SPALL	M	1.00 Slabs
76 ASR	L	7.00 Slabs
76 ASR	M	1.00 Slabs

RE-INSPECTION REPORT KEOKUK MUNICIPAL AIRPORT

Pavement Database: IA 2023

Generate Date: 4/16/2024

Network ID: EOK

Page 28

Branch - Section ID: TBKE - 004

Branch Name: TAXIWAY B

Use: TAXIWAY

LCD: 7/3/2013

PCI Family: IowaPCCTW_SE_Enhanced

Surface Type: PCC

Rank: P

Section Area (sf): 12,390.41

Length (ft): 214.00

Width (ft): 40.00

From: RUNWAY 08/26

To: TAXIWAY 06

Slabs: 118

Section Comments:

Slab Length (ft): 10.50

Slab Width (ft): 10.00

Joint Length (ft): 2,051.42

Last Insp Date: 11/13/2023

Inspection Comments:

PCI: 96

Total Samples: 9

Surveyed: 5

Sample Number: 01

Sample Type: R

Sample Comments:

Sample PCI: 83

Sample Area (Slabs): 16.00

65 JT SEAL DMG

H

16.00 Slabs

74 JOINT SPALL

M

1.00 Slabs

Sample Number: 04

Sample Type: R

Sample Comments:

Sample PCI: 100

Sample Area (Slabs): 16.00

NO DISTRESS

Sample Number: 05

Sample Type: R

Sample Comments:

Sample PCI: 100

Sample Area (Slabs): 16.00

NO DISTRESS

Sample Number: 06

Sample Type: R

Sample Comments:

Sample PCI: 100

Sample Area (Slabs): 18.00

NO DISTRESS

Sample Number: 08

Sample Type: R

Sample Comments:

Sample PCI: 96

Sample Area (Slabs): 18.00

74 JOINT SPALL

M

1.00 Slabs

RE-INSPECTION REPORT KEOKUK MUNICIPAL AIRPORT

Pavement Database: IA 2023

Generate Date: 4/16/2024

Network ID: EOK

Page 29

Branch - Section ID: TCKE - 001

Branch Name: TAXIWAY C

Use: TAXIWAY

LCD: 7/2/2013

PCI Family: IowaPCCTW_SE_Enhanced

Surface Type: PCC

Rank: P

Section Area (sf): 7,579.17

Length (ft): 200.00

Width (ft): 40.00

From: SEE MAP

To: SEE MAP

Slabs: 76

Section Comments:

Slab Length (ft): 10.00

Slab Width (ft): 10.00

Joint Length (ft): 1,288.46

Last Insp Date: 11/13/2023

Inspection Comments:

PCI: 100

Total Samples: 4

Surveyed: 3

Sample Number: 02

Sample Type: R

Sample Comments:

Sample PCI: 99

Sample Area (Slabs): 20.00

70 SCALING

L

1.00 Slabs

Sample Number: 03

Sample Type: R

Sample Comments:

Sample PCI: 100

Sample Area (Slabs): 20.00

NO DISTRESS

Sample Number: 04

Sample Type: R

Sample Comments:

Sample PCI: 100

Sample Area (Slabs): 20.00

NO DISTRESS

RE-INSPECTION REPORT KEOKUK MUNICIPAL AIRPORT

Pavement Database: IA 2023

Generate Date: 4/16/2024

Network ID: EOK

Page 30

Branch - Section ID: TCKE - 002

Branch Name: TAXIWAY C

Use: TAXIWAY

LCD: 6/2/1966

PCI Family: IowaPCCTW_SE_Enhanced

Surface Type: PCC

Rank: P

Section Area (sf): 58,474.77

Length (ft): 1,437.00

Width (ft): 40.00

From: SEE MAP

To: SEE MAP

Slabs: 292

Section Comments:

Slab Length (ft): 20.00

Slab Width (ft): 10.00

Joint Length (ft): 7,268.65

Last Insp Date: 11/13/2023

Inspection Comments:

PCI: 62

Total Samples: 15

Surveyed: 6

Sample Number: 02

Sample Type: R

Sample Comments:

Sample PCI: 48

Sample Area (Slabs): 16.00

63 LINEAR CR	M	4.00 Slabs
65 JT SEAL DMG	H	16.00 Slabs
66 SMALL PATCH	L	1.00 Slabs
67 LARGE PATCH	L	1.00 Slabs
74 JOINT SPALL	M	3.00 Slabs
76 ASR	L	1.00 Slabs

Sample Number: 04

Sample Type: R

Sample Comments:

Sample PCI: 80

Sample Area (Slabs): 20.00

65 JT SEAL DMG	H	20.00 Slabs
66 SMALL PATCH	H	2.00 Slabs
73 SHRINKAGE CR	N	1.00 Slabs

Sample Number: 06

Sample Type: R

Sample Comments:

Sample PCI: 83

Sample Area (Slabs): 20.00

63 LINEAR CR	L	1.00 Slabs
65 JT SEAL DMG	H	20.00 Slabs

Sample Number: 09

Sample Type: R

Sample Comments:

Sample PCI: 45

Sample Area (Slabs): 20.00

63 LINEAR CR	M	3.00 Slabs
65 JT SEAL DMG	H	20.00 Slabs
67 LARGE PATCH	L	1.00 Slabs
74 JOINT SPALL	M	2.00 Slabs
75 CORNER SPALL	M	1.00 Slabs
76 ASR	M	2.00 Slabs

RE-INSPECTION REPORT KEOKUK MUNICIPAL AIRPORT

Pavement Database: IA 2023

Generate Date: 4/16/2024

Network ID: EOK

Page 31

Sample Number: 12

Sample Type: R

Sample Comments:

Sample PCI: 70

Sample Area (Slabs): 20.00

65 JT SEAL DMG	H	20.00 Slabs
66 SMALL PATCH	H	1.00 Slabs
66 SMALL PATCH	L	1.00 Slabs
76 ASR	L	1.00 Slabs
76 ASR	M	1.00 Slabs

Sample Number: 14

Sample Type: R

Sample Comments:

Sample PCI: 44

Sample Area (Slabs): 20.00

63 LINEAR CR	M	2.00 Slabs
65 JT SEAL DMG	H	20.00 Slabs
66 SMALL PATCH	H	1.00 Slabs
76 ASR	L	3.00 Slabs
76 ASR	M	4.00 Slabs

RE-INSPECTION REPORT KEOKUK MUNICIPAL AIRPORT

Pavement Database: IA 2023

Generate Date: 4/16/2024

Network ID: EOK

Page 32

Branch - Section ID: TCKE - 003

Branch Name: TAXIWAY C

Use: TAXIWAY

LCD: 8/1/1995

PCI Family: IowaPCCTW_SE_Enhanced

Surface Type: PCC

Rank: P

Section Area (sf): 6,228.99

Length (ft): 90.00

Width (ft): 40.00

From: RUNWAY 32 END

To: SEE MAP

Slabs: 55

Section Comments:

Slab Length (ft): 11.30

Slab Width (ft): 10.00

Joint Length (ft): 949.20

Last Insp Date: 11/13/2023

Inspection Comments:

PCI: 90

Total Samples: 3

Surveyed: 3

Sample Number: 01

Sample Type: R

Sample Comments:

Sample PCI: 88

Sample Area (Slabs): 17.00

65 JT SEAL DMG

H

17.00 Slabs

Sample Number: 02

Sample Type: R

Sample Comments:

Sample PCI: 89

Sample Area (Slabs): 13.00

65 JT SEAL DMG

M

13.00 Slabs

70 SCALING

L

1.00 Slabs

73 SHRINKAGE CR

N

2.00 Slabs

Sample Number: 03

Sample Type: R

Sample Comments:

Sample PCI: 92

Sample Area (Slabs): 25.00

65 JT SEAL DMG

M

25.00 Slabs

70 SCALING

L

1.00 Slabs

RE-INSPECTION REPORT KEOKUK MUNICIPAL AIRPORT

Pavement Database: IA 2023

Generate Date: 4/16/2024

Network ID: EOK

Page 33

Branch - Section ID: TDKE - 001

Branch Name: TAXIWAY D

Use: TAXIWAY

LCD: 7/3/2013

PCI Family: IowaPCCTW_SE_Enhanced

Surface Type: PCC

Rank: P

Section Area (sf): 12,226.40

Length (ft): 218.00

Width (ft): 35.00

From: RUNWAY 08/26

To: TAXIWAY 06

Slabs: 151

Section Comments: avg

Slab Length (ft): 9.00

Slab Width (ft): 9.00

Joint Length (ft): 2,311.57

Last Insp Date: 11/13/2023

Inspection Comments:

PCI: 92

Total Samples: 8

Surveyed: 5

Sample Number: 01

Sample Type: R

Sample Comments:

Sample PCI: 88

Sample Area (Slabs): 13.00

65 JT SEAL DMG

H

13.00 Slabs

Sample Number: 03

Sample Type: R

Sample Comments:

Sample PCI: 98

Sample Area (Slabs): 20.00

65 JT SEAL DMG

L

20.00 Slabs

Sample Number: 05

Sample Type: R

Sample Comments:

Sample PCI: 88

Sample Area (Slabs): 22.00

65 JT SEAL DMG

H

22.00 Slabs

Sample Number: 06

Sample Type: R

Sample Comments:

Sample PCI: 98

Sample Area (Slabs): 18.00

65 JT SEAL DMG

L

18.00 Slabs

Sample Number: 08

Sample Type: R

Sample Comments:

Sample PCI: 88

Sample Area (Slabs): 15.00

74 JOINT SPALL

L

1.00 Slabs

74 JOINT SPALL

M

2.00 Slabs

RE-INSPECTION REPORT KEOKUK MUNICIPAL AIRPORT

Pavement Database: IA 2023

Generate Date: 4/16/2024

Network ID: EOK

Page 34

Branch - Section ID: TEKE - 001

Branch Name: TAXIWAY E

Use: TAXIWAY

LCD: 6/1/1997
 Surface Type: APC
 Rank: P
 Section Area (sf): 17,103.22
 Length (ft): 305.00
 Width (ft): 40.00
 From: APRON 01 SECT 02
 To: RUNWAY 14 END

PCI Family: IowaAPCTW_Southern

Slabs:
 Slab Length (ft):
 Slab Width (ft):
 Joint Length (ft):

Section Comments:

Last Insp Date: 11/13/2023
 PCI: 16
 Total Samples: 4
 Surveyed: 3

Inspection Comments:

Sample Number: 01

Sample Type: R
 Sample PCI: 17
 Sample Area (SF): 4,695.00

Sample Comments:

43 BLOCK CR	L	1,000.00 SF	LU
43 BLOCK CR	M	1,000.00 SF	W
48 L & T CR	L	85.00 Ft	LU
52 RAVELING	H	1,000.00 SF	
52 RAVELING	L	1,000.00 SF	
52 RAVELING	M	1,000.00 SF	
57 WEATHERING	H	1,495.00 SF	
57 WEATHERING	L	1,200.00 SF	

Sample Number: 03

Sample Type: R
 Sample PCI: 15
 Sample Area (SF): 4,050.00

Sample Comments:

43 BLOCK CR	M	1,700.00 SF	W
48 L & T CR	L	220.00 Ft	LU
48 L & T CR	M	90.00 Ft	W
52 RAVELING	H	1,000.00 SF	
52 RAVELING	M	1,000.00 SF	
57 WEATHERING	H	1,000.00 SF	
57 WEATHERING	L	1,050.00 SF	

Sample Number: 04

Sample Type: R
 Sample PCI: 17
 Sample Area (SF): 5,400.00

Sample Comments:

48 L & T CR	L	520.00 Ft	LU
48 L & T CR	M	210.00 Ft	W
52 RAVELING	H	1,000.00 SF	
52 RAVELING	L	2,000.00 SF	
52 RAVELING	M	1,000.00 SF	
57 WEATHERING	H	2,000.00 SF	
57 WEATHERING	L	1,400.00 SF	

RE-INSPECTION REPORT KEOKUK MUNICIPAL AIRPORT

Pavement Database: IA 2023

Generate Date: 4/16/2024

Network ID: EOK

Page 35

Branch - Section ID: TH01KE - 001

Branch Name: T-HANGAR 01

Use: T-HANGAR

LCD: 1/1/2006 PCI Family: IowaPCCTH_SE

Surface Type: PCC

Rank: P

Section Area (sf): 23,489.00

Length (ft): 765.00

Width (ft): 25.00

From: SEE MAP

To: SEE MAP

Slabs: 551

Section Comments:

Slab Length (ft): 6.50

Slab Width (ft): 6.50

Joint Length (ft): 6,201.18

Last Insp Date: 11/13/2023

Inspection Comments:

PCI: 90

Total Samples: 26

Surveyed: 7

Sample Number: 04

Sample Type: R

Sample Comments:

Sample PCI: 93

Sample Area (Slabs): 20.00

65 JT SEAL DMG

M

20.00 Slabs

Sample Number: 08

Sample Type: R

Sample Comments:

Sample PCI: 93

Sample Area (Slabs): 20.00

65 JT SEAL DMG

M

20.00 Slabs

Sample Number: 11

Sample Type: R

Sample Comments:

Sample PCI: 90

Sample Area (Slabs): 24.00

65 JT SEAL DMG

M

24.00 Slabs

74 JOINT SPALL

L

2.00 Slabs

Sample Number: 15

Sample Type: R

Sample Comments:

Sample PCI: 88

Sample Area (Slabs): 22.00

65 JT SEAL DMG

H

22.00 Slabs

Sample Number: 18

Sample Type: R

Sample Comments:

Sample PCI: 93

Sample Area (Slabs): 20.00

65 JT SEAL DMG

M

20.00 Slabs

Sample Number: 21

Sample Type: R

Sample Comments:

Sample PCI: 99

Sample Area (Slabs): 20.00

73 SHRINKAGE CR

N

1.00 Slabs

RE-INSPECTION REPORT KEOKUK MUNICIPAL AIRPORT

Pavement Database: IA 2023

Generate Date: 4/16/2024

Network ID: EOK

Page 36

Sample Number: 24

Sample Type: R

Sample Comments:

Sample PCI: 76

Sample Area (Slabs): 22.00

62 CORNER BREAK

L

4.00 Slabs

62 CORNER BREAK

M

1.00 Slabs

63 LINEAR CR

L

2.00 Slabs

APPENDIX D

WORK HISTORY REPORT

WORK HISTORY

Pavement Database: IA 2023

Generate Date: 4/30/2024

Network ID: EOK

Page 1

Network: KEOKUK MUNICIPAL AIRPORT

Branch - Section ID: A01KE - 001

LCD: 6/2/1966
Use: APRON
Rank: P
Surface: PCC

Length (ft): 189.00
Width (ft): 151.00
True Area (sf): 27,972.00

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
10-31-2010	CS-PC	Crack Sealing - PCC	\$0.00	0.00	False	-
10-31-2010	JS-LC	Joint Seal (Localized)	\$0.00	0.00	False	-
10-31-2010	PA-PP	Patching - PCC Partial Depth	\$0.00	0.00	False	-
06-02-1966	NC-PC	New Construction - PCC	\$0.00	0.00	True	5-8" PCC
06-01-1966	SB-AG	Subbase - Aggregate	\$0.00	6.00	False	6" P-154

Branch - Section ID: A01KE - 002

LCD: 6/1/2001
Use: APRON
Rank: P
Surface: APC

Length (ft): 308.00
Width (ft): 207.00
True Area (sf): 58,837.64

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
06-01-2001	OL-AS	Overlay - AC Structural	\$0.00	0.00	True	-
06-01-1979	OL-AC	Overlay - AC	\$0.00	0.00	True	-
06-02-1966	NC-PC	New Construction - PCC	\$0.00	8.00	True	8" PCC
06-01-1966	SB-AG	Subbase - Aggregate	\$0.00	12.00	False	12" P-154 SUBBASE

Branch - Section ID: A01KE - 003

LCD: 6/2/1949
Use: APRON
Rank: P
Surface: PCC

Length (ft): 88.00
Width (ft): 52.00
True Area (sf): 4,121.00

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
06-02-1949	NC-PC	New Construction - PCC	\$0.00	8.00	True	8" PCC
06-01-1949	SG-CO	Subgrade - Compacted	\$0.00	12.00	False	12" P-152 COMPACTED SUBGRADE

Branch - Section ID: A01KE - 004

LCD: 1/1/1999
Use: APRON
Rank: P
Surface: PCC

Length (ft): 90.00
Width (ft): 40.00
True Area (sf): 3,598.32

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
01-01-1999	NC-PC	New Construction - PCC	\$0.00	0.00	True	EST DATE VIA GOOGLE EARTH

WORK HISTORY

Pavement Database: IA 2023

Generate Date: 4/30/2024

Network ID: EOK

Page 2

Branch - Section ID: R08KE - 001

LCD: 7/2/2013
 Use: RUNWAY
 Rank: P
 Surface: PCC

Length (ft): 5,500.00
 Width (ft): 100.00
 True Area (sf): 595,926.88

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
07-02-2013	OL-PU	Overlay - PCC Unbonded	\$0.00	6.00	True	6" P501 PCC UNBONDED OVERLAY
07-01-2013	BA-BI	Base Course - Bituminous	\$0.00	1.00	False	1" MIN P403 BIT LAYER
06-01-2011	ST-MS	Surface Treatment - Micro Surface	\$0.00	0.00	False	-
06-01-2006	SL-PC	Slab Replacement - PCC	\$0.00	0.00	False	-
06-01-2003	SL-PC	Slab Replacement - PCC	\$0.00	0.00	False	-
07-31-1991	NC-PC	New Construction - PCC	\$0.00	7.00	True	7" PCCP; 4-5.5" AGG

Branch - Section ID: R14KE - 001

LCD: 6/1/1995
 Use: RUNWAY
 Rank: S
 Surface: PCC

Length (ft): 1,512.00
 Width (ft): 100.00
 True Area (sf): 151,473.57

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
10-31-2010	PA-PP	Patching - PCC Partial Depth	\$0.00	0.00	False	-
10-31-2010	JS-LC	Joint Seal (Localized)	\$0.00	0.00	False	-
10-31-2010	CS-PC	Crack Sealing - PCC	\$0.00	0.00	False	-
07-01-2010	SL-PC	Slab Replacement - PCC	\$0.00	0.00	False	-
06-01-1995	OL-PU	Overlay - PCC Unbonded	\$0.00	6.00	True	6" P501 PCC OVERLAY
01-01-1980	OL-AC	Overlay - AC	\$0.00	2.00	True	2" AC OVERLAY
01-02-1949	NC-PC	New Construction - PCC	\$0.00	7.00	True	7" P501 PCC SURFACE
01-01-1949	SB-AG	Subbase - Aggregate	\$0.00	12.00	False	12" P154 SUBBASE

Branch - Section ID: R14KE - 002

LCD: 6/1/1995
 Use: RUNWAY
 Rank: S
 Surface: PCC

Length (ft): 1,590.00
 Width (ft): 100.00
 True Area (sf): 160,172.57

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
10-31-2010	PA-PP	Patching - PCC Partial Depth	\$0.00	0.00	False	-
10-31-2010	SL-PC	Slab Replacement - PCC	\$0.00	0.00	False	-
10-31-2010	JS-LC	Joint Seal (Localized)	\$0.00	0.00	False	-
10-31-2010	CS-PC	Crack Sealing - PCC	\$0.00	0.00	False	-
06-01-1995	OL-PU	Overlay - PCC Unbonded	\$0.00	6.00	True	6" P501 PCC OVERLAY
01-01-1980	OL-AC	Overlay - AC	\$0.00	2.00	True	2" AC OVERLAY
01-02-1949	NC-PC	New Construction - PCC	\$0.00	7.00	True	7" P501 PCC SURFACE
01-01-1949	SB-AG	Subbase - Aggregate	\$0.00	12.00	False	12" P154 SUBBASE

WORK HISTORY

Pavement Database: IA 2023

Generate Date: 4/30/2024

Network ID: EOK

Page 3

Branch - Section ID: R14KE - 003

LCD: 7/2/2013
Use: RUNWAY
Rank: S
Surface: PCC

Length (ft): 175.00
Width (ft): 100.00
True Area (sf): 17,657.15

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
07-02-2013	NC-PC	New Construction - PCC	\$0.00	7.00	True	7" P501 PCC
07-01-2013	BA-AG	Base Course - Aggregate	\$0.00	4.00	False	4" P209 AGG

Branch - Section ID: R14KE - 004

LCD: 7/2/2013
Use: RUNWAY
Rank: S
Surface: PCC

Length (ft): 150.00
Width (ft): 100.00
True Area (sf): 15,005.16

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
07-02-2013	NC-PC	New Construction - PCC	\$0.00	7.00	True	7" P501 PCC
07-01-2013	BA-AG	Base Course - Aggregate	\$0.00	4.00	False	4" P209 AGG

Branch - Section ID: TAKE - 001

LCD: 7/3/2013
Use: TAXIWAY
Rank: P
Surface: PCC

Length (ft): 136.00
Width (ft): 35.00
True Area (sf): 5,033.48

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
07-03-2013	NC-PC	New Construction - PCC	\$0.00	7.00	True	7" P501 PCC
07-02-2013	BA-AG	Base Course - Aggregate	\$0.00	4.00	False	4" AGG BASE
07-01-2013	SG-ST	Subgrade - Stabilized	\$0.00	6.00	False	6" LIME TREATED

Branch - Section ID: TAKE - 002

LCD: 7/31/1991
Use: TAXIWAY
Rank: P
Surface: PCC

Length (ft): 85.00
Width (ft): 35.00
True Area (sf): 4,287.72

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
07-31-1991	NC-PC	New Construction - PCC	\$0.00	0.00	True	-

Branch - Section ID: TAKE - 003

LCD: 6/1/1997
Use: TAXIWAY
Rank: P
Surface: PCC

Length (ft): 690.00
Width (ft): 35.00
True Area (sf): 24,563.00

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
06-01-2013	SL-PC	Slab Replacement - PCC	\$0.00	0.00	False	EST
06-01-1997	NC-IN	New Construction - Initial	\$0.00	0.00	True	-

WORK HISTORY

Pavement Database: IA 2023

Generate Date: 4/30/2024

Network ID: EOK

Page 4

Branch - Section ID: TAKE - 004

LCD: 6/1/1997
 Use: TAXIWAY
 Rank: P
 Surface: PCC

Length (ft): 4,530.00
 Width (ft): 35.00
 True Area (sf): 159,166.62

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
06-01-1997	NC-IN	New Construction - Initial	\$0.00	0.00	True	-

Branch - Section ID: TAKE - 005

LCD: 7/31/1991
 Use: TAXIWAY
 Rank: P
 Surface: PCC

Length (ft): 94.00
 Width (ft): 35.00
 True Area (sf): 4,209.20

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
07-31-1991	NC-PC	New Construction - PCC	\$0.00	0.00	True	-

Branch - Section ID: TAKE - 006

LCD: 7/3/2013
 Use: TAXIWAY
 Rank: P
 Surface: PCC

Length (ft): 141.00
 Width (ft): 35.00
 True Area (sf): 5,673.66

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
07-03-2013	NC-PC	New Construction - PCC	\$0.00	7.00	True	7" P501 PCC
07-02-2013	BA-AG	Base Course - Aggregate	\$0.00	4.00	False	4" P209 AGG
07-01-2013	SG-ST	Subgrade - Stabilized	\$0.00	6.00	False	6" LIME TREATED

Branch - Section ID: TBKE - 001

LCD: 6/1/1992
 Use: TAXIWAY
 Rank: P
 Surface: PCC

Length (ft): 815.00
 Width (ft): 40.00
 True Area (sf): 32,956.00

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
10-31-2010	PA-PP	Patching - PCC Partial Depth	\$0.00	0.00	False	-
10-31-2010	JS-LC	Joint Seal (Localized)	\$0.00	0.00	False	-
10-31-2010	CS-PC	Crack Sealing - PCC	\$0.00	0.00	False	-
06-01-1992	CR-PC	Complete Reconstruction - PCC	\$0.00	6.00	True	-
06-02-1966	NC-PC	New Construction - PCC	\$0.00	6.00	True	6" PCC
06-01-1966	SB-AG	Subbase - Aggregate	\$0.00	6.00	False	6" P-154

WORK HISTORY

Pavement Database: IA 2023

Generate Date: 4/30/2024

Network ID: EOK

Page 5

Branch - Section ID: **TBKE - 002**

LCD: 6/1/1992
 Use: TAXIWAY
 Rank: P
 Surface: PCC

Length (ft): 566.00
 Width (ft): 40.00
 True Area (sf): 23,080.21

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
10-31-2010	JS-LC	Joint Seal (Localized)	\$0.00	0.00	False	-
10-31-2010	CS-PC	Crack Sealing - PCC	\$0.00	0.00	False	-
10-31-2010	PA-PP	Patching - PCC Partial Depth	\$0.00	0.00	False	-
06-01-1992	CR-PC	Complete Reconstruction - PCC	\$0.00	0.00	True	-
06-02-1966	NC-PC	New Construction - PCC	\$0.00	6.00	True	6" PCC
06-01-1966	SB-AG	Subbase - Aggregate	\$0.00	6.00	False	6" P-154

Branch - Section ID: **TBKE - 003**

LCD: 8/1/1995
 Use: TAXIWAY
 Rank: P
 Surface: PCC

Length (ft): 90.00
 Width (ft): 40.00
 True Area (sf): 5,577.08

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
10-31-2010	CS-PC	Crack Sealing - PCC	\$0.00	0.00	False	-
10-31-2010	PA-PP	Patching - PCC Partial Depth	\$0.00	0.00	False	-
10-31-2010	JS-LC	Joint Seal (Localized)	\$0.00	0.00	False	-
08-01-1995	NC-IN	New Construction - Initial	\$0.00	0.00	True	-

Branch - Section ID: **TBKE - 004**

LCD: 7/3/2013
 Use: TAXIWAY
 Rank: P
 Surface: PCC

Length (ft): 214.00
 Width (ft): 40.00
 True Area (sf): 12,390.41

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
07-03-2013	CR-PC	Complete Reconstruction - PCC	\$0.00	7.00	True	7" P501 PCC
07-02-2013	BA-AG	Base Course - Aggregate	\$0.00	4.00	False	4" P209 AGG
07-01-2013	SG-ST	Subgrade - Stabilized	\$0.00	6.00	False	6" LIME TREATED
10-31-2010	JS-LC	Joint Seal (Localized)	\$0.00	0.00	False	-
10-31-2010	PA-PP	Patching - PCC Partial Depth	\$0.00	0.00	False	-
10-31-2010	CS-PC	Crack Sealing - PCC	\$0.00	0.00	False	-
06-01-1997	CR-PC	Complete Reconstruction - PCC	\$0.00	0.00	True	-
07-31-1991	NC-PC	New Construction - PCC	\$0.00	0.00	True	-
06-02-1966	NC-PC	New Construction - PCC	\$0.00	6.00	True	6" PCC
06-01-1966	SB-AG	Subbase - Aggregate	\$0.00	6.00	False	6" P-154

WORK HISTORY

Pavement Database: IA 2023

Generate Date: 4/30/2024

Network ID: EOK

Page 6

Branch - Section ID: TCKE - 001

LCD: 7/2/2013
 Use: TAXIWAY
 Rank: P
 Surface: PCC

Length (ft): 200.00
 Width (ft): 40.00
 True Area (sf): 7,579.17

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
07-02-2013	CR-PC	Complete Reconstruction - PCC	\$0.00	7.00	True	7" P501 PCC
07-01-2013	BA-AG	Base Course - Aggregate	\$0.00	4.00	False	4" P209 AGG
10-31-2010	PA-PP	Patching - PCC Partial Depth	\$0.00	0.00	False	-
10-31-2010	CS-PC	Crack Sealing - PCC	\$0.00	0.00	False	-
10-31-2010	JS-LC	Joint Seal (Localized)	\$0.00	0.00	False	-
07-31-1991	NC-PC	New Construction - PCC	\$0.00	0.00	True	-
06-02-1966	NC-PC	New Construction - PCC	\$0.00	6.00	True	6" PCC
06-01-1966	SB-AG	Subbase - Aggregate	\$0.00	6.00	False	6" P-154

Branch - Section ID: TCKE - 002

LCD: 6/2/1966
 Use: TAXIWAY
 Rank: P
 Surface: PCC

Length (ft): 1,437.00
 Width (ft): 40.00
 True Area (sf): 58,474.77

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
10-31-2010	PA-PP	Patching - PCC Partial Depth	\$0.00	0.00	False	-
10-31-2010	JS-LC	Joint Seal (Localized)	\$0.00	0.00	False	-
10-31-2010	CS-PC	Crack Sealing - PCC	\$0.00	0.00	False	-
06-02-1966	NC-PC	New Construction - PCC	\$0.00	6.00	True	6" PCC
06-01-1966	SB-AG	Subbase - Aggregate	\$0.00	6.00	False	6" P-154

Branch - Section ID: TCKE - 003

LCD: 8/1/1995
 Use: TAXIWAY
 Rank: P
 Surface: PCC

Length (ft): 90.00
 Width (ft): 40.00
 True Area (sf): 6,228.99

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
10-31-2010	PA-PP	Patching - PCC Partial Depth	\$0.00	0.00	False	-
10-31-2010	JS-LC	Joint Seal (Localized)	\$0.00	0.00	False	-
10-31-2010	CS-PC	Crack Sealing - PCC	\$0.00	0.00	False	-
08-01-1995	NC-IN	New Construction - Initial	\$0.00	0.00	True	-
06-02-1966	NC-PC	New Construction - PCC	\$0.00	6.00	True	6" PCC
06-01-1966	SB-AG	Subbase - Aggregate	\$0.00	6.00	False	6" P-154

Branch - Section ID: TDKE - 001

LCD: 7/3/2013
 Use: TAXIWAY
 Rank: P
 Surface: PCC

Length (ft): 218.00
 Width (ft): 35.00
 True Area (sf): 12,226.40

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
07-03-2013	CR-PC	Complete Reconstruction - PCC	\$0.00	7.00	True	7" P501
07-02-2013	BA-AG	Base Course - Aggregate	\$0.00	4.00	False	4" P209 AGG
07-01-2013	SG-ST	Subgrade - Stabilized	\$0.00	6.00	False	6" LIME TREATED
06-01-1997	NC-IN	New Construction - Initial	\$0.00	0.00	True	-

WORK HISTORY

Pavement Database: IA 2023

Generate Date: 4/30/2024

Network ID: EOK

Page 7

Branch - Section ID: TEKE - 001

LCD: 6/1/1997
 Use: TAXIWAY
 Rank: P
 Surface: APC

Length (ft): 305.00
 Width (ft): 40.00
 True Area (sf): 17,103.22

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
06-01-1997	OL-AC	Overlay - AC	\$0.00	0.00	True	-
06-01-1979	OL-AC	Overlay - AC	\$0.00	0.00	True	-
06-02-1966	NC-PC	New Construction - PCC	\$0.00	8.00	True	8" PCC
06-01-1966	SB-AG	Subbase - Aggregate	\$0.00	12.00	False	12" P-154 SUBBASE

Branch - Section ID: TH01KE - 001

LCD: 1/1/2006
 Use: T-HANGAR
 Rank: P
 Surface: PCC

Length (ft): 765.00
 Width (ft): 25.00
 True Area (sf): 23,489.00

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major MR	Comments
06-01-2019	JS-LC	Joint Seal (Localized)	\$0.00	0.00	False	Field est. Localized joint seal repair
01-01-2006	CR-PC	Complete Reconstruction - PCC	\$0.00	0.00	True	LCD USING GOOGLE EARTH

APPENDIX E

LOCALIZED PREVENTIVE MAINTENANCE POLICIES AND UNIT COST TABLES

Table E-1. Localized preventive maintenance policy, asphalt-surfaced pavements.

Distress Type	Severity Level	Maintenance Action
Alligator Cracking	Low	Monitor
Alligator Cracking	Medium	Asphalt Patch
Alligator Cracking	High	Asphalt Patch
Bleeding	N/A	Monitor
Block Cracking	Low	Monitor
Block Cracking	Medium	Crack Seal—Asphalt
Block Cracking	High	Crack Seal—Asphalt
Corrugation	Low	Monitor
Corrugation	Medium	Asphalt Patch
Corrugation	High	Asphalt Patch
Depression	Low	Monitor
Depression	Medium	Monitor
Depression	High	Asphalt Patch
Jet-Blast Erosion	N/A	Asphalt Patch
Joint Reflection Cracking	Low	Monitor
Joint Reflection Cracking	Medium	Crack Seal—Asphalt
Joint Reflection Cracking	High	Crack Seal—Asphalt
L&T Cracking	Low	Monitor
L&T Cracking	Medium	Crack Seal—Asphalt
L&T Cracking	High	Crack Seal—Asphalt
Oil Spillage	N/A	Asphalt Patch
Patching	Low	Monitor
Patching	Medium	Asphalt Patch
Patching	High	Asphalt Patch
Polished Aggregate	N/A	Monitor
Raveling	Low	Monitor
Raveling	Medium	Asphalt Patch
Raveling	High	Asphalt Patch
Rutting	Low	Monitor
Rutting	Medium	Monitor
Rutting	High	Asphalt Patch
Shoving	Low	Monitor
Shoving	Medium	Asphalt Patch
Shoving	High	Asphalt Patch
Slippage Cracking	N/A	Asphalt Patch
Swelling	Low	Monitor
Swelling	Medium	Monitor
Swelling	High	Asphalt Patch
Weathering	Low	Monitor
Weathering	Medium	Monitor
Weathering	High	Asphalt Patch

Table E-2. Localized preventive maintenance policy, PCC pavements.

Distress Type	Severity Level	Maintenance Action
ASR	Low	Monitor
ASR	Medium	Slab Replacement
ASR	High	Slab Replacement
Blowup	Low	Slab Replacement
Blowup	Medium	Slab Replacement
Blowup	High	Slab Replacement
Corner Break	Low	Crack Seal—PCC
Corner Break	Medium	Full Depth PCC Patch
Corner Break	High	Full Depth PCC Patch
Durability Cracking	Low	Monitor
Durability Cracking	Medium	Full Depth Patch
Durability Cracking	High	Slab Replacement
Faulting	Low	Monitor
Faulting	Medium	Grinding
Faulting	High	Slab Replacement
Joint Seal Damage	Low	Monitor
Joint Seal Damage	Medium	Joint Seal
Joint Seal Damage	High	Joint Seal
LTD Cracking	Low	Monitor
LTD Cracking	Medium	Crack Seal—PCC
LTD Cracking	High	Slab Replacement
Patching (Small and Large)	Low	Monitor
Patching (Small and Large)	Medium	Full Depth PCC Patch
Patching (Small and Large)	High	Full Depth PCC Patch
Popouts	N/A	Monitor
Pumping	N/A	Monitor
Scaling	Low	Monitor
Scaling	Medium	Partial Depth PCC Patch
Scaling	High	Slab Replacement
Shattered Slab	Low	Crack Seal—PCC
Shattered Slab	Medium	Slab Replacement
Shattered Slab	High	Slab Replacement
Shrinkage Cracking	N/A	Monitor
Spalling (Joint and Corner)	Low	Monitor
Spalling (Joint and Corner)	Medium	Partial Depth PCC Patch
Spalling (Joint and Corner)	High	Partial Depth PCC Patch

Table E-3. 2024 unit costs for localized preventive maintenance actions.

Maintenance Action	Unit Cost
Asphalt Patch—Asphalt-Surfaced Pavement	\$15.54/sf
Crack Sealing—Asphalt-Surfaced Pavement	\$2.66/lf
Partial Depth PCC Patch—PCC Pavement	\$39.82/sf
Full Depth PCC Patch—PCC Pavement	\$17.78/sf
Crack Sealing—PCC Pavement	\$3.20/lf
Joint Sealing—PCC Pavement	\$3.20/lf
Grinding—PCC Pavement	\$0.38/sf
Slab Replacement—PCC Pavement	\$17.78/sf

Table Note: The unit cost estimates are based on broad statewide numbers and should be adjusted to reflect local costs.

Table E-4. 2024 unit costs (per square foot) based on pavement type and PCI ranges.

Pavement Type	PCI Range 0-40	PCI Range 40-50	PCI Range 50-60	PCI Range 60-70	PCI Range 70-80	PCI Range 80-90	PCI Range 90-100
AC	\$11.04	\$5.22	\$5.22	\$5.22	\$0.00	\$0.00	\$0.00
PCC	\$18.44	\$8.72	\$8.72	\$8.72	\$0.00	\$0.00	\$0.00

Table Note: The unit cost estimates are based on broad statewide numbers and should be adjusted to reflect local costs.

APPENDIX F

YEAR 2024 LOCALIZED PREVENTIVE MAINTENANCE DETAILS

Table F-1. Year 2024 localized preventive maintenance details.

Branch	Section	Distress Type	Severity	Distress Quantity	Distress Unit	Maintenance Action	Unit Cost	2024 Estimated Cost
A01KE	03	Joint Spalling	Medium	5	Slabs	Patching - PCC Partial Depth	\$39.82	\$1,286
A01KE	03	Joint Seal Damage	Medium	20	Slabs	Joint Seal (Localized)	\$3.20	\$1,451
A01KE	03	LTD Cracking	Medium	1	Slabs	Crack Sealing - PCC	\$3.20	\$46
A01KE	03	Corner Spalling	Medium	1	Slabs	Patching - PCC Partial Depth	\$39.82	\$107
A01KE	04	Joint Spalling	Medium	1	Slabs	Patching - PCC Partial Depth	\$39.82	\$257
R08KE	01	Scaling	Medium	56	Slabs	Patching - PCC Partial Depth	\$39.82	\$114,493
R08KE	01	ASR	Medium	9	Slabs	Slab Replacement - PCC	\$17.78	\$25,970
R08KE	01	Joint Spalling	Medium	19	Slabs	Patching - PCC Partial Depth	\$39.82	\$4,808
R14KE	01	Joint Spalling	Medium	12	Slabs	Patching - PCC Partial Depth	\$39.82	\$3,115
R14KE	01	Joint Seal Damage	High	969	Slabs	Joint Seal (Localized)	\$3.20	\$72,387
R14KE	02	Joint Seal Damage	High	1,025	Slabs	Joint Seal (Localized)	\$3.20	\$76,561
R14KE	02	Corner Spalling	Medium	6	Slabs	Patching - PCC Partial Depth	\$39.82	\$686
R14KE	02	Joint Spalling	Medium	19	Slabs	Patching - PCC Partial Depth	\$39.82	\$4,943
R14KE	04	Scaling	Medium	1	Slabs	Patching - PCC Partial Depth	\$39.82	\$2,450
TAKE	03	ASR	Medium	2	Slabs	Slab Replacement - PCC	\$17.78	\$3,643
TAKE	03	Joint Seal Damage	High	281	Slabs	Joint Seal (Localized)	\$3.20	\$14,484
TAKE	04	Small Patch	High	8	Slabs	Patching - PCC Full Depth	\$17.78	\$396
TAKE	04	ASR	Medium	17	Slabs	Slab Replacement - PCC	\$17.78	\$25,726
TAKE	04	Joint Seal Damage	Medium	1,819	Slabs	Joint Seal (Localized)	\$3.20	\$94,478
TAKE	06	Corner Spalling	Medium	1	Slabs	Patching - PCC Partial Depth	\$39.82	\$107
TAKE	06	Joint Seal Damage	High	66	Slabs	Joint Seal (Localized)	\$3.20	\$3,280
TAKE	06	Joint Spalling	Medium	1	Slabs	Patching - PCC Partial Depth	\$39.82	\$257
TBKE	01	Joint Seal Damage	High	188	Slabs	Joint Seal (Localized)	\$3.20	\$13,806
TBKE	01	Corner Spalling	Medium	2	Slabs	Patching - PCC Partial Depth	\$39.82	\$168

Table F-1. Year 2024 localized preventive maintenance details (continued).

Branch	Section	Distress Type	Severity	Distress Quantity	Distress Unit	Maintenance Action	Unit Cost	2024 Estimated Cost
TBKE	01	Joint Spalling	Medium	5	Slabs	Patching - PCC Partial Depth	\$39.82	\$1,209
TBKE	01	ASR	Medium	3	Slabs	Slab Replacement - PCC	\$17.78	\$9,749
TBKE	01	Corner Spalling	High	2	Slabs	Patching - PCC Partial Depth	\$39.82	\$168
TBKE	01	Scaling	Medium	5	Slabs	Patching - PCC Partial Depth	\$39.82	\$7,675
TBKE	01	Small Patch	High	2	Slabs	Patching - PCC Full Depth	\$17.78	\$75
TBKE	02	Joint Seal Damage	High	126	Slabs	Joint Seal (Localized)	\$3.20	\$9,445
TBKE	02	Joint Spalling	Medium	9	Slabs	Patching - PCC Partial Depth	\$39.82	\$2,430
TBKE	02	LTD Cracking	Medium	6	Slabs	Crack Sealing - PCC	\$3.20	\$285
TBKE	04	Joint Spalling	Medium	3	Slabs	Patching - PCC Partial Depth	\$39.82	\$723
TBKE	04	Joint Seal Damage	High	22	Slabs	Joint Seal (Localized)	\$3.20	\$1,250
TCKE	03	Joint Seal Damage	Medium	38	Slabs	Joint Seal (Localized)	\$3.20	\$2,099
TCKE	03	Joint Seal Damage	High	17	Slabs	Joint Seal (Localized)	\$3.20	\$939
TDKE	01	Joint Seal Damage	High	60	Slabs	Joint Seal (Localized)	\$3.20	\$2,942
TDKE	01	Joint Spalling	Medium	3	Slabs	Patching - PCC Partial Depth	\$39.82	\$883
TH01KE	01	Joint Seal Damage	Medium	313	Slabs	Joint Seal (Localized)	\$3.20	\$11,263
TH01KE	01	Corner Break	Medium	4	Slabs	Patching - PCC Full Depth	\$17.78	\$2,138
TH01KE	01	Joint Seal Damage	High	82	Slabs	Joint Seal (Localized)	\$3.20	\$2,950
TH01KE	01	Corner Break	Low	15	Slabs	Crack Sealing - PCC	\$3.20	\$391

Table Notes:

1. See Figure 3 for the location of the branch and section.
2. Distress types are defined by ASTM D5340-20. L&T Cracking = Longitudinal and Transverse Cracking; LTD Cracking = Longitudinal, Transverse, and Diagonal Cracking; ASR = Alkali-Silica Reaction.
3. The costs provided are of a general nature for the entire state and may require adjustment to reflect specific conditions at Keokuk Municipal Airport.



PREPARED FOR

Iowa Department of Transportation
Modal Transportation Bureau – Aviation
800 Lincoln Way
Ames, Iowa 50010
515-239-1691
<https://iowadot.gov/aviation>

JULY 2024